



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/12/2023		M57 Pretoria Road - 1619
Inspection Date	18/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	JEEP	Registration Number	KD11KLGP
Model	WRANGLER	Register Number	
VIN	1C4BJWJG2CL265719	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	31/05/2023
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	113,057 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Seat Front Left Damaged	Repair
Seat Front Right Dirty	Repair
Front Bumper Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Steering Stopper Left Defective	Replace
Steering Stopper Right Defective	Replace
Control Arm Bush(es) Front Axle Right Defective	Replace
Engine mountings Cracked	Replace
Gearbox Oil Sweat	Repair
Differential Oil Sweat	Repair
Radiator Cradle Dented	Repair
Triangle Missing	Replace
Tyre pressure warning light intermittent	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 1C4BJWJG2CL265719

1 / 12



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/70 R17	115T	Goodyear	Wrangler	V	4120	7 mm
Front Right	265/70 R17	115T	Goodyear	Wrangler	V	1020	7 mm
Rear Left	265/70 R17	115T	Goodyear	Wrangler	V	3219	7 mm
Rear Right	265/70 R17	115T	Goodyear	Wrangler	V	1020	7 mm
Spare	265/70 R17	115T	Copper	Discoverer	V	3812	9 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM(ENGINE CONTROL MODULE)	P0369	CAMSHAFT POSITION(CMP) SENSOR INTERMITTENT-BANK 1	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Engine Compartment: Engine bay dirty. Brake fluid level ok.

Interior: Vehicle interior dirty and some interior panels scratched.

Body • Exterior: Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels. Roof rails scratched.

Axle and Suspension: Abnormal noise coming from front and rear suspension.

Tyres and Rims: Alloy rims scratched.

Undercarriage: Vehicle undercarriage dirty. Signs of surface rust on undercarriage

Road Test: 4x4 low and high range struggles to select.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za




CONDITION REPORT


Report No: 2016207425

2 / 12
DATE


18/12/2023

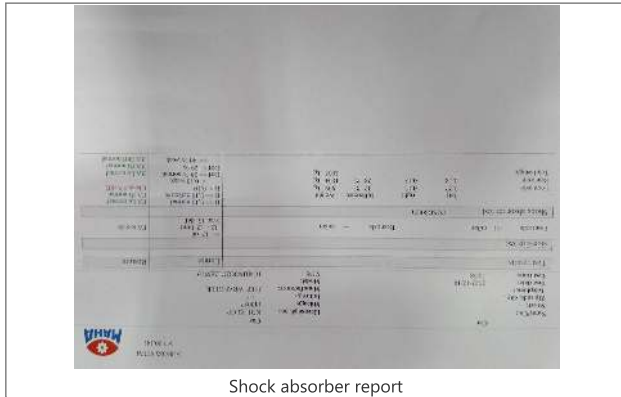

Shock absorber report

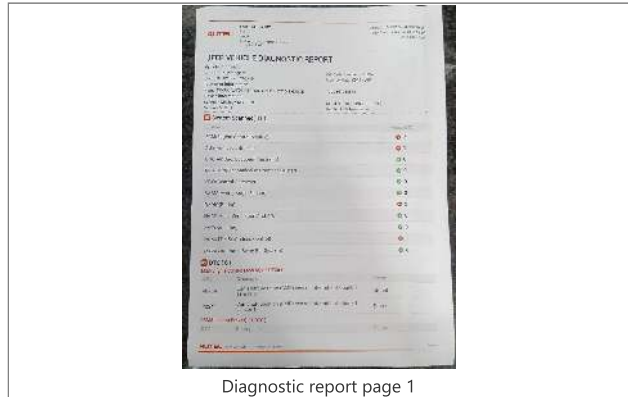

Diagnostic report page 1

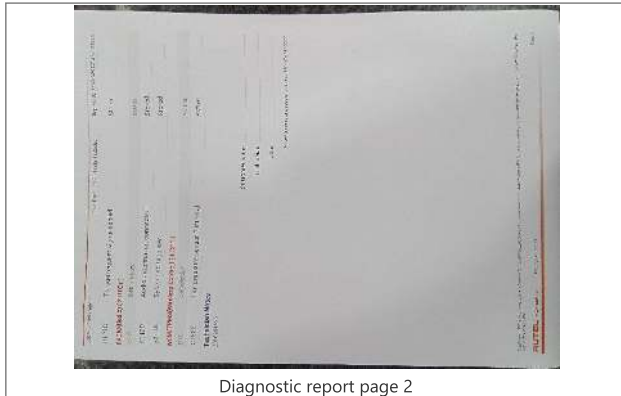

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

VIN: 1C4BJWJG2CL265719

DATE

18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE: 12/19/2023
VIN: 1C4BJWJG3C04252023
4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

VIN: 1C4BJWJG2CL265719

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

VIN: 1C4BJWJG2CL265719

6 / 12




LF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD

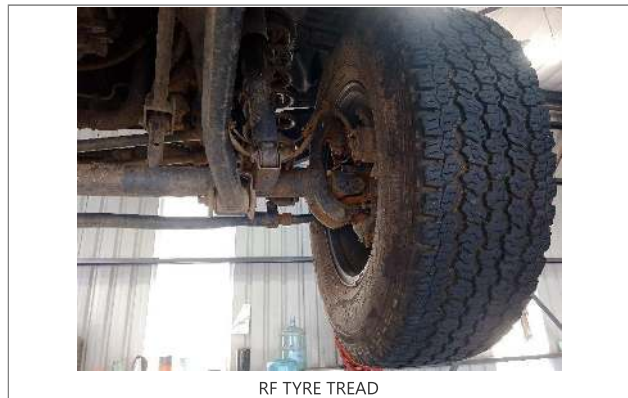

RF TYRE TREAD

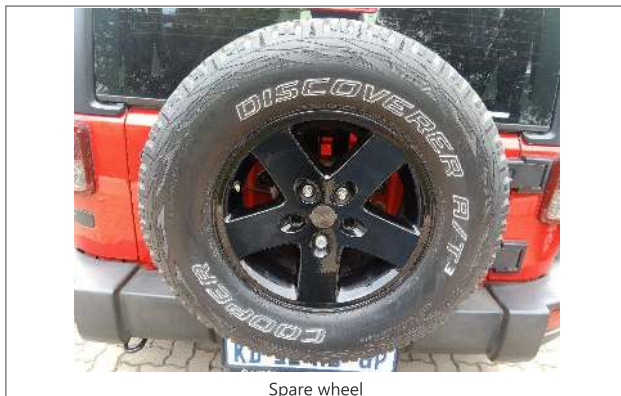

Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

VIN: 1C4BJWJG2CL265719
7 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Spare wheel Accessories



Manual Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

VIN: 1C4BJWJG2CL265719

9 / 12


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

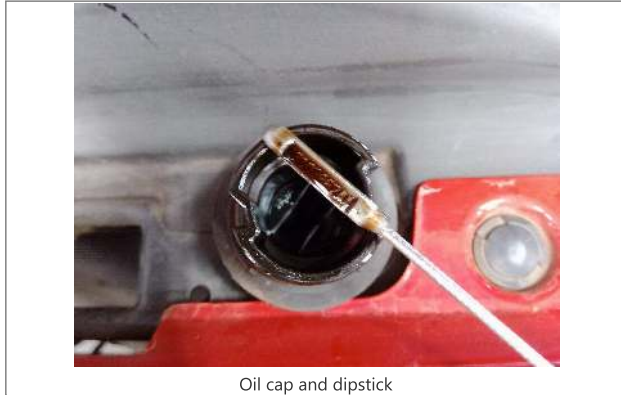

Oil cap and dipstick




Door Front Left

VIN: CA8JG2CL265719
10 / 12



Rear Fender Left

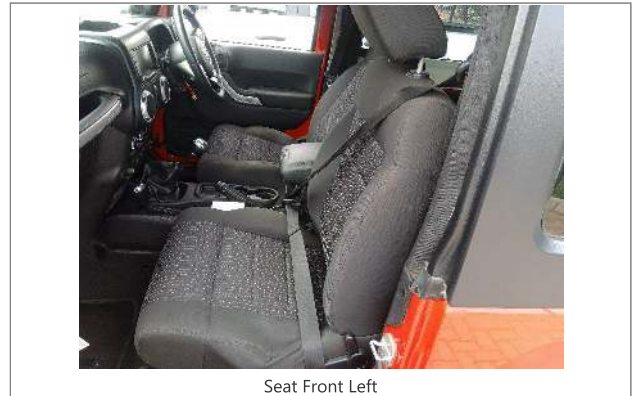

Seat Front Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

VIN: 1C4BJWJG2CL265719
11 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023



Rear Fender Right



Front Bumper


265719
12 / 12



Front Bumper



Seat Front Right

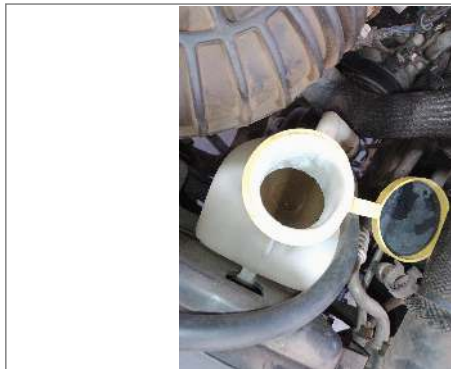

Water level



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

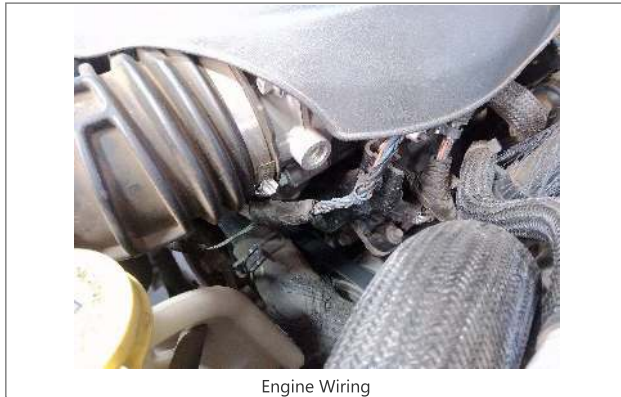


Engine Wiring



Engine Wiring



Windscreen

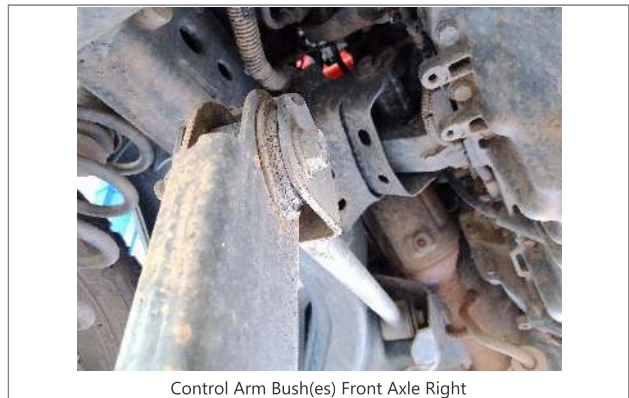

Control Arm Bush(es) Front Axle Right



Engine



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

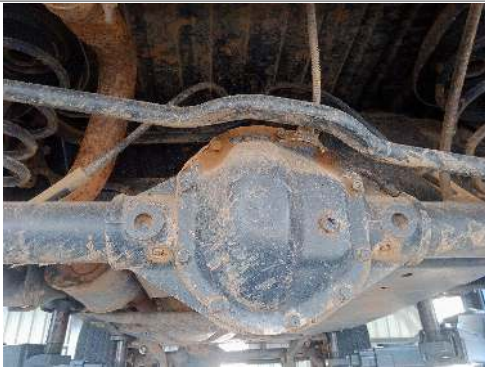

Differential




Steering Stopper Left




Steering Stopper Right



Engine mountings

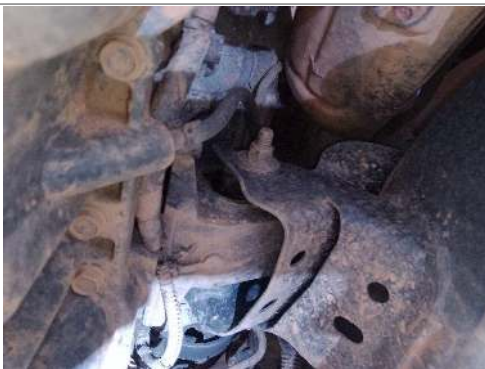

Engine mountings

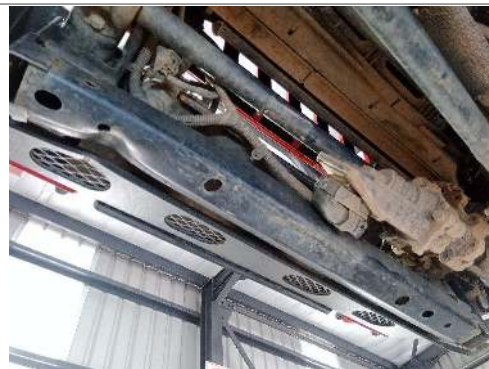

Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



Engine Wiring



Engine Wiring



CONDITION REPORT

Report No: 2016204425

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za