



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	MS95SSGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZLU006672	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2019	Fuel	PETROL
Km Reading	231,413 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026

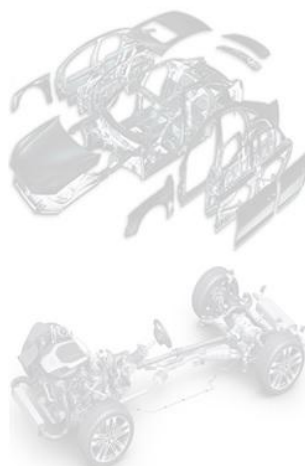

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Bonnet cable Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Replace
Switch Electrical Window Winder front left Damaged	Replace
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Tail Light Left Cracked	Replace
Tail Light Right Cracked	Replace
Headlight Left Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Sun Visor Right Dirty	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Parcel Tray Damaged	Replace
Steering Wheel Trim Damaged	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
C • Pillar Left Dented	Repair
Front Fender Left Damaged	Replace
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Replace
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Tie Rod End left Cracked	Replace
Rear Axle Damaged	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Worn	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Chassis Damaged	Repair
Sub Frame Damaged	Repair
Engine to silencer pipe Damaged	Repair
Belly plates Damaged	Repair
Fuel Tank Damaged	Repair
Fuel Lines Damaged	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026

Damage	Repair Way
Radiator Cradle Damaged	Replace
Brakes Malfunction	Repair
Triangle Missing	Replace
Front emblem cracked	Replace
Center exhaust cross member bracket damaged	Replace
Engine oil sump dented	Repair
Front bumper stiffener damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.65	-	
Rear	1.52	0.99	-	
Emergency / Parking	1.14	0.67	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	88H	Autogrip	Grip200	V	1323	0 mm
Front Right	185/60 R15	88H	Autogrip	Grip200	V	1323	0 mm
Rear Left	185/60 R15	84H	Hilo	Genesys	V	0124	1 mm
Rear Right	185/65 R15	88T	Hankook	Kinergy	V	1023	0 mm
Spare	185/60 R14	82H	Goodyear	Efficient	V	4119	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	09-ELECTRONIC CENTRAL ELECTRIC	03429:011	ACTIVATION OF RIGHT CORNERING LIGHT-OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. Engine Compartment: Signs of rodents in the engine bay. The radiator and air conditioning condenser were loose. Interior: The vehicle interior was dirty, and the panels were scratched. An aftermarket sound system was fitted to the vehicle.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026

Body • Exterior: Poor residual traces of repair on body panels. Body panels were misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of impact damage to the front of the vehicle.

Axle and Suspension: Front suspension faulty.

Undercarriage: Signs of surface rust on the undercarriage. The vehicle's undercarriage was dirty.

Road Test: Vehicle unsafe to drive.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:

2017296379

DATE

09/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



FRONT CHASSIS



REAR CHASSIS



OIL CAP AND DIPSTICK

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:

2017296379

DATE

09/09/2026



CENTER CROSS MEMBER



ENGINE OIL SUMP



FRONT EMBLEM



SPARE WHEEL AND ACCESSORIES



FRONT BUMPER STIFFENER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT




Report No:
2017296379
DATE
09/09/2026




VIN PLATE OR STICKER

EUBOTEM				EUBOTEM	
V.3.00.143					
Car			Car		
Make/Car			License pl. no.	5559150P	
Adress			Usage:	21414	
Zip code, city			Lab. no.		
Telephone			Manufacturer	VEB PECO VPO	
Year built	2004/04/03		Model	AAZ2200H10ACT	
Test time	10/10		YIN		
Test results			Results		
side-slip test					
Test speed	50 km/h	Test speed	10 km/h	10 km/h	10 km/h
			10 km/h	10 km/h	10 km/h
Shock absorber test					
DEFORMER					
Front axle	left	right	Difference	Weight	
	6,30	6,24	0,06	110 kg	
Rear axle	6,30	6,22	0,08	125 kg	
Total weight				235 kg	
Brake test					
Brake force			Brake force		
Front axle	2,76 MPa	2,87 MPa	1,11 MPa	1,11 MPa	1,11 MPa
Rear axle	1,14 MPa	0,97 MPa	0,17 MPa	0,17 MPa	0,17 MPa
Parking brake	1,22 MPa	0,92 MPa	0,30 MPa	0,30 MPa	0,30 MPa
Deceleration test					
Deceleration parking brake					
			Total weight	1225 kg	

BRAKE AND SHOCK TEST REPORT

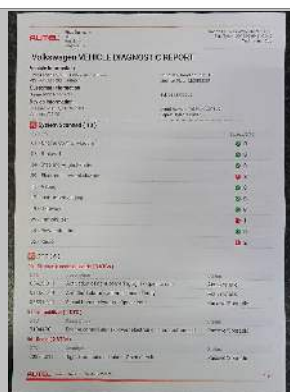

DIAGNOSTIC REPORT PAGE 1

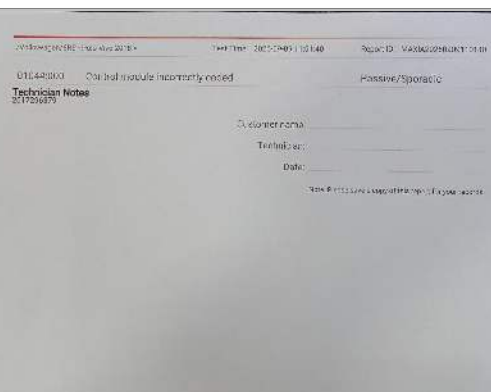

Diagnostic report page 2



Center Console / Cubbyhole + Lid



Sun Visor Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Hood Lining



Steering Wheel Trim




Bonnet cable



Door Sealing Rubber Front Right



Seat Front Right

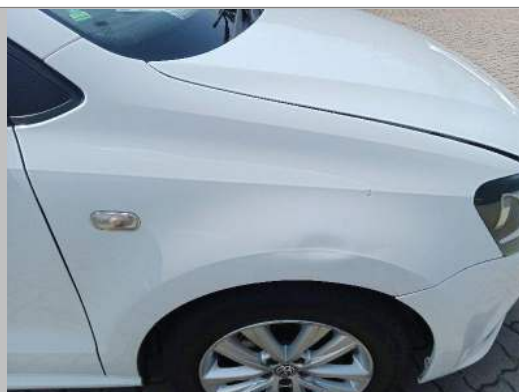

Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:

2017296379

DATE

09/09/2026



Door Front Right



Door Front Right



Door Rear Right



Rear Fender Right



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Door Rear Left



C • Pillar Left



Seat Front Left



Switch Electrical Window Winder front left



Door Front Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Side Mirror Left



Indicator Light Front Left



Bonnet



Boot Lid / Hatch door



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Rear bumper




Parcel Tray



Tail Light Left



Tail Light Right

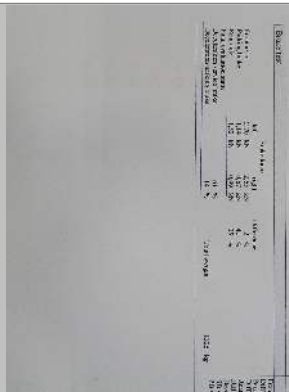

Service Brake Performance Rear Axle



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Water level



Engine Wiring



Headlight Left



Front Fender Right / Inner Tray



Rim Front Right



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Sill Panel Right



Front Bumper



Front Bumper



Front Bumper



Front Fender Left / Inner Tray



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Rim Front Left



Sill Panel Left



Sill Panel Left



Rim Rear Left



Rim Rear Right



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Engine to silencer pipe



Sub Frame



Sub Frame



CV Joint(s) Boot(s) Front Right (inner/outer)



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Chassis




Belly plates



Fuel Tank



Fuel Lines

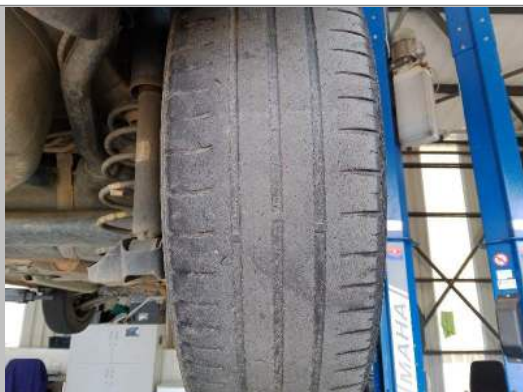

Tyre Rear Right



Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672




CONDITION REPORT



Report No:
2017296379
DATE
09/09/2026



Belly plates

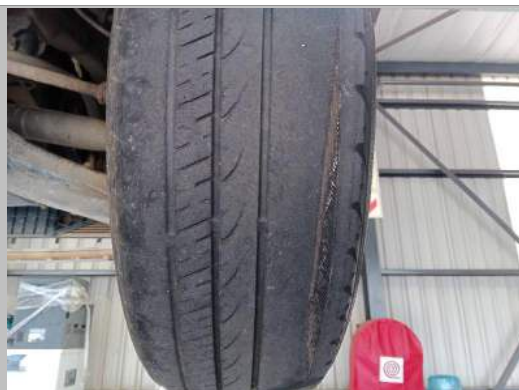

Tyre Front Right



Tyre Front Left



Tie Rod End left



Engine



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZLU006672



CONDITION REPORT



Report No:

2017296379

DATE

09/09/2026



Radiator Cradle



Indicator Light Front Right



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: AAVZZZ6RZLU006672