



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/08/2026		M57 Pretoria Road - 1619
Inspection Date	20/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JX57BDGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2020-2022]	Register Number	
VIN	AAVZZZ6RZMU009509	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	C - COMMON
Km Reading	101,916 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026

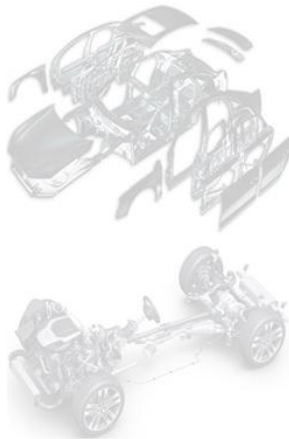

Damage	Repair Way
Engine Wiring Defective	Repair
Air cleaner Defective	Repair
Bonnet cable Missing	Repair
Radio/CD/USB Defective	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder front right Missing	Replace
Air Conditioner Insufficient	Repair
Indicator Light Front Right Missing	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Fuse box and fuses Defective	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Door Hinges Front Left Defective	Replace
Door Hinges Front Right Defective	Replace
Door Hinges Rear Left Defective	Replace
Window Winder rear left Missing	Replace
Window Winder rear right Missing	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Worn	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Hail damaged on body panels	Report
Boot does not open, electronics malfunction	Repair
Some body panels misaligned	Repair
Rear tyre size differs	Replace
both front CV joints excessive noise	Replace
Warning lights illuminated	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.7	-	
Rear	1.3	1.5	-	
Emergency / Parking	1	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R15	84H	Kumho	Solus	V	2314	1 mm
Front Right	175/65R15	84H	Wanli	S1023	V	3813	1 mm
Rear Left	185/60R14	86H	Radar	RPX	V	1420	0 mm
Rear Right	175/70R14	84T	Continental	Contact	V	4618	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P0030:00/00048:000	02 SENSOR HEATER CONTROL CIR BANK	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026

SHOCK AND BRAKE REPORT			
Client Name	Client Address	Client City	Client Postcode
Client Phone	Client Email	Client Vehicle	Client VIN
Client Licence	Client Insurance	Client Make	Client Model
Client Year	Client Colour	Client Engine	Client Gear
Client Tyres	Client Wheels	Client Brakes	Client Suspension
Client Steering	Client Chassis	Client Exhaust	Client Lights
Client Windows	Client Doors	Client Seats	Client Interior
Client Exterior	Client Paint	Client Body	Client Trim
Client Accessories	Client Tools	Client Spare	Client Documents
Client Remarks	Client Notes	Client Signature	Client Date

Shock and brake report

DIAGNOSTICS REPORT			
Client Name	Client Address	Client City	Client Postcode
Client Phone	Client Email	Client Vehicle	Client VIN
Client Licence	Client Insurance	Client Make	Client Model
Client Year	Client Colour	Client Engine	Client Gear
Client Tyres	Client Wheels	Client Brakes	Client Suspension
Client Steering	Client Chassis	Client Exhaust	Client Lights
Client Windows	Client Doors	Client Seats	Client Interior
Client Exterior	Client Paint	Client Body	Client Trim
Client Accessories	Client Tools	Client Spare	Client Documents
Client Remarks	Client Notes	Client Signature	Client Date

Diagnostics report

DIAGNOSTICS REPORT			
Client Name	Client Address	Client City	Client Postcode
Client Phone	Client Email	Client Vehicle	Client VIN
Client Licence	Client Insurance	Client Make	Client Model
Client Year	Client Colour	Client Engine	Client Gear
Client Tyres	Client Wheels	Client Brakes	Client Suspension
Client Steering	Client Chassis	Client Exhaust	Client Lights
Client Windows	Client Doors	Client Seats	Client Interior
Client Exterior	Client Paint	Client Body	Client Trim
Client Accessories	Client Tools	Client Spare	Client Documents
Client Remarks	Client Notes	Client Signature	Client Date

Diagnostics report

DIAGNOSTICS REPORT			
Client Name	Client Address	Client City	Client Postcode
Client Phone	Client Email	Client Vehicle	Client VIN
Client Licence	Client Insurance	Client Make	Client Model
Client Year	Client Colour	Client Engine	Client Gear
Client Tyres	Client Wheels	Client Brakes	Client Suspension
Client Steering	Client Chassis	Client Exhaust	Client Lights
Client Windows	Client Doors	Client Seats	Client Interior
Client Exterior	Client Paint	Client Body	Client Trim
Client Accessories	Client Tools	Client Spare	Client Documents
Client Remarks	Client Notes	Client Signature	Client Date

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD



RR TYRE TREAD



LR TYRE TREAD

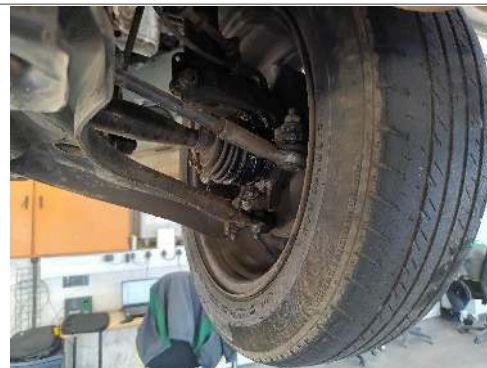

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Sider cover missing



Oil cap and dipstick



Expansion bottle



R/F fender liner missing



L/F fender liner missing



L/R fender liner missing

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



R/R fender liner missing



Warning lights illuminated



Seat Rear



Center Console / Cubbyhole + Lid



Radio/CD/USB



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Air Conditioner



Bonnet cable



Fuse box and fuses



Switch Electrical Window Winder front right



Seat Front Right



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Roof



Side Mirror Right



Side Mirror Right



Indicator Light Front Right



Front Fender Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Door Rear Right



Window Winder rear right



Tail Light Right



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Tail Light Left



Door Rear Left



Window Winder rear left



Door Rear Left



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Side Mirror Left




Bonnet



Headlight Left



Headlight Right

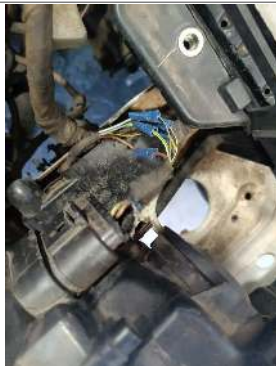

Engine Wiring



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509




CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Air cleaner

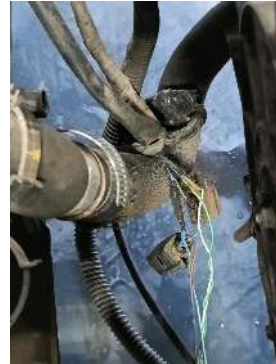

Engine Wiring



Engine Wiring



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Front Bumper



Front Bumper



Front Bumper



Grill



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Rear bumper



Rear bumper



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Stabilizer Mounting Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Stabilizer Mounting Front Right



Engine Wiring



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Left (inner/outer)



Door Hinges Rear Left



Door Hinges Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509



CONDITION REPORT



Report No:
2017287377
DATE
20/08/2026



Door Hinges Front Left



Door Hinges Front Left



Door Hinges Front Right



Door Hinges Front Right



Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU009509