

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/12/2023		M57 Pretoria Road - 1619
Inspection Date	20/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KF89WRGP
Model	POLO VIVO	Register Number	
VIN	AAVZZZ6RZMU018164	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2022
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	51,164 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
A • Pillar Right Damaged	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Right Torn / Cut	
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	3.2	-	
Rear	1.4	1.5	-	
Emergency / Parking	0.8	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Ling long	Green-max	V	2121	3 mm
Front Right	185/60R15	84H	Continental	Contact	V	1921	3 mm
Rear Left	185/60R15	84H	Continental	Contact	V	0515	2 mm
Rear Right	195/55R15	85V	Continental	Contact	V	1308	3 mm
Spare	185/65R14	86H	Onyx	Ny-801	V	0120	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels
Axle and Suspension: No shock test done due to shock machine not working

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

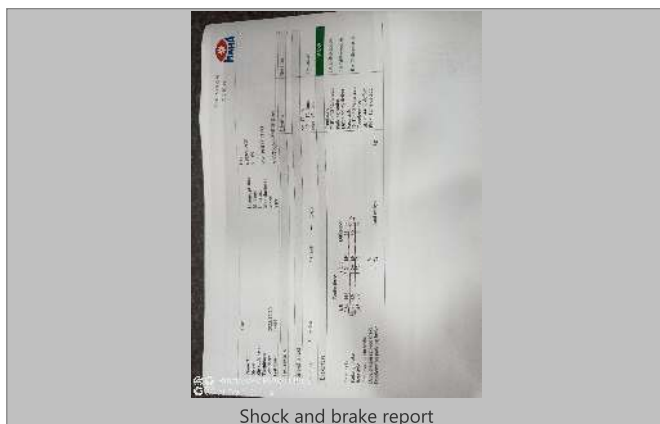


Shock and brake report



Diagnostic report

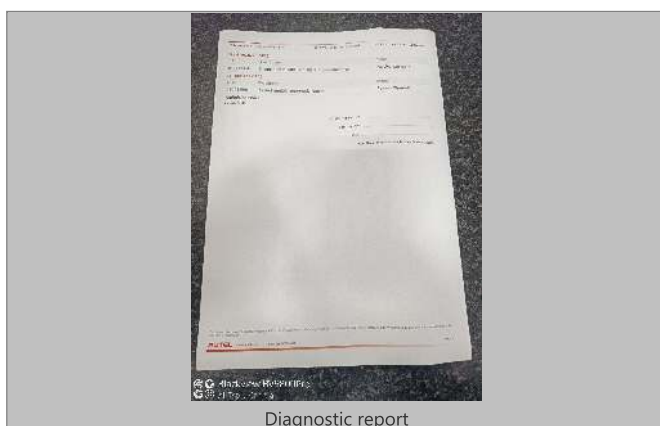


Diagnostic report

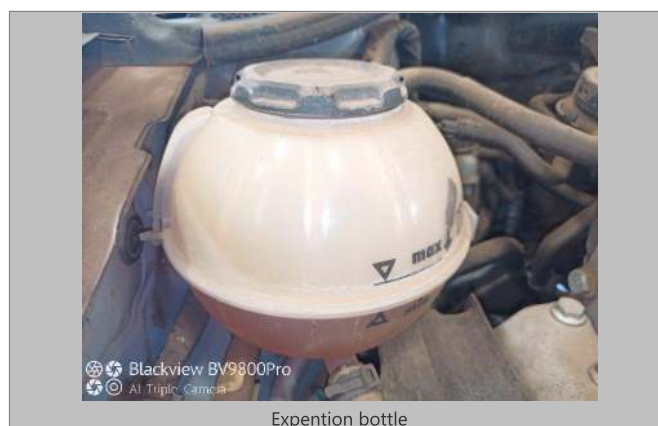

Expenditure bottle



Oil cap and dipstick

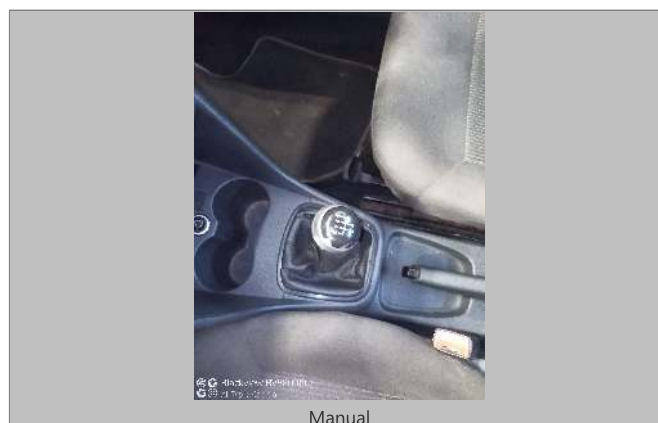

Manual



CONDITION REPORT

Report No: 2016207780

VIN: AAVZZZ6RZMU018164

DATE

20/12/2023



Spare wheel



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

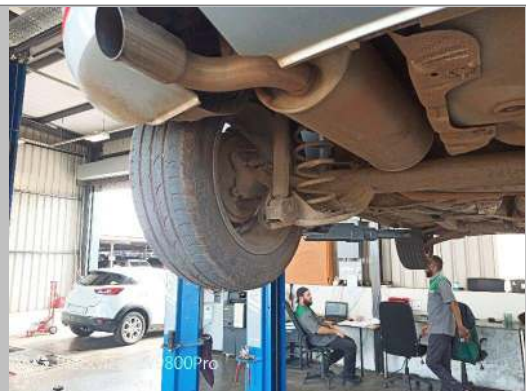

LR TYRE TREAD

VIN: AAVZZZ6RZMU018164

7 / 12



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 2




CHASSIS

VIN: AAVZZZ6RZMU018164

9 / 12



ENGINE 1

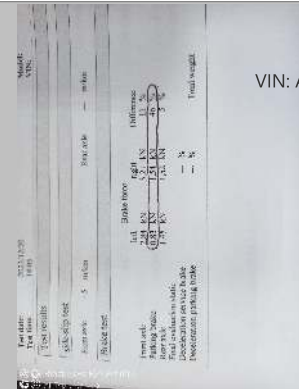

Parking Brake Performance

VIN: AAVZZZ6RZMU018164
10 / 12



Water level



Headlight Right



Headlight Left



Bonnet slam plate (Shock tower/ Inner tray)

VIN: AAVZZZ6RZMU018164

11 / 12



Grill



Bonnet



A • Pillar Right



Rear Fender Right



Door Rear Right



Door Front Right



Sill Panel Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Sill Panel Left



Door Front Left



Side Mirror Left



Rear Fender Left



Door Rear Left



Rear bumper



Rear bumper



Rear bumper



Bolt(s) / Nut(s) Front Wheel Right



Tyre Front Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right



CONDITION REPORT

Report No: 2016207780

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za