



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/08/2026		M57 Pretoria Road - 1619
Inspection Date	14/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FS12CZGP
Model	POLO VIVO GP 1.4 63KW TRENDLINE 5-DR [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6SZHU006451	Last COR	
Engine Number		License Expiry Date	31/05/2023
Doors	5	Power / Displacement	
Color	SILVER	Paint Finish	M - METALLIC
Year Model	2017	Fuel	PETROL
Km Reading	117,202 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026

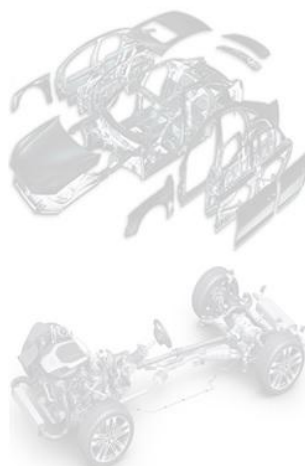

Damage	Repair Way
Engine Wiring Defective	Repair
Air cleaner Damaged	Repair
Windscreen Wiper Worn	Replace
Tail Light Right Cracked	Replace
Fog Light Front Left Damaged	Replace
Wiring connections Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Left Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Repair
Bonnet Dented	Repair
Front Fender Left / Inner Tray Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Shock Absorber Mounting Front Left Loose / Excessive Play	Repair
Shock Absorber Mounting Front Right Loose / Excessive Play	Repair
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Smooth	Replace
Rim Front Left Damaged	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Gearbox Noise Excessive	Repair
Warning lights illuminated	Repair
Body exterior	Signs of spray work done on body panels
Boot does not open, electric malfunction.	Repair
Vehicle electronics malfunction.	Electric fan keep running.
Vehicle misfire	Repair
ABS warning lights illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.3	-	
Rear	1.8	1.4	-	
Emergency / Parking	1.1	1	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45R17	91W	Continental	Contact	V	2723	1 mm
Front Right	205/40R17	84W	Wanli	Sport	V	1221	0 mm
Rear Left	185/65R15	88H	Falken	Sincera	V	2819	6 mm
Rear Right	185/65R15	88H	Falken	Sincera	V	1719	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P0135:00/00309:000	02 SENSOR HEATER CIC BANK 1 SENSOR 1 MALFUNCTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026



90 DEGREE REAR



90 DEGREE RIGHT



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026



REAR



CHASSIS



RR TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026




ENGINE 1




Expansion bottle




Oil cap and dipstick

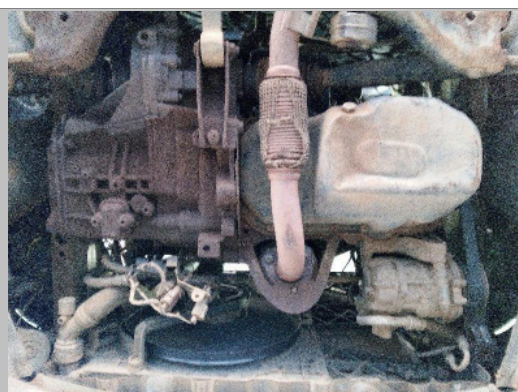

ENGINE 2

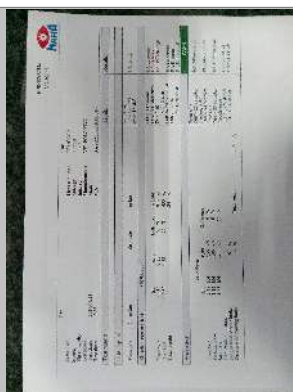

Shock and brake report

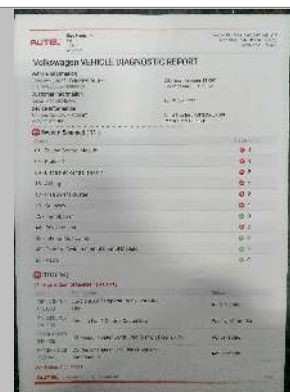

Diagnostic test

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT




Report No:

2017284338

DATE

14/08/2026

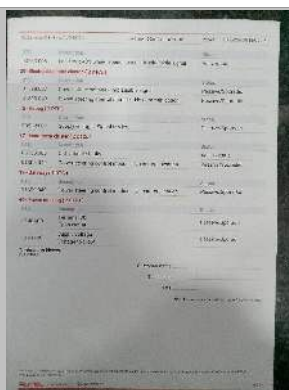

Diagnostic test



ECU is loose




Engine heat shield damage



ABS warning lights illuminated



Water level

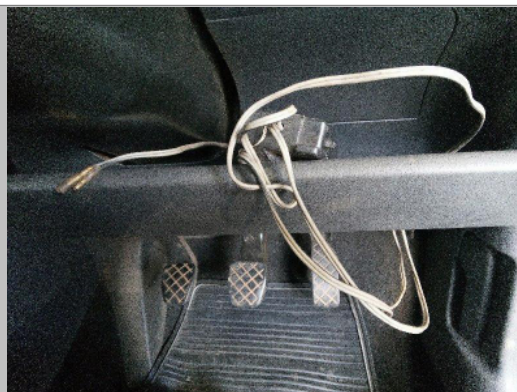

Wiring connections

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026



Wiring connections



Seat Front Right



Seat Front Left



Door Rear Right



Tail Light Right



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026



Door Rear Left



Door Front Left




Side Mirror Left



Windscreen Wiper



Bonnet

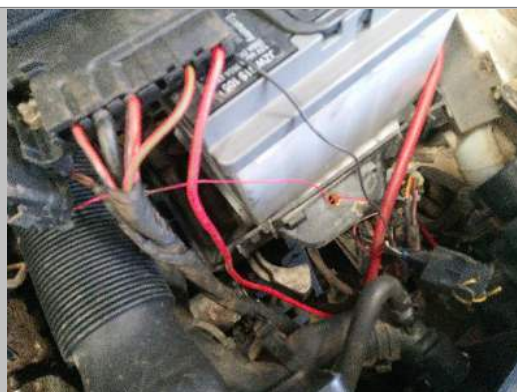

Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026



Engine Wiring



Front Fender Left / Inner Tray



Front Fender Left / Inner Tray



Front Fender Left / Inner Tray



Air cleaner



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026



Front Bumper



Fog Light Front Left



Grill



Tyre Front Left



Bolt(s) / Nut(s) Rear Wheel Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:
2017284338
DATE
14/08/2026



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right



Tyre Front Right



CV Joint(s) Boot(s) Front Left (inner/outer)



Rim Front Left



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451



CONDITION REPORT



Report No:

2017284338

DATE

14/08/2026



Front Fender Left / Inner Tray



Gearbox



Gearbox



Shock Absorber Mounting Front Left



Shock Absorber Mounting Front Right



Headlight Right

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: AAVZZZ6SZHU006451