



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KG32ZVGP
Model	POLO 1.0 TSI 70KW COMFORTLINE 5-DR [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZKU090051	Last COR	
Engine Number		License Expiry Date	31/10/2026
Doors	5	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2019	Fuel	PETROL
Km Reading	347,540 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051



CONDITION REPORT



Report No:

2017298430

DATE

14/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Switch Electrical Window Winder front left Damaged	Replace
Switch Electrical Window Winder front right Damaged	Replace
Switch Electrical Window Winder rear left Damaged	Replace
Switch Electrical Window Winder rear right Damaged	Replace
Windscreen Wiper Damaged	Replace
Seat Front Right Damaged	Repair
Seat Belt Front Right Damaged	Repair
Interior Mirror Missing	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Residual Traces of Repair	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Right Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Sunglasses Holder damage	Repair
Airbag light on	Repair
Rear tires deferred name brand and sizes	Repair
Both front fog lights malfunction	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.3	-	
Rear	1.6	1.5	-	
Emergency / Parking	1.2	0.7	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Continental	Contact	V	3821	1 mm
Front Right	195/65R15	91H	Continental	Contact	V	4220	2 mm
Rear Left	185/65R15	88H	Kapsen	Comfort max	V	4124	2 mm
Rear Right	195/65R15	91V	Powertrac	Adams	V	0125	0 mm
Spare	195/65R15	91H	Continental	Contact	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	P308800	STARTER RELAY ELECTRICAL FAULT IN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels. Signs of hail damage on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026

[illegible]

Shock and brake report

【例題】 右の表をよみ、下の問いに答えなさい。

【表】 (単位: 円) (単位: 円)

品名	数量	単価	金額
りんご	10	100	1000
みかん	20	50	1000
バナナ	15	80	1200
梨	5	200	1000
合計	50		4200

① りんごの金額はいくらですか。

② みかんの金額はいくらですか。

③ バナナの金額はいくらですか。

④ 梨の金額はいくらですか。

⑤ 合計の金額はいくらですか。

⑥ りんご、みかん、バナナ、梨の金額の合計はいくらですか。

⑦ りんご、みかん、バナナ、梨の金額の平均はいくらですか。

⑧ りんご、みかん、バナナ、梨の金額の最大値はいくらですか。

⑨ りんご、みかん、バナナ、梨の金額の最小値はいくらですか。

⑩ りんご、みかん、バナナ、梨の金額の中央値はいくらですか。

Diagnostic report

[illegible]

Diagnostic report

項目	単位	備考
1. 基礎知識	10	
2. 基礎知識	10	
3. 基礎知識	10	
4. 基礎知識	10	
5. 基礎知識	10	
6. 基礎知識	10	
7. 基礎知識	10	
8. 基礎知識	10	
9. 基礎知識	10	
10. 基礎知識	10	
11. 基礎知識	10	
12. 基礎知識	10	
13. 基礎知識	10	
14. 基礎知識	10	
15. 基礎知識	10	
16. 基礎知識	10	
17. 基礎知識	10	
18. 基礎知識	10	
19. 基礎知識	10	
20. 基礎知識	10	
21. 基礎知識	10	
22. 基礎知識	10	
23. 基礎知識	10	
24. 基礎知識	10	
25. 基礎知識	10	
26. 基礎知識	10	
27. 基礎知識	10	
28. 基礎知識	10	
29. 基礎知識	10	
30. 基礎知識	10	
31. 基礎知識	10	
32. 基礎知識	10	
33. 基礎知識	10	
34. 基礎知識	10	
35. 基礎知識	10	
36. 基礎知識	10	
37. 基礎知識	10	
38. 基礎知識	10	
39. 基礎知識	10	
40. 基礎知識	10	
41. 基礎知識	10	
42. 基礎知識	10	
43. 基礎知識	10	
44. 基礎知識	10	
45. 基礎知識	10	
46. 基礎知識	10	
47. 基礎知識	10	
48. 基礎知識	10	
49. 基礎知識	10	
50. 基礎知識	10	
51. 基礎知識	10	
52. 基礎知識	10	
53. 基礎知識	10	
54. 基礎知識	10	
55. 基礎知識	10	
56. 基礎知識	10	
57. 基礎知識	10	
58. 基礎知識	10	
59. 基礎知識	10	
60. 基礎知識	10	
61. 基礎知識	10	
62. 基礎知識	10	
63. 基礎知識	10	
64. 基礎知識	10	
65. 基礎知識	10	
66. 基礎知識	10	
67. 基礎知識	10	
68. 基礎知識	10	
69. 基礎知識	10	
70. 基礎知識	10	
71. 基礎知識	10	
72. 基礎知識	10	
73. 基礎知識	10	
74. 基礎知識	10	
75. 基礎知識	10	
76. 基礎知識	10	
77. 基礎知識	10	
78. 基礎知識	10	
79. 基礎知識	10	
80. 基礎知識	10	
81. 基礎知識	10	
82. 基礎知識	10	
83. 基礎知識	10	
84. 基礎知識	10	
85. 基礎知識	10	
86. 基礎知識	10	
87. 基礎知識	10	
88. 基礎知識	10	
89. 基礎知識	10	
90. 基礎知識	10	
91. 基礎知識	10	
92. 基礎知識	10	
93. 基礎知識	10	
94. 基礎知識	10	
95. 基礎知識	10	
96. 基礎知識	10	
97. 基礎知識	10	
98. 基礎知識	10	
99. 基礎知識	10	
100. 基礎知識	10	

Diagnostic report

[illegible]

Diagnostic report



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051



CONDITION REPORT



Report No:

2017298430

DATE

14/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051



CONDITION REPORT




Report No:

2017298430

DATE

14/09/2026

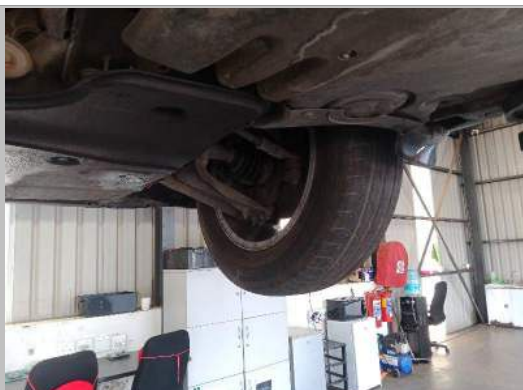

RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051




CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026



CHASSIS

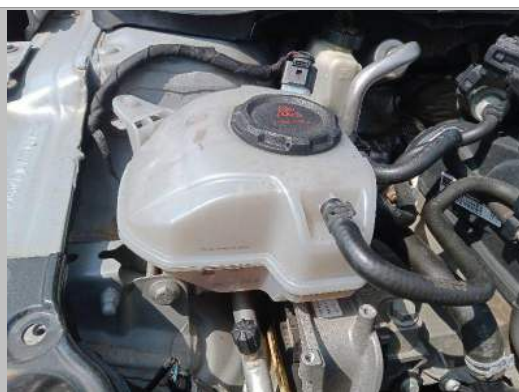

Expansion bottle



Oil cap and dipstick



Water level



Interior Mirror



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026



Switch Electrical Window Winder front right



Switch Electrical Window Winder rear left



Switch Electrical Window Winder rear right



Seat Belt Front Right



Seat Front Right



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051




CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026

Assignment:	2026/09/14	Manufacturer:	VW POLO TSI
Test date:	13/07	Model:	AAVZZZAWZK(190001)
Test time:		VIN:	
Test results			
side-slip test			
Front axle	-5 m/s	Rear axle	- m/s
Shock absorber test			
(MSD2000)			
Front axle	left	right	Difference
	> 0,30	> 0,30	0 %
Rear axle	> 0,30	> 0,30	0 %
Total weight			1430 kg
Brake test			
Brake time			
Front axle	left	right	Difference
	3,66 s	2,32 s	36 %
Parking brake	0,22 s	0,54 s	40 %
Rear axle	1,67 s	1,53 s	8 %
Final evaluation status:			
Deceleration service brake	73 %		
Deceleration parking brake	14 %		
Total weight			1430 kg

Parking Brake Performance

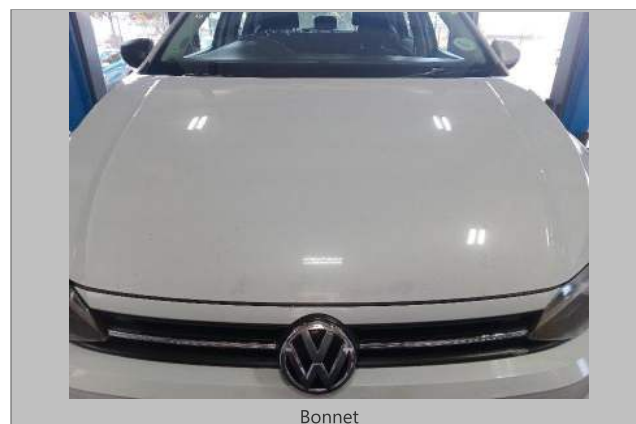

Bonnet



Front Bumper



Front Bumper



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU090051



CONDITION REPORT




Report No:

2017298430

DATE

14/09/2026

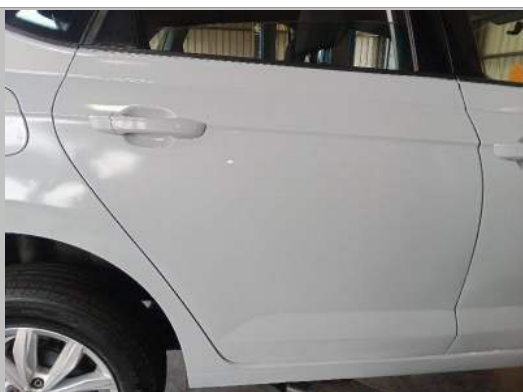

Door Rear Right



Rear Fender Right




Boot Lid / Hatch door



Rear bumper



Rear bumper

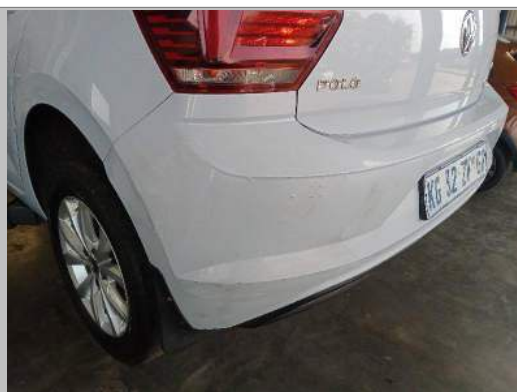

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051



CONDITION REPORT



Report No:
2017298430
DATE
14/09/2026



Door Rear Left



Door Front Left



Front Fender Left



Sill Panel Left



Sill Panel Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051



CONDITION REPORT



Report No:

2017298430

DATE

14/09/2026



Bolt(s) / Nut(s) Front Wheel Right




Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Tyre Rear Right

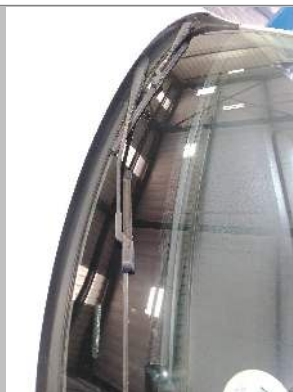

Windscreen Wiper



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU090051