



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	CHEVROLET	Registration Number	BY72RVGP
Model	SPARK 1.2 LS 5-DR [2012-2013]	Register Number	
VIN	ADMMF48DLC4602300	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	GREY	Power / Displacement	
Year Model	2012	Paint Finish	M - METALLIC
Km Reading	225,322 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026

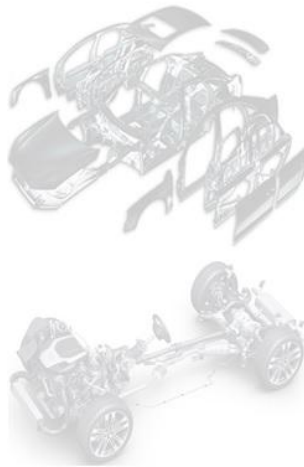

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Fog Light Front Right Defective	Repair
Dash Padding Damaged	Repair
Side Mirror Left Damaged	Replace
Front Bumper Paintwork • Flaking	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Dented	Repair
Door Front Left Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Roof Paintwork • Dull	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Right Damaged	Replace
Rim Front Right Deformed	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Some body panels misaligned	Repair
Front tyre size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.9	-	
Rear	1.3	1.1	-	
Emergency / Parking	1.1	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/55R15	82V	Hilo	Genesys	V	2223	5 mm
Front Right	175/60R15	81H	Yokohama	Bluearth	V	2623	1 mm
Rear Left	185/55R15	82V	Hilo	Genesys	V	4723	5 mm
Rear Right	185/55R15	82V	Hilo	Genesys	V	2123	6 mm
Spare	175/65R14	82H	Firestone	Touring	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300

**CONDITION REPORT**

Report No:
2017298878
DATE
15/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair work on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMMF48DLC4602300




CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026

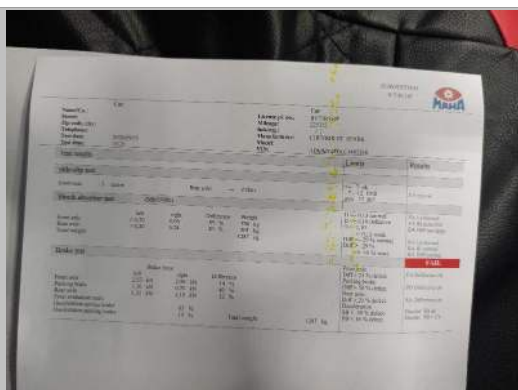

Shock and brake

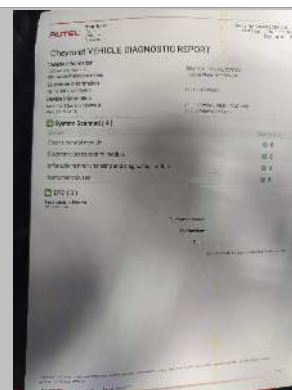

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300




CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026



ODOMETER

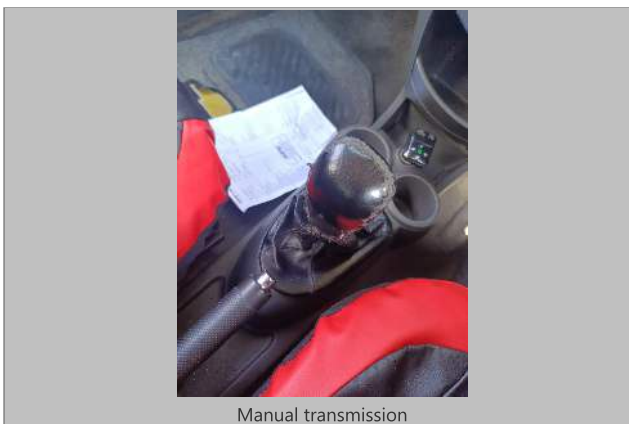


Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

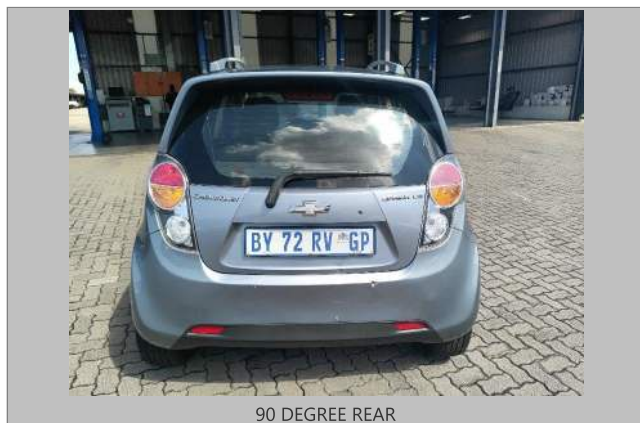

90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT




Report No:


2017298878

DATE


15/09/2026

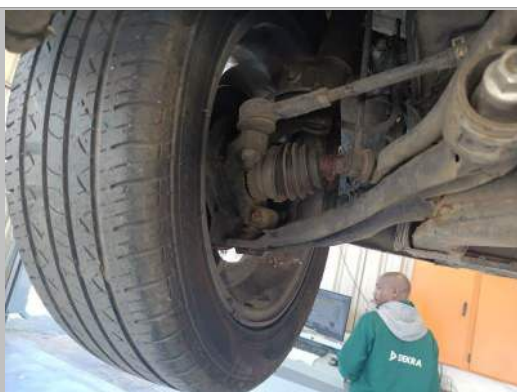

LF TYRE TREAD

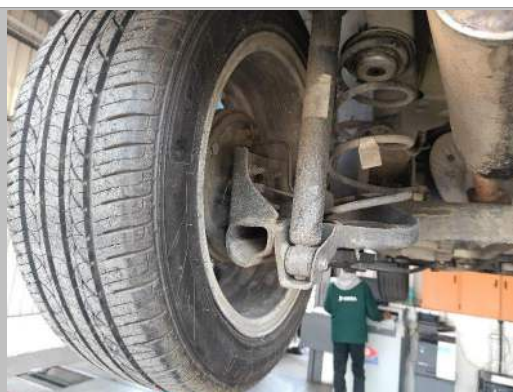

LR TYRE TREAD

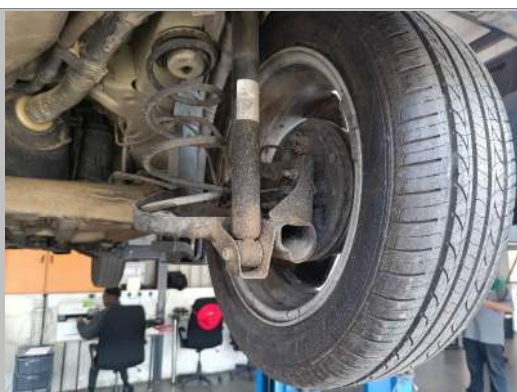

RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:

2017298878

DATE

15/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026



Oil cap and dipstick



L/F fender liner missing



ADDITIONAL 13



Bolt(s) / Nut(s) Rear Wheel Left



Door Rear Left



A • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026



A • Pillar Left



Side Mirror Left




Front Fender Left



Door Front Left



Bonnet

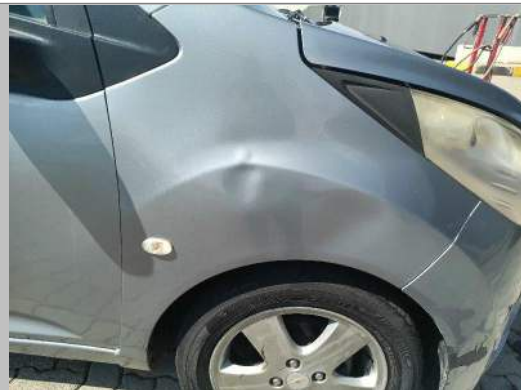

Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026



Engine Wiring



Water level



Bonnet



Dash Padding

Front axle	> 0,30	0,05	83 %	786 kg
Rear axle	> 0,30	0,24	20 %	501 kg
Total weight				1287 kg

Brake test			
	Brake force		
	left	right	Difference
Front axle	2,53 kN	2,96 kN	14 %
Parking brake	1,16 kN	0,70 kN	40 %
Rear axle	1,31 kN	1,15 kN	12 %
Final evaluation static			
Deceleration service brake		63 %	
Deceleration parking brake		15 %	
			Total weight

Parking Brake Performance



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026



Front Bumper



Fog Light Front Right



Front Bumper



Front Bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:
2017298878
DATE
15/09/2026

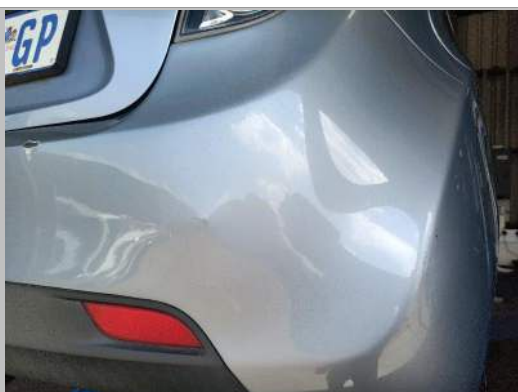

Rear bumper



Tyre Rear Right



Rim Front Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Engine



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300



CONDITION REPORT



Report No:

2017298878

DATE

15/09/2026



Engine



Engine



Roof



Roof



Side Mirror Left



Dash Padding

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMMF48DLC4602300