



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/08/2026		M57 Pretoria Road - 1619
Inspection Date	13/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	KKE635MP
Model	KB250 HO HR D-CAB DSL PU [2016-2018]	Register Number	
VIN	ADMNRCHR9G4793935	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2022
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT UNI
Km Reading	327,947 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:

2017283750

DATE

13/08/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Damaged	Replace
Fan Belt Damaged	Replace
Radiator Damaged	Replace
Water level Insufficient	Repair
Battery clamps Damaged	Repair
Engine Management Lights Set	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Scratched	Repair
Headlight Right Scratched	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Replace
Stabilizer Front Damaged	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Engine mountings Damaged	Replace
Gearbox Mountings Damaged	Replace
Gearbox Oil Leak	Replace
Differential Oil Leak	Repair
Brakes Insufficient	Repair
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair
Engine Smoke Excessive	Repair



DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.59	2.97	-	
Rear	0.0	0.0	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/70R16	112T	Dunlop	Grandtrek	V	1021	0 mm
Front Right	245/70R16	109T	Goodyear	Wrangler	V	3723	0 mm
Rear Left	LT245/75R16	116Q	Patriot	Radial	V	0224	2 mm
Rear Right	255/70R16	117S	BFGoodrich	Radial	V	0417	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: incorrect battery fitted to vehicle. signs of rodent inside engine bay. vehicle struggles to start. excessive water leak from engine. excessive oil leak from engine.

Interior: vehicle interior in poor condition.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Vehicle body in poor condition. Repair work done to vehicle below standard.

Brakes: vehicle has no handbrake and rear brakes. vehicle is unsafe to drive

Tyres and Rims: rear tire sizes do not match. front tire sizes do not match.

Road Test: gear lever linkages worn. excessive play on gear lever.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge,

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935

**CONDITION REPORT**

Report No:
2017283750
DATE
13/08/2026

operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMNRCHR9G4793935




CONDITION REPORT




Report No:
2017283750
DATE
13/08/2026

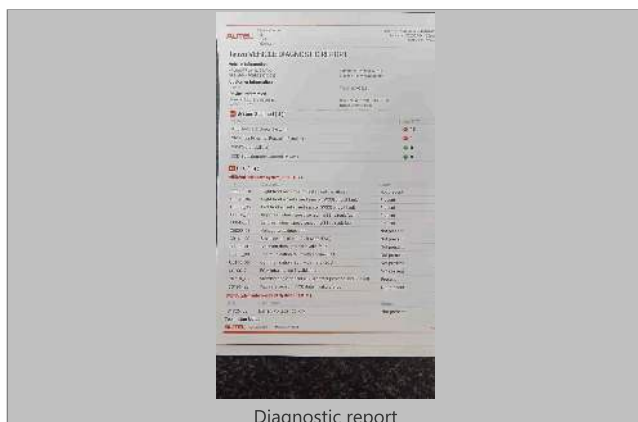

Diagnostic report

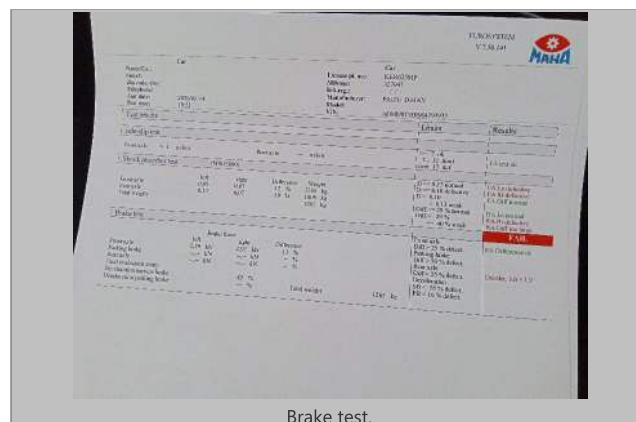

Brake test.

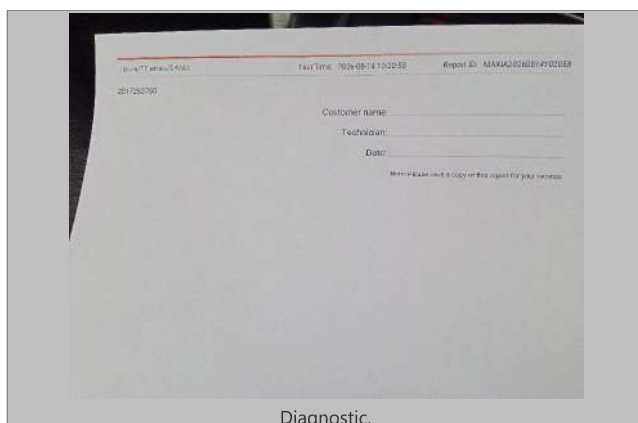


Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

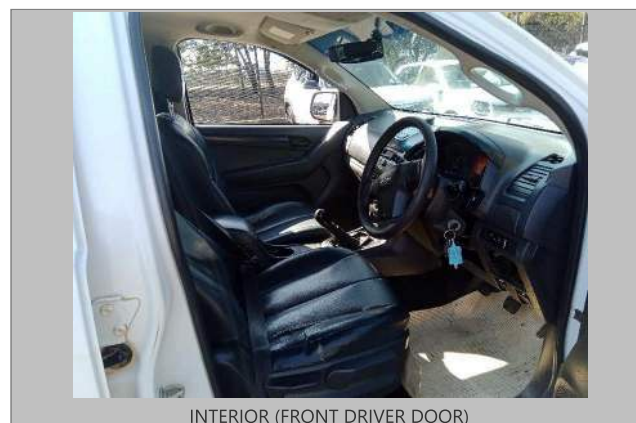

INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:

2017283750

DATE

13/08/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026




90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD

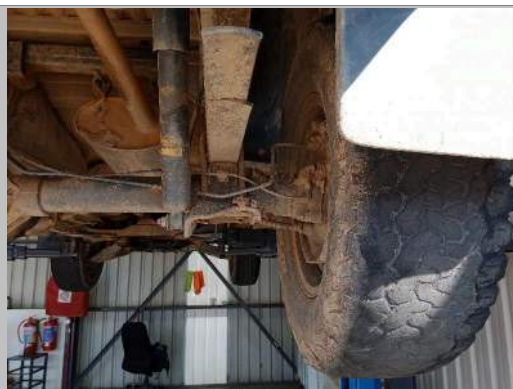

RR TYRE TREAD

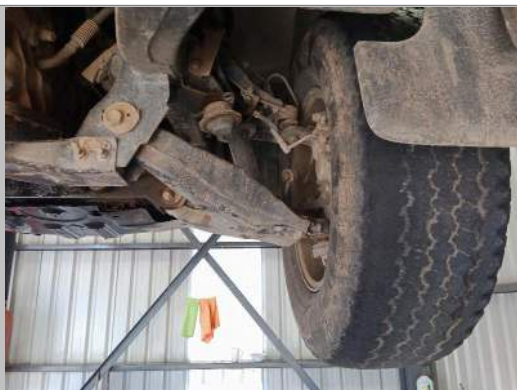

RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026



Water level



Radiator



Battery clamps



Engine Wiring



Fan Belt



Fan Belt

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026



Seat Front Right



Seat Front Left



Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT




Report No:
2017283750
DATE
13/08/2026



Rear Fender Left



Door Front Left

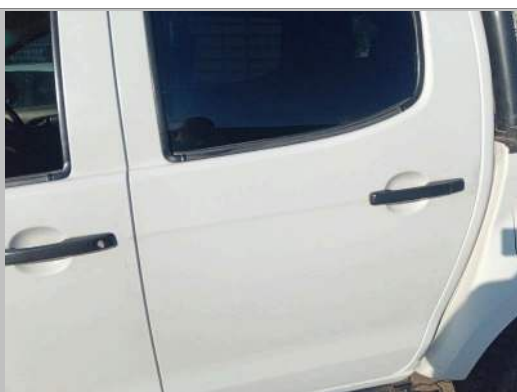

Door Rear Left



Tailgate



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:

2017283750

DATE


13/08/2026



Door Front Right



Door Rear Right

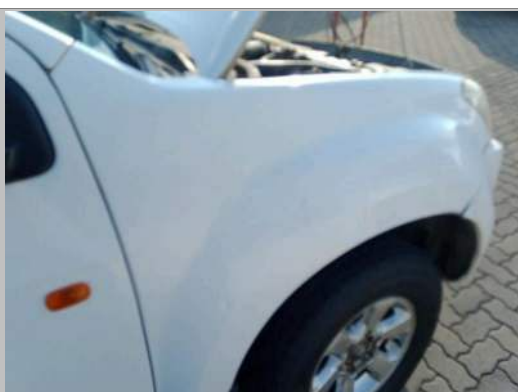

Front Fender Right



Rear Fender Right



Engine Management Lights



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026



Tail Light Right



Headlight Left



Headlight Right



Tyre Rear Right



Tyre Front Left



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026

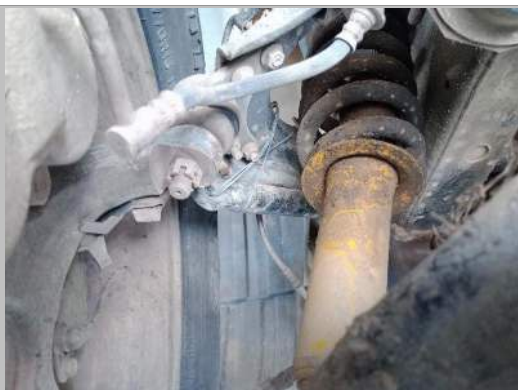

Stabilizer Front



Ball Joint(s) Front Axle Left



Engine



Gearbox



Gearbox Mountings



Engine mountings

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935



CONDITION REPORT



Report No:
2017283750
DATE
13/08/2026




Engine mountings



Stabilizer Front



Stabilizer Mounting Front Left

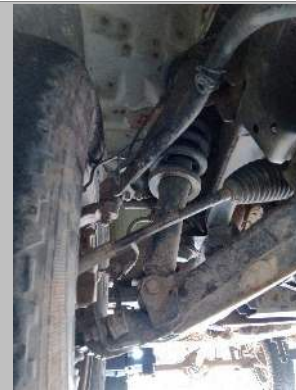

Stabilizer Mounting Front Right



Differential

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMNRCHR9G4793935