



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	OPEL	Registration Number	BP20XPGP
Model	CORSA LITE 1.4 3-DR [2008-2009]	Register Number	
VIN	ADMSC08MA83467452	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	30/11/2020
Color	WHITE	Power / Displacement	
Year Model	2008	Paint Finish	TWO COAT UNI
Km Reading	189,149 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:

2017298445

DATE

14/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Damaged	Replace
Air cleaner Defective	Repair
Central Air Vent Damaged	Replace
Windscreen Washer Defective	Repair
Indicator Light Front Left Damaged	Replace
Seat Front Right Damaged	Repair
Sun Visor Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Brake disc 1. Axle right Worn	Replace
Brake disc 2. Axle left Worn	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Worn	Replace
Engine to silencer pipe Welded	Replace
Catalytic converter Missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.2	2.41	-	
Rear	1.1	0.35	-	
Emergency / Parking	0.35	0.98	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Goodyear	Duraplus	V	2421	0 mm
Front Right	175/70R14	84T	Goodyear	Duraplus	V	2421	0 mm
Rear Left	175/70R14	84T	Goodyear	Duraplus	V	2421	1 mm
Rear Right	185/60R14	82H	Timax	Radial	V	4521	0 mm
Spare	165/80R14	85T	Apollo	Radial	V	0619	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE:Y 13 DT	P0562-00	SYSTEM VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Battery loose.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Vehicle body in poor condition. Repair work done to vehicle below standard.

Brakes: right rear wheel binding.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026

Vehicle Data				Test Results			
Make/Model	Year	License plate no.	Chassis no.	Test no.	Test date	Test time	Test location
DAEWOO	2008	BP2012	100-000000	001	14/09/2026	11:37	DEKRA
Test name	Test date	Test time	Test location	Test no.	Test date	Test time	Test location
Brake test	14/09/2026	11:37	DEKRA	001	14/09/2026	11:37	DEKRA
Brake test results				Brake test results			
Front axle	1.00	1.00	1.00	Front axle	1.00	1.00	1.00
Rear axle	1.00	1.00	1.00	Rear axle	1.00	1.00	1.00
Total weight	1.00	1.00	1.00	Total weight	1.00	1.00	1.00

Brake test.

Vehicle Data				Test Results			
Make/Model	Year	License plate no.	Chassis no.	Test no.	Test date	Test time	Test location
DAEWOO	2008	BP2012	100-000000	001	14/09/2026	11:37	DEKRA
Test name	Test date	Test time	Test location	Test no.	Test date	Test time	Test location
Diagnostic	14/09/2026	11:37	DEKRA	001	14/09/2026	11:37	DEKRA
Diagnostic results				Diagnostic results			
Engine	1.00	1.00	1.00	Engine	1.00	1.00	1.00
Transmission	1.00	1.00	1.00	Transmission	1.00	1.00	1.00
Brake	1.00	1.00	1.00	Brake	1.00	1.00	1.00

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

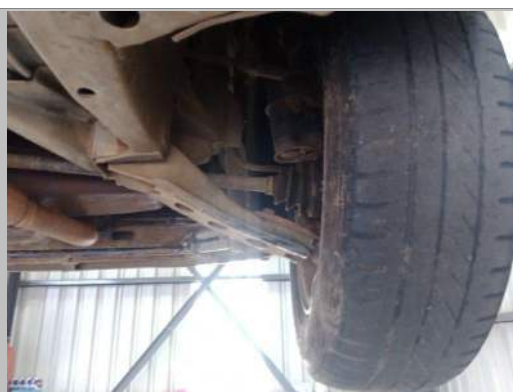

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026



Front Bumper



Front Bumper



Bonnet



Engine Wiring



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026



Rear Fender Left



Door Front Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:

2017298445

DATE

14/09/2026



Front Fender Right



Door Front Right



Seat Front Right



Central Air Vent



Central Air Vent



Sun Visor Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026




Indicator Light Front Left



Tyre Rear Left



Tyre Rear Right

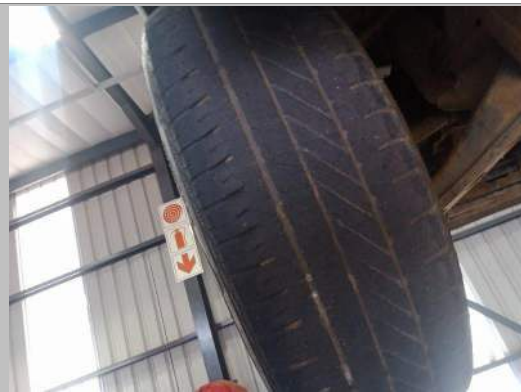

Tyre Front Left



Tyre Front Right



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026



Brake disc 1. Axle right



Brake disc 2. Axle left



Engine to silencer pipe



Catalytic converter



Roof



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADMSC08MA83467452



CONDITION REPORT



Report No:
2017298445
DATE
14/09/2026

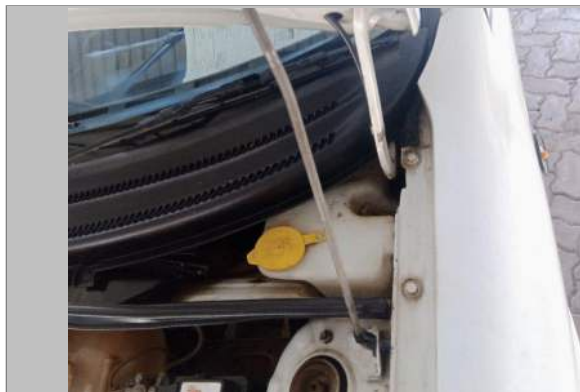

Windscreen Washer



Windscreen Washer

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADMSC08MA83467452