



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/01/2024		M57 Pretoria Road - 1619
Inspection Date	23/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	JG71SSGP
Model	NP200	Register Number	
VIN	ADNUSN1D5U0170273	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	30/06/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	162,480 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

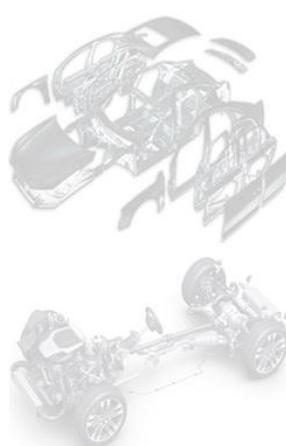

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Battery clamps Defective	Repair
Dim Light Left Defective	Repair
Number Plate Light Left Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Window Winder front right Defective	Repair
Front Bumper Damaged	Repair
Rear bumper Damaged	Repair
Shock Absorber Rear Right Leak	Replace
Spare Tyre Torn / Cut	Replace
Rim Rear Right Dented	Repair
Gearbox Oil Leak	Repair



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.9	3.0	-	
Rear	1.4	1.3	-	
Emergency / Parking	1.1	0.8	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Firestone	Touring		4121	1 mm
Front Right	185/65R15	88T	Continental	Contact	V	2222	2 mm
Rear Left	185/65R15	92H	Blackhwak	Street	V	1821	3 mm
Rear Right	185/65R15	92T	Barum	Brilliantis	V	0423	5 mm
Spare	185/65R15	92H	Sumitomo	HTR	V	//////	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Driver window malfunction.
Body • Exterior: Minor dents scratches and stone chips on som

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016239725

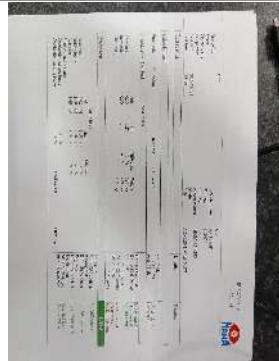DATE
23/01/2024

Shock and brake report



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0170273

4 / 10



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0170273

6 / 10



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

ENGINE 1



ENGINE 2



CHASSIS



Rear end



Manual



Oil cap and dipstick



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

Expansion bottle



Number Plate Light Left



Seat Front Right



Seat Front Right



Water level



Engine Wiring

**CONDITION REPORT**

Report No: 2016239725

DATE
23/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

Battery clamps



Front Bumper



Rear bumper



Rear bumper



Engine



Gearbox



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024


Spare Tyre



Spare Tyre



Rim Rear Right

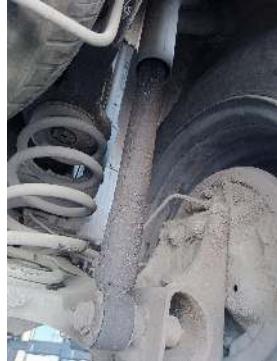

Shock Absorber Rear Right



Seat Front Left



Dim Light Left





CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

Window Winder front right



CONDITION REPORT

Report No: 2016239725

DATE
23/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za