

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/04/2025		M57 Pretoria Road - 1619
Inspection Date	07/04/2025		Kempton Park - GT

**Vehicle Data**

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	CP28BWGP
Model	RANGER SUPER CAB 2.2TD HI-POWER XL HI-RIDER DSL PU [2011-2016]	Register Number	
VIN	AFAGXXMJ2GDP08894	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	C - COMMON
Km Reading	280,335 KM	Fuel	DIESEL
Cab / Body Type	SUPER CAB	Transmission	MANUAL

**Vehicle Options & Accessories**

**Items**

**VEHICLE INSPECTION**

Damage	Repair Way
Front Bumper Discoloured	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Body exterior	Vehicle got minor scratches stone chips and dents

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAGXXMJ2GDP08894

**Brakes**

**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	3.7	4.1	-	
Rear	3.1	1.9	-	
Emergency / Parking	2.7	1.9	-	

**Tyres and Rims**

**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/70R16	112H	General	Grabber	V	0119	4 mm
Front Right	265/70R16	112H	General	Grabber	V	0119	4 mm
Rear Left	265/70R16	112H	General	Grabber	V	0119	4 mm
Rear Right	265/70R16	112H	General	Grabber	V	0620	4 mm
Spare	265/70R16	112H	General	Grabber	V	0319	7 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U3003:62-28	BATTERY VOLTAGE	

**Inspection Conditions**

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Expenditure bottle




Oil cap and dipstick




Manual




Spare wheel

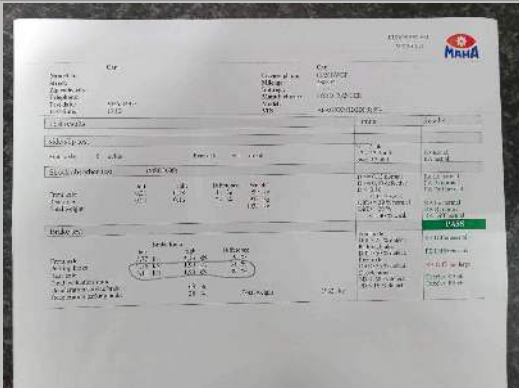

Shock and brake report

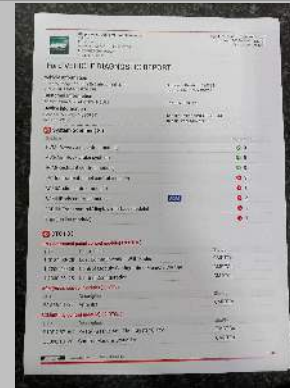

Diagnostic report

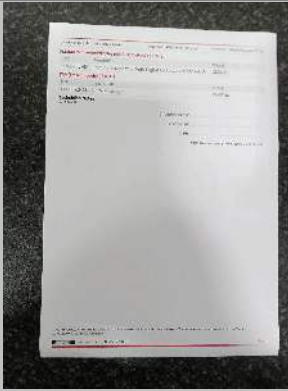

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

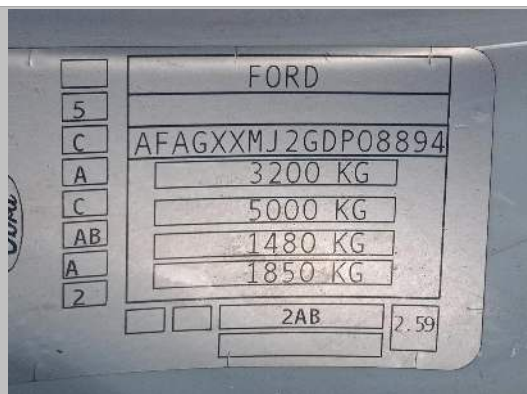

VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2



Water level



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Bonnet



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Tailgate




Rear bumper




Rear bumper



Windscreen

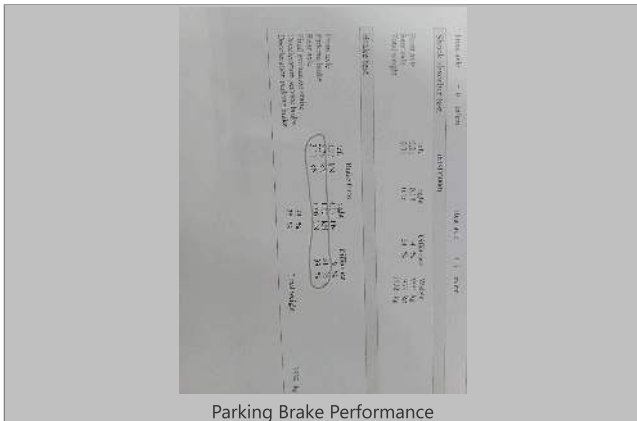

Parking Brake Performance

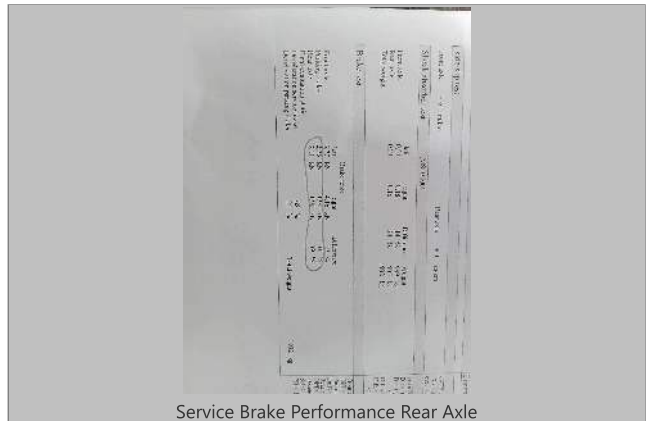

Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFAGXXMJ2GDP08894