



CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	MD92JFGP
Model	COROLLA QUEST 1.8 PLUS [2022-2025]	Register Number	
VIN	AHTBF8JE601028365	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2027
Color	GREY	Power / Displacement	
Year Model	2024	Paint Finish	M - METALLIC
Km Reading	65,613 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:

2017297912

DATE

11/09/2026

Damage

Repair Way

Seat Front Right Torn / Cut	Repair
Seat Rear Damaged	Repair
Front Bumper Residual Traces of Repair	Repair
Grill Damaged	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Right Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Brake disc 2. Axle right Corrosion	Replace
Brake Pad/Shoe 2. Axle right Damaged	Replace
Brake Piping Leak	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Stabilizer Mounting Front Right Damaged	Replace
Rim Rear Right Deformed	Repair
Front suspension excessive noise	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	3.2	-	
Rear	1.7	1.1	-	
Emergency / Parking	0.5	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Sumitomo	BC100	V	0725	5 mm
Front Right	195/65R15	91V	Sumitomo	BC100	V	0725	5 mm
Rear Left	195/65R15	91H	Goodyear	Excellence	V	4023	6 mm
Rear Right	195/65R15	91H	Goodyear	Excellence	V	4023	5 mm
Spare	195/65R15	91H	Goodyear	Excellence	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:

2017297912

DATE

11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1201	ENGINE/EV CONTROL SYSTEM MALFUNCTION	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of poor repair on body panels. Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:

2017297912

DATE

11/09/2026

Car		Car	
Model	Car	Model	Car
Registration	ND 92 JF-67	Registration	ND 92 JF-67
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA
Vehicle	Car	Vehicle	Car
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA

Shock and brake report

Car		Car	
Model	Car	Model	Car
Registration	ND 92 JF-67	Registration	ND 92 JF-67
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA
Vehicle	Car	Vehicle	Car
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA

Diagnostics report

Car		Car	
Model	Car	Model	Car
Registration	ND 92 JF-67	Registration	ND 92 JF-67
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA
Vehicle	Car	Vehicle	Car
Engine	1.8L	Engine	1.8L
Power	100 kW	Power	100 kW
Year	2014	Year	2014
Color	Grey	Color	Grey
Owner	DEKRA	Owner	DEKRA
Insurer	SAFARI	Insurer	SAFARI
Inspection	11/09/2026	Inspection	11/09/2026
Inspector	DEKRA	Inspector	DEKRA
Location	DEKRA	Location	DEKRA

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:

2017297912

DATE

11/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:


2017297912

DATE

11/09/2026



LICENSE DISC

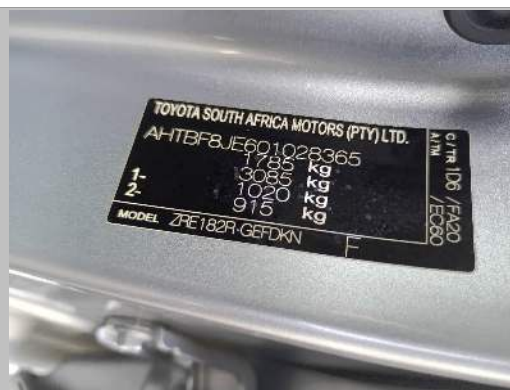

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:

2017297912

DATE

11/09/2026



R/F fender liner missing



Expansion bottle



Oil cap and dipstick



Seat Rear

Shock absorber test (MSD3000)				
	left	right	Difference	Weight
Front axle	> 0,30	0,23	23 %	970 kg
Rear axle	> 0,30	0,23	23 %	565 kg
Total weight				1535 kg

Brake test				
	left	right	Difference	
Front axle	2,76 kN	3,21 kN	14 %	
Parking brake	0,55 kN	1,04 kN	47 %	
Rear axle	1,79 kN	1,10 kN	39 %	
Final evaluation static				
Deceleration service brake		59 %		
Deceleration parking brake		11 %		Total weight

Parking Brake Performance



Front Fender Right

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026



Seat Front Right



A • Pillar Right



Door Rear Right



Rear Fender Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365




CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026



Rear bumper

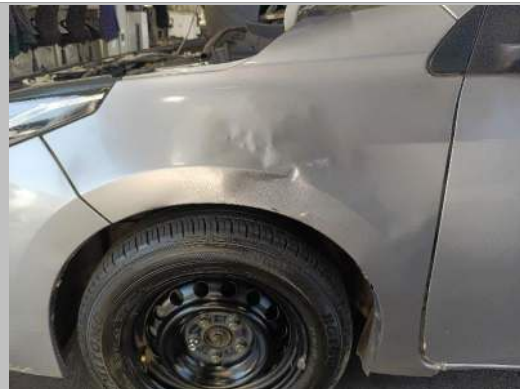


Front Fender Left



Water level



Front Bumper

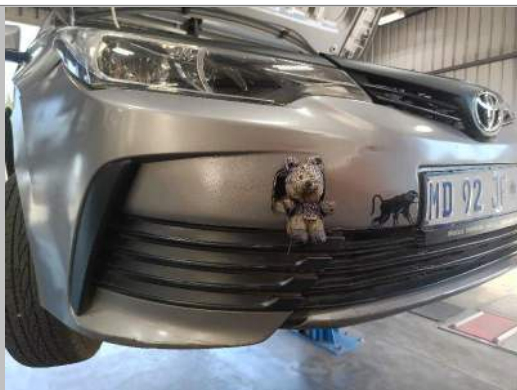

Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026



Grill



Front Bumper



Front Bumper



Rear bumper



Rear bumper



Brake disc 2. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365



CONDITION REPORT



Report No:
2017297912
DATE
11/09/2026



Stabilizer Mounting Front Right



Brake Piping



Brake Pad/Shoe 2. Axle right



Rim Rear Right



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE601028365