



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LDZ937NW
Model	COROLLA QUEST 1.8 PLUS [2022-2025]	Register Number	
VIN	AHTBF8JE701021702	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	73,093 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:

2017296906

DATE

10/09/2026

Damage

Repair Way

Windscreen Wiper Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Door Handle Front Left Damaged	Repair
Mirror Adjusters Damaged	Replace
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Smart Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Replace
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Paintwork • Flaking	Repair
Tyre Front Left Worn	Replace
Rim Spare Wheel Defective	Repair
Cross Member Rear Left Damaged	Repair
Cross Member Rear Right Damaged	Repair
Sub Frame Scratched	Repair
Belly plates Damaged	Replace
Fuel Tank Damaged	Repair
Radiator Cradle Damaged	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.62	2.63	-	
Rear	2.29	2.32	-	
Emergency / Parking	1.43	1.33	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:

2017296906

DATE

10/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Winrun	R330	V	1324	0 mm
Front Right	195/65R15	91V	Winrun	R330	V	1324	1 mm
Rear Left	195/65R15	91H	Hilo	Genesys	V	4123	2 mm
Rear Right	195/65R15	91H	Hilo	Genesys	V	4123	2 mm
Spare	195/65R15	91T	General	Altimax	V	0523	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Tyres and Rims: Spare Wheel could not be checked properly due to lock down pin stuck.

Undercarriage: The vehicle's undercarriage is dirty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026

[illegible]

Brake and shock absorber report



Front chassis



Rear chassis

Diagnostic report page 1

Toyota/Corolla		Test Time: 2026-09-10 10:01:10	Report ID: MAXIA3026091000110
Combination meter (1 DTC)			
DTC	Description	Status	
B1507	Turn signal circuit open	History	
Technician Notes			
2077256996			
Customer name:			
Technician:			
Date:			
Many thanks to our customers for their support and cooperation.			

Diagnostic report page 2



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:

2017296906

DATE

10/09/2026



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Seat Front Right



Seat Rear



Tail Light Right



Door Rear Left



Door Rear Left



B • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Seat Front Left




Windscreen Wiper



Side Mirror Left



Front Fender Right

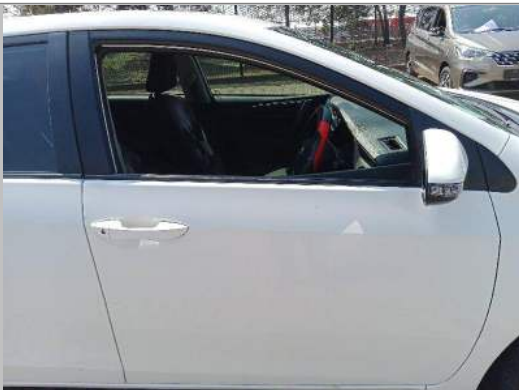

Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Door Rear Right



Mirror Adjusters



Bonnet



Bonnet



Front Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Door Handle Front Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear bumper



Rim Spare Wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Water level



Front Bumper



Front Bumper



Front Bumper



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Sill Panel Left



Sill Panel Right



Front Fender Right / Inner Tray



Belly plates



Tyre Front Left



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026



Radiator Cradle



Radiator Cradle



Cross Member Rear Left



Cross Member Rear Right



Fuel Tank



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702



CONDITION REPORT



Report No:
2017296906
DATE
10/09/2026




Sub Frame



Rear Fender Left



Rear Fender Right

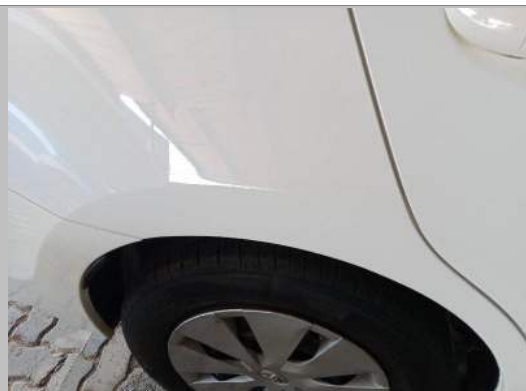

Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE701021702