



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/08/2026		M57 Pretoria Road - 1619
Inspection Date	24/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LW04FCGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
VIN	AHTSS22P007156333	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2026
Color	PINK	Power / Displacement	
Year Model	2024	Paint Finish	M - METALLIC
Km Reading	188,415 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026

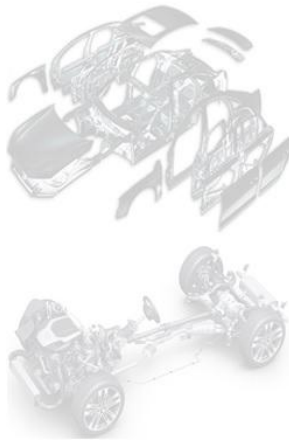

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Torn / Cut	Repair
Sun Visor Left Missing	Replace
Front Bumper Damaged	Repair
Bonnet Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Dented	Repair
Sliding Door Paintwork • Scratched	Repair
Windscreen Chipped	Replace
Brake Drum 2. Axle right Defective	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Control Arm(s) Front Axle Right Deformed	Replace
Spare Tyre Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Original color is white vehicle is sprayed pink	Report
Warning lights illuminated	Report

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.8	3.3	-	
Rear	0.9	1.8	-	
Emergency / Parking	2.2	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/75R14	109/107S	Yokohama	Steel	V	3325	3 mm
Front Right	205/75R14	109/107S	Yokohama	Steel	V	0524	1 mm
Rear Left	205/75R14	109/107S	Gt radial	Maxmiller	V	2125	5 mm
Rear Right	205/75R14	109/107S	Yokohama	Steel	V	2425	1 mm
Spare	195R15	106/104S	Goodyear	Efficient	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333

**CONDITION REPORT**

Report No:
2017288390
DATE
24/08/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on all body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P007156333




CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026

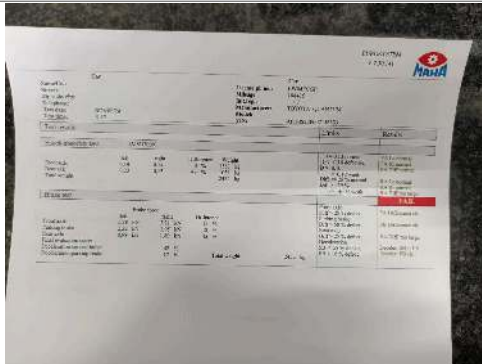

Shock and brake report

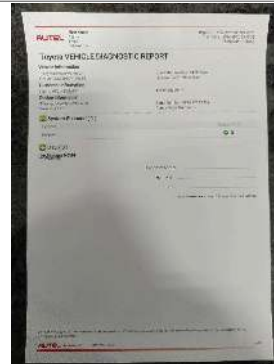

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT




Report No:
2017288390
DATE
24/08/2026




LF TYRE TREAD



LR TYRE TREAD

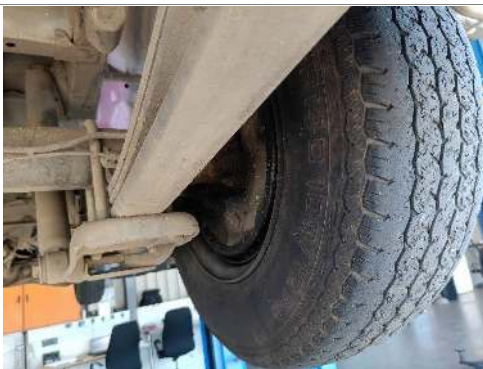

RR TYRE TREAD

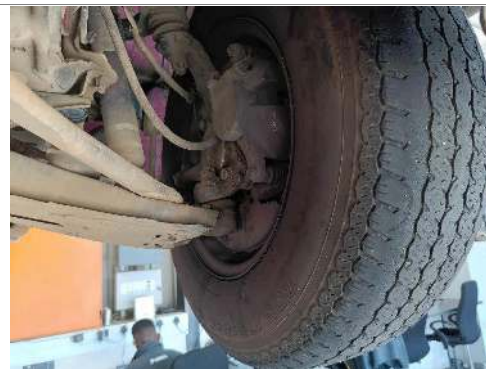

RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



Expansion bottle



Sun Visor Left

Shock absorber test (MAN/0000)				
	left	right	Difference	Weight
Front axle	0,14	0,14	0 %	1381 kg
Rear axle	0,23	0,13	43 %	1051 kg
Total weight				2432 kg

Brake test			
	left	right	Difference
Front axle	3,88 kN	3,31 kN	15 %
Parking brake	2,22 kN	1,95 kN	12 %
Rear axle	0,99 kN	1,80 kN	45 %
Final evaluation static			
Deceleration service brake		42 %	
Deceleration parking brake		17 %	
Total weight			

Service Brake Performance Rear Axle



Seat Front Right



Rear Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear bumper



Rear Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



Sliding Door



Sliding Door



Seat Front Left



Engine



Bonnet



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



Front Bumper



Bolt(s) / Nut(s) Front Wheel Left



Engine



Engine



Control Arm(s) Front Axle Right



Control Arm(s) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333



CONDITION REPORT



Report No:
2017288390
DATE
24/08/2026



Engine Wiring



Engine



Engine



Spare Tyre



Brake Drum 2. Axle right



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333

**CONDITION REPORT**

Report No:
2017288390
DATE
24/08/2026



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P007156333