



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	JD29CMGP
Model	ELANTRA MD 1.6 PREMIUM [2011-2015]	Register Number	
VIN	KMHDH41CLDU893896	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2026
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	139,674 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:

2017298906

DATE

15/09/2026

Damage

Repair Way

Engine Wiring Damaged	Replace
Ref Counter Defective	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder front right Damaged	Replace
Switch Electrical Window Winder rear left Damaged	Replace
Tail Light Left Cracked	Replace
Tail Light Right Cracked	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Rear Dirty	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Left Paintwork • Scratched	Smart Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
B • Pillar Left Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Doorstopper Front Right Excessive Wear & Tear	Replace
Weather Strip Door Front Left Defective	Repair
Weather Strip Door Rear Left Defective	Repair
Weather Strip Door Rear Right Defective	Repair
Boot Lid / Hatch door Damaged	Repair
Boot Lid / Hatch Door Rubbers Damaged	Replace
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Damaged	Repair
Roof Damaged	Repair
Shock Absorber Front Left Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Spare Tyre Damaged	Replace
Rim Rear Left Scratched	Repair
Rim Spare Wheel Scratched	Repair
Chassis Dented	Repair
Engine to silencer pipe Welded	Repair
Belly plates Damaged	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Loose sound wiring inside boot of vehicle	Replace
Spare Wheel regrooved	Replace

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026

Damage	Repair Way
Rear right door child lock damaged	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.61	2.79	-	
Rear	2.33	2.53	-	
Emergency / Parking	0.98	1.12	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91V	Habilead	Comfort	V	4718	0 mm
Front Right	195/65 R15	91H	Hankook	Kinergy	V	2013	0 mm
Rear Left	195/65 R15	91V	Habilead	Comfort	V	4718	1 mm
Rear Right	195/65 R15	91V	Habilead	Comfort	V	4718	2 mm
Spare	195/65 R15	91H	Continental	Contipremuim	V	4122	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENG(ENGINE)	P0335	CRANKSHAFT POSITION(CKP) SENSOR'A' CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Electrical Components and Instruments: Ref counter not working.
Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Poor residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.
Axle and Suspension: Front and rear suspension faulty
Road Test: Vehicle has a hard start.

Concluding Remarks

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:

2017298906

DATE _____

15/09/2026

[illegible]

Brake and shock absorber report

Vehicle Diagnostic Report	
Vehicle ID:	VEH-2024-089
Engine Type:	Gasoline
Transmission:	Automatic
Drive Type:	Front-wheel drive
Year/Make/Model:	2018 Ford Focus
Owner Name:	John Doe
Report Date:	2024-10-27
Technician:	Mike Smith
Vehicle Status:	Under Repair
Report ID:	REP-2024-045
Notes:	Initial inspection. No major issues found.
Engine Oil:	5W-30
Brake Fluid:	DOT 4
Transmission Fluid:	ATF-68
Spark Plugs:	NGK
Water Pump:	Good
Timing Belt:	Good
Exhaust System:	Good
Lighting:	Good
Wipers:	Good
Steering:	Good
Suspension:	Good
Brakes:	Good
Engine:	Good
Transmission:	Good
Drivetrain:	Good
Chassis:	Good
Electrical:	Good
Interior:	Good
Exterior:	Good
Overall:	Good
Comments:	Vehicle is in good condition. No major issues found.
Signature:	Mike Smith
Date:	2024-10-27

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:

2017298906

DATE

15/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:

2017298906

DATE

15/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Rear right door child lock

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Loose sound wiring



Oil cap and dipstick



Center Console / Cubbyhole + Lid



Hood Lining



Steering Wheel Trim



Door Sealing Rubber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026

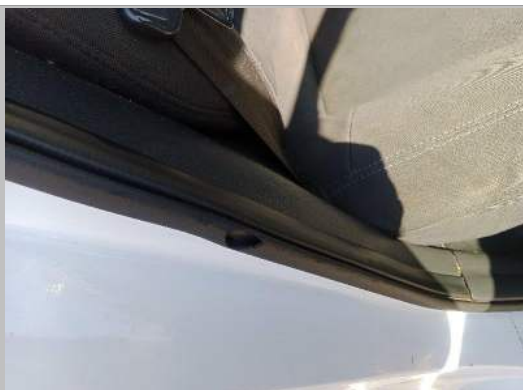

Door Sealing Rubber Rear Right



Seat Rear



Seat Rear



Door Sealing Rubber Rear Left



Seat Front Left



B • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Headlight Right



Headlight Left



Engine Wiring



Water level



Water level



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Front Fender Right



Door Front Right



Door Rear Right



Door Rear Right



Weather Strip Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Tail Light Right



Tail Light Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:

2017298906

DATE

15/09/2026



Rear bumper



Roof



Boot Lid / Hatch Door Rubbers



Spare Tyre



Rim Spare Wheel



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Rear Fender Left



Door Rear Left



Door Rear Left



Door Front Left



Weather Strip Door Rear Left



Weather Strip Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026




Side Mirror Left



Front Fender Left



Front Fender Left

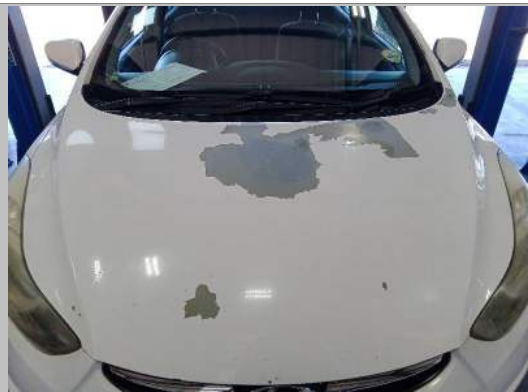

Bonnet



Control Arm Bush(es) Front Axle Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



Sill Panel Left



Rim Rear Left



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Sill Panel Right



Belly plates



Chassis



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026



Chassis



Tyre Front Right



Tyre Front Left



Ball Joint(s) Front Axle Left



Shock Absorber Front Left



Ref Counter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHDH41CLDU893896



CONDITION REPORT



Report No:
2017298906
DATE
15/09/2026

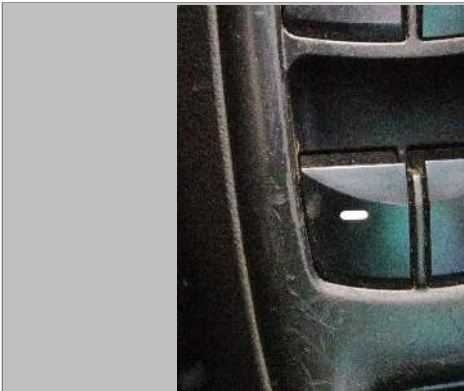

Switch Electrical Window Winder rear left



Doorstopper Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHDH41CLDU893896