



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/09/2026		M57 Pretoria Road - 1619
Inspection Date	18/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	HC37GHGP
Model	PICANTO	Register Number	
VIN	KNAB2511LJT113268	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	294,083 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026

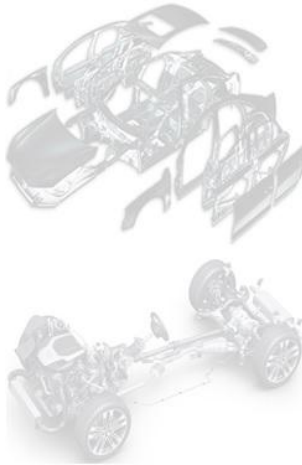

Damage	Repair Way
Engine Oil Leak	Repair
Radiator Water Leak	Repair
Air cleaner Damaged	Repair
Indicator Light Front Right Missing	Replace
Tail Light Left Scratched	Repair
Headlight Right Defective	Repair
Seat Front Right Loose / Excessive Play	Repair
Parcel Tray Missing	Replace
Side Mirror Left Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Discoloured	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Discoloured	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Brake Piping Defective	Repair
Tyre Rear Right Damaged	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Repair
Boot not opening can not see spare wheel	Repair
All four hup caps missing	Replace
No license disc	Replace
Battery loose	Repair
VCI plug malfunction	Repair
Both front fender liner damage	Replace
Engine sump dent	Repair
Rear and Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.3	-	
Rear	1.7	1.8	-	
Emergency / Parking	1.1	1.1	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65R14	79T	Goodyear	Efficient gr	V	1821	2 mm
Front Right	165/60R14	75H	Encore	Reflex 202	V	5220	2 mm
Rear Left	165/70R14	81S	MRF	Zvtv	V	1719	2 mm
Rear Right	175/65R14	82T	Hankook	Optimo	V	1519	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Diagnostic could not be performed due to no data available and or OBD interface malfunction.

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT




Report No:

2017300801

DATE

18/09/2026

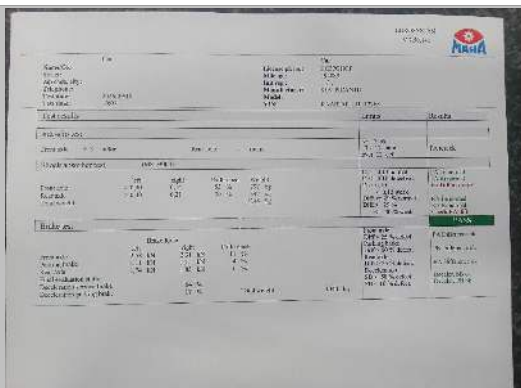

Shock and brake report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:


2017300801

DATE


18/09/2026



LR TYRE TREAD

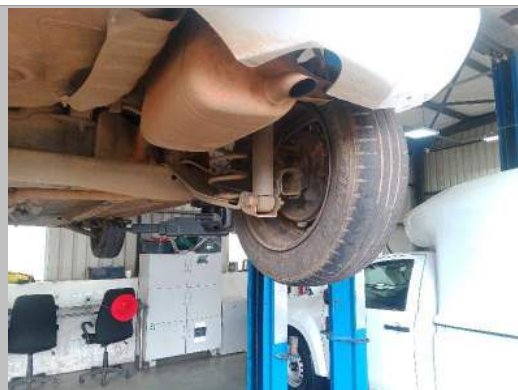

RR TYRE TREAD

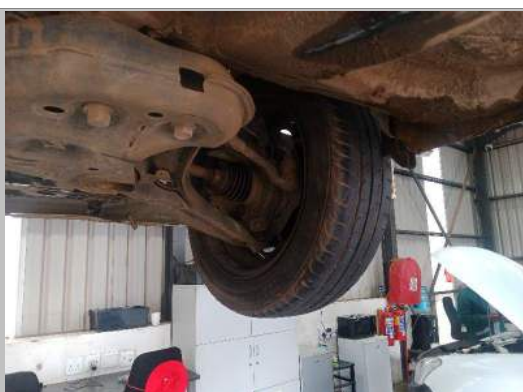

RF TYRE TREAD



No license disc



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick



Water level



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:

2017300801

DATE

18/09/2026



Headlight Right



Side Mirror Right



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Side Mirror Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



Radiator



Radiator



Brake Piping



CV Joint(s) Boot(s) Front Left (inner/outer)



Engine



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268



CONDITION REPORT



Report No:
2017300801
DATE
18/09/2026



Seat Front Right



Windscreen



Tail Light Left



Indicator Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LJT113268