



CONDITION REPORT



Report No:

2017296801

DATE

10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	LY15JMGP
Model	RIO 1.4 TEC 5-DR [2015-2018]	Register Number	
VIN	KNADN512LF6544456	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	RED	Power / Displacement	
Year Model	2015	Paint Finish	TWO COAT UNI
Km Reading	135,540 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:

2017296801

DATE

10/09/2026



Damage

Repair Way

Engine Oil Sweat	Repair
Battery box Damaged	Replace
Air cleaner Damaged	Replace
Indicator Light Front Left Damaged	Replace
Indicator Light Front Right Damaged	Replace
Sun Roof Switch Malfunction	Replace
Seat Rear Loose / Excessive Play	Repair
Front Bumper Paintwork • Chipmarks	Repair
C • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Worn	Replace
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Chassis Damaged	Repair
Sub Frame Dented	Repair
Engine mountings Damaged	Replace
Wiper valance damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.54	3.54	-	
Rear	2.11	1.78	-	
Emergency / Parking	1.55	1.31	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/45 R17	88W	Continental	Premium	V	5021	2 mm
Front Right	205/45 R17	88W	Continental	Premium	V	3319	0 mm
Rear Left	205/45 R17	88W	Continental	Premium	V	4218	1 mm
Rear Right	205/45 R17	88W	Continental	Premium	V	4423	5 mm
Spare	205/45 R17	88W	Hify	HF805	V	0817	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Interior fan blower blocked.

Body • Exterior: Non standard sunroof fitted to vehicle. Residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of hail damage on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:

2017296801

DATE

10/09/2026

VEHICLE INFORMATION			
Make/Model	Year	Engine/Power	Color
Toyota Yaris	2017	1.5L 106kW	Red
Registration	Inspection Date	Inspection Result	Inspection Station
123456789	10/09/2026	Pass	DEKRA
BRAKE AND SHOCK ABSORBER REPORT			
Front Left	Front Right	Rear Left	Rear Right
Disc/Pad	Disc/Pad	Disc/Pad	Disc/Pad
Good	Good	Good	Good
Shock Absorber	Shock Absorber	Shock Absorber	Shock Absorber
Good	Good	Good	Good
Steering	Steering	Steering	Steering
Good	Good	Good	Good
Wheels/Tyres	Wheels/Tyres	Wheels/Tyres	Wheels/Tyres
Good	Good	Good	Good
Overall Condition	Overall Condition	Overall Condition	Overall Condition
Good	Good	Good	Good

Brake and shock absorber report

VEHICLE INFORMATION	
Make/Model	Year
Toyota Yaris	2017
DIAGNOSTIC REPORT	
Engine	Pass
Transmission	Pass
Brakes	Pass
Steering	Pass
Wheels/Tyres	Pass
Overall Condition	Pass

Diagnostic report page 1

VEHICLE INFORMATION	
Make/Model	Year
Toyota Yaris	2017
DIAGNOSTIC REPORT	
Engine	Pass
Transmission	Pass
Brakes	Pass
Steering	Pass
Wheels/Tyres	Pass
Overall Condition	Pass

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:

2017296801

DATE

10/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Wiper valance



Water level



Air cleaner



Engine mountings



Battery box



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Sun Roof Switch




Seat Rear



Indicator Light Front Right



Front Fender Right

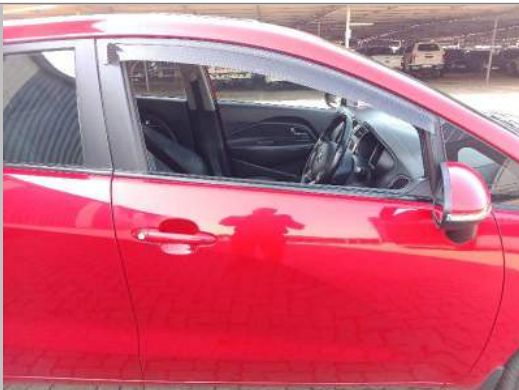

Door Front Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Rear Fender Right



Rear bumper



Roof



Rear Fender Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Front Fender Left



Indicator Light Front Left



Windscreen



Spare Tyre



Rim Front Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Control Arm Bush(es) Front Axle Right



Rim Front Right



Front Bumper



Front Bumper



Front Bumper



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026

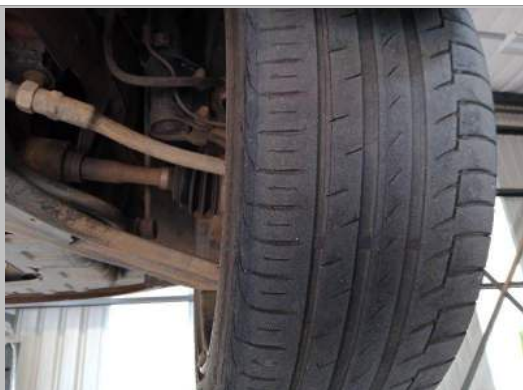

Tyre Front Right



Sub Frame



Engine



Stabilizer Mounting Front Right



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456



CONDITION REPORT



Report No:
2017296801
DATE
10/09/2026



Chassis



C • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6544456