



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/12/2023		M57 Pretoria Road - 1619
Inspection Date	14/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	DT97FYGP
Model	RIO	Register Number	
VIN	KNADN512LF6560805	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2022
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	168,237 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

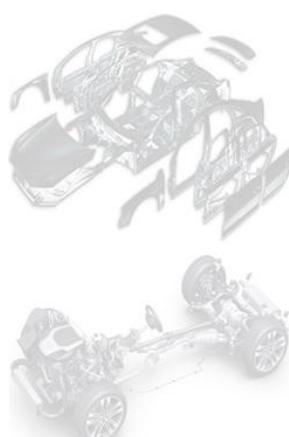

Damage	Repair Way
Engine Oil Leak	Repair
Tail Light Right Damaged	Replace
Dim Light Left Malfunction	Repair
Dim Light Right Malfunction	Repair
Fog Light Front Left Missing	Replace
Fog Light Front Right Defective	Repair
Seat Front Right Damaged	Repair
Gear Lever Dust Boot Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Sealing / Rubber Rear Door Left Missing	Replace
Sealing / Rubber Rear Door Right Damaged	Replace
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Dented	Repair
Windscreen Cracked	Replace
Tyre Front Left Torn / Cut	Replace
Clutch Operation Insufficient	Repair
Boot not opening cannot see spare wheel	Repair
L/F fender line missing	Replace
Steering wheel noisy	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNADN512LF6560805

1 / 12



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Damage	Repair Way
Front suspension noisy	Repair

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	2.9	-	-
Rear	1.3	1.3	-	-
Emergency / Parking	1.4	1.4	-	-

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	94W	Voyager	Hp	V	0419	1 mm
Front Right	225/45R17	91W	Continental	Contact	V	1316	1 mm
Rear Left	225/45R17	94W	Invovic	EI601	V	3616	1 mm
Rear Right	215/50R17	91W	Sava	Intensa	V	1916	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got some scratches, stone chips and dents on some body panels. Signs of spray work done on some body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: KNAFLN512115502001

Report No: 2016202101


2 / 12

DATE


14/12/2023

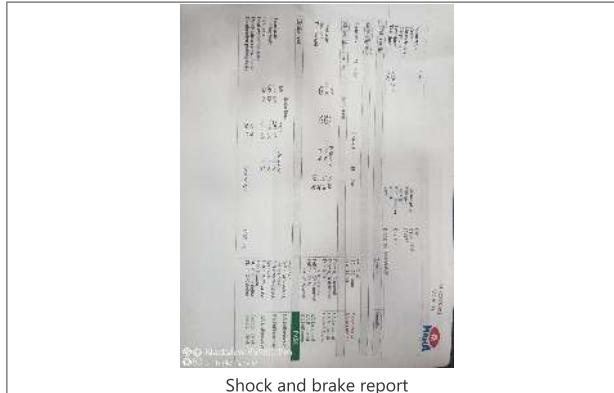

Shock and brake report

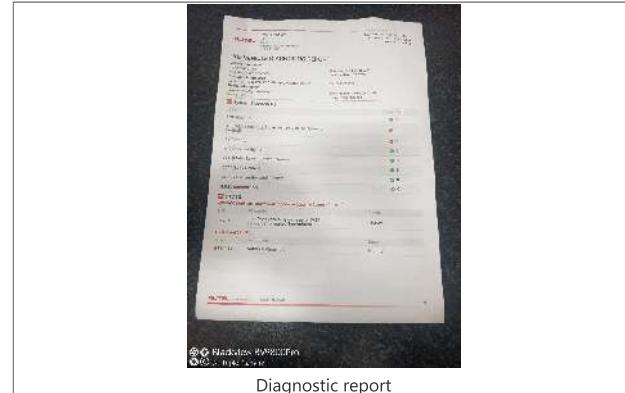

Diagnostic report

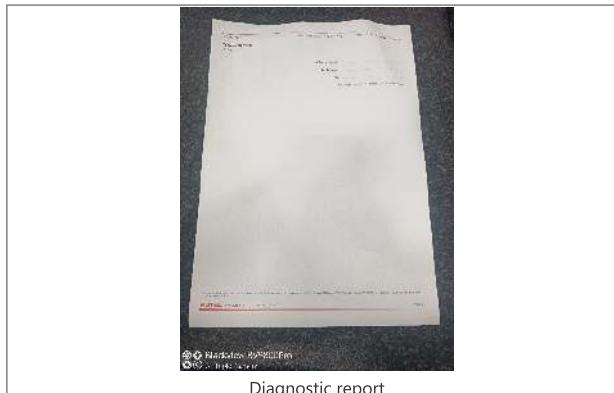

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016202101

VIN: KNADN512LF6560805

DATE

14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016202101

DATE

VIN: KNADN51415529023

4/12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

VIN: KNADN512LF6560805

5 / 12



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

VIN: KNADN512LF6560805

6 / 12



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

VIN: KNADN512LF6560805

7 / 12



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

ENGINE 1



VIN: KNADN512LF6560805

8 / 12

ENGINE 2



CHASSIS




Coolant bottle



Oil cap and dipstick



Manual

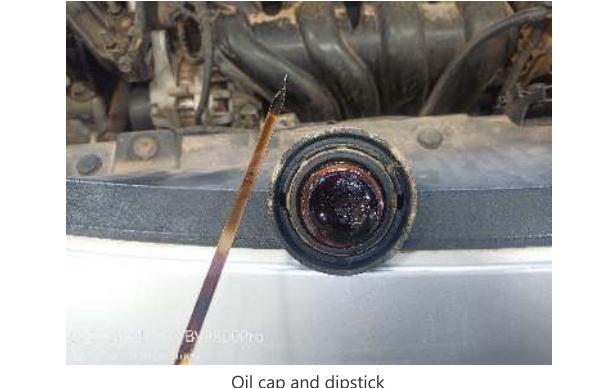

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

VIN: KNADN512LF6560805

9 / 12



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Windscreen



Water level



Seat Front Right



Gear Lever Dust Boot



Rear Fender Right



Door Rear Right



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

VIN: KNADN512LF6560805

11 / 12



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Door Front Right



Side Mirror Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Door Front Left



Door Rear Left



Rear Fender Left



Sealing / Rubber Rear Door Left



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Rear bumper



Sealing / Rubber Rear Door Right



Tail Light Right



Sill Panel Right



Sill Panel Left



Engine



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

Engine



Tyre Front Left



Dim Light Left



Dim Light Right



Fog Light Front Left



Fog Light Front Right



CONDITION REPORT

Report No: 2016202101

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za