



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 14/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 14/09/2026        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                              |                         |              |
|-----------------|----------------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                            | Registered Owner        |              |
| Manufacturer    | FORD                                         | Registration Number     | KG75WLGP     |
| Model           | FIGO 1.4 AMBIENTE BLUETOOTH 5-DR [2014-2016] | Register Number         |              |
|                 |                                              | Date Of First Licensing |              |
| VIN             | MAJ1XXMRJ1FE31737                            | Last COR                |              |
| Engine Number   |                                              | License Expiry Date     |              |
| Doors           | 5                                            | Power / Displacement    |              |
| Color           | GREEN                                        | Paint Finish            | PEARL EFFECT |
| Year Model      | 2016                                         | Fuel                    | PETROL       |
| Km Reading      | 160,349 KM                                   | Transmission            | MANUAL       |
| Cab / Body Type | HATCHBACK                                    |                         |              |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026

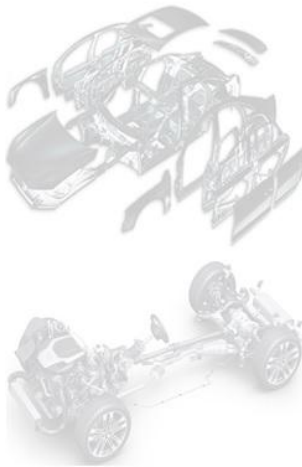

| Damage                                           | Repair Way |
|--------------------------------------------------|------------|
| Engine Wiring Defective                          | Repair     |
| Caps Missing                                     | Replace    |
| Under bonnet insulation cover Damaged            | Repair     |
| Radio/CD/USB Defective                           | Repair     |
| Tail Light Left Damaged                          | Replace    |
| Headlight Right Defective                        | Repair     |
| Seat Front Left Dirty                            | Repair     |
| Seat Front Right Dirty                           | Repair     |
| Window Winder rear left Defective                | Replace    |
| Boot Carpet Damaged                              | Repair     |
| Steering Wheel Trim Excessive Wear & Tear        | Repair     |
| Side Mirror Left Paintwork • Scratched           | Repair     |
| Front Bumper Paintwork • Scratched               | Repair     |
| Bonnet Damaged                                   | Repair     |
| B • Pillar Right Damaged                         | Repair     |
| C • Pillar Left Damaged                          | Repair     |
| C • Pillar Right Damaged                         | Repair     |
| Front Fender Left Dented                         | Repair     |
| Front Fender Right Residual Traces of Repair     | Repair     |
| Rear Fender Left Dented                          | Repair     |
| Rear Fender Right Paintwork • Scratched          | Repair     |
| Rear Fender Left / Inner Tray Dented             | Repair     |
| Door Front Left Dented                           | Repair     |
| Door Front Right Damaged                         | Repair     |
| Door Rear Left Damaged                           | Repair     |
| Boot Lid / Hatch door Residual Traces of Repair  | Repair     |
| Rear bumper Damaged                              | Repair     |
| Inner Boot Floor Pan and Spare Wheel Well Dented | Repair     |
| Roof Dented                                      | Repair     |
| Windscreen Chipped                               | Replace    |
| Tie Rod End left Cracked                         | Replace    |
| Steering Rack Defective                          | Repair     |
| Shock Absorber Rear Left Defective               | Replace    |
| Shock Absorber Rear Right Defective              | Replace    |
| Mounting Rubber(s) Rear Axle Left Cracked        | Replace    |
| Mounting Rubber(s) Rear Axle Right Cracked       | Replace    |
| Rim Spare Wheel Dented                           | Repair     |
| Bolt(s) / Nut(s) Rear Wheel Left Missing         | Replace    |
| Chassis Scratched                                | Repair     |
| Sub Frame Dented                                 | Repair     |
| Belly plates Damaged                             | Repair     |
| Gearbox Mountings Damaged                        | Replace    |
| Gearbox Damaged                                  | Repair     |
| Fuel Tank Damaged                                | Repair     |
| Gearbox Noise Excessive                          | Repair     |
| ABS warning light intermittent                   | Repair     |

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:

2017298325

DATE

14/09/2026

### Brakes

#### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.01               | 2.99               | -                |                                  |
| Rear                | 1.82               | 1.9                | -                |                                  |
| Emergency / Parking | 1.05               | 1.15               | -                |                                  |

### Tyres and Rims

#### Tyre Specification & Measurement

|             | Size       | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 175/65 R14 | 82H              | Annaite     | AN660     | V     | 1625            | 3 mm             |
| Front Right | 175/65 R14 | 82H              | Annaite     | AN668     | V     | 1625            | 3 mm             |
| Rear Left   | 175/65 R14 | 82H              | Fullrun     | Frun-one  | V     | 3720            | 1 mm             |
| Rear Right  | 175/65 R14 | 82H              | Fullrun     | Frun-one  | V     | 3720            | 1 mm             |
| Spare       | 175/65 R14 | 82H              | Windforce   | Catchfors | V     | 3624            | 4 mm             |

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System                         | Code     | Description                                        | Status |
|----|--------------------------------|----------|----------------------------------------------------|--------|
| 1  | PCM(POWERTRAIN CONTROL MODULE) | P1000-70 | CHECK OF ALL SYSTEMS IS NOT COMPLETE SINCE LAST ME |        |

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Windshield wiper bottle cap missing.

Electrical Components and Instruments: Boot release switch not opening.Radio needs code to operate.Vehicle electronics malfunction.

Lights: Front right headlight lens faded.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Poor residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.Signs of hail damage on body panels.

Steering: Steering rack leak.

Undercarriage: Oil leak on gearbox.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026

This document was created electronically and is valid without signature.

## General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Front chassis



Rear chassis



Spare Wheel



Spare Wheel Accessories



Oil cap and dipstick



Manual Transmission

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:

Report No.  
2017298325

DATE \_\_\_\_\_

14/09/2026

[illegible]

Brake and shock absorber report

| AUTEL            |  | DATE           | TIME |
|------------------|--|----------------|------|
| 1. 车型 (VEHICLE)  |  | 2. 日期 (DATE)   |      |
| 3. 车型 (VEHICLE)  |  | 4. 时间 (TIME)   |      |
| 5. 车型 (VEHICLE)  |  | 6. 时间 (TIME)   |      |
| 7. 车型 (VEHICLE)  |  | 8. 时间 (TIME)   |      |
| 9. 车型 (VEHICLE)  |  | 10. 时间 (TIME)  |      |
| 11. 车型 (VEHICLE) |  | 12. 时间 (TIME)  |      |
| 13. 车型 (VEHICLE) |  | 14. 时间 (TIME)  |      |
| 15. 车型 (VEHICLE) |  | 16. 时间 (TIME)  |      |
| 17. 车型 (VEHICLE) |  | 18. 时间 (TIME)  |      |
| 19. 车型 (VEHICLE) |  | 20. 时间 (TIME)  |      |
| 21. 车型 (VEHICLE) |  | 22. 时间 (TIME)  |      |
| 23. 车型 (VEHICLE) |  | 24. 时间 (TIME)  |      |
| 25. 车型 (VEHICLE) |  | 26. 时间 (TIME)  |      |
| 27. 车型 (VEHICLE) |  | 28. 时间 (TIME)  |      |
| 29. 车型 (VEHICLE) |  | 30. 时间 (TIME)  |      |
| 31. 车型 (VEHICLE) |  | 32. 时间 (TIME)  |      |
| 33. 车型 (VEHICLE) |  | 34. 时间 (TIME)  |      |
| 35. 车型 (VEHICLE) |  | 36. 时间 (TIME)  |      |
| 37. 车型 (VEHICLE) |  | 38. 时间 (TIME)  |      |
| 39. 车型 (VEHICLE) |  | 40. 时间 (TIME)  |      |
| 41. 车型 (VEHICLE) |  | 42. 时间 (TIME)  |      |
| 43. 车型 (VEHICLE) |  | 44. 时间 (TIME)  |      |
| 45. 车型 (VEHICLE) |  | 46. 时间 (TIME)  |      |
| 47. 车型 (VEHICLE) |  | 48. 时间 (TIME)  |      |
| 49. 车型 (VEHICLE) |  | 50. 时间 (TIME)  |      |
| 51. 车型 (VEHICLE) |  | 52. 时间 (TIME)  |      |
| 53. 车型 (VEHICLE) |  | 54. 时间 (TIME)  |      |
| 55. 车型 (VEHICLE) |  | 56. 时间 (TIME)  |      |
| 57. 车型 (VEHICLE) |  | 58. 时间 (TIME)  |      |
| 59. 车型 (VEHICLE) |  | 60. 时间 (TIME)  |      |
| 61. 车型 (VEHICLE) |  | 62. 时间 (TIME)  |      |
| 63. 车型 (VEHICLE) |  | 64. 时间 (TIME)  |      |
| 65. 车型 (VEHICLE) |  | 66. 时间 (TIME)  |      |
| 67. 车型 (VEHICLE) |  | 68. 时间 (TIME)  |      |
| 69. 车型 (VEHICLE) |  | 70. 时间 (TIME)  |      |
| 71. 车型 (VEHICLE) |  | 72. 时间 (TIME)  |      |
| 73. 车型 (VEHICLE) |  | 74. 时间 (TIME)  |      |
| 75. 车型 (VEHICLE) |  | 76. 时间 (TIME)  |      |
| 77. 车型 (VEHICLE) |  | 78. 时间 (TIME)  |      |
| 79. 车型 (VEHICLE) |  | 80. 时间 (TIME)  |      |
| 81. 车型 (VEHICLE) |  | 82. 时间 (TIME)  |      |
| 83. 车型 (VEHICLE) |  | 84. 时间 (TIME)  |      |
| 85. 车型 (VEHICLE) |  | 86. 时间 (TIME)  |      |
| 87. 车型 (VEHICLE) |  | 88. 时间 (TIME)  |      |
| 89. 车型 (VEHICLE) |  | 90. 时间 (TIME)  |      |
| 91. 车型 (VEHICLE) |  | 92. 时间 (TIME)  |      |
| 93. 车型 (VEHICLE) |  | 94. 时间 (TIME)  |      |
| 95. 车型 (VEHICLE) |  | 96. 时间 (TIME)  |      |
| 97. 车型 (VEHICLE) |  | 98. 时间 (TIME)  |      |
| 99. 车型 (VEHICLE) |  | 100. 时间 (TIME) |      |

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:

2017298325

DATE

14/09/2026



ENGINE 1



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT




Report No:  
2017298325  
DATE  
14/09/2026



Door Rear Left



Door Front Left

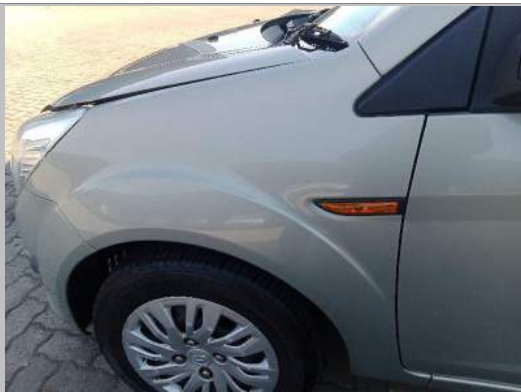

Front Fender Left



Side Mirror Left



Windscreen



Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Front Fender Right



Door Front Right



Rear Fender Right



Rear Fender Right



Headlight Right



Under bonnet insulation cover

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Water level



B • Pillar Right



Steering Wheel Trim



B • Pillar Right



Seat Front Right



Window Winder rear left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Seat Front Left



C • Pillar Right



C • Pillar Left



Radio/CD/USB



Boot Carpet



Rim Spare Wheel

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well




Roof



Front Bumper



Front Bumper

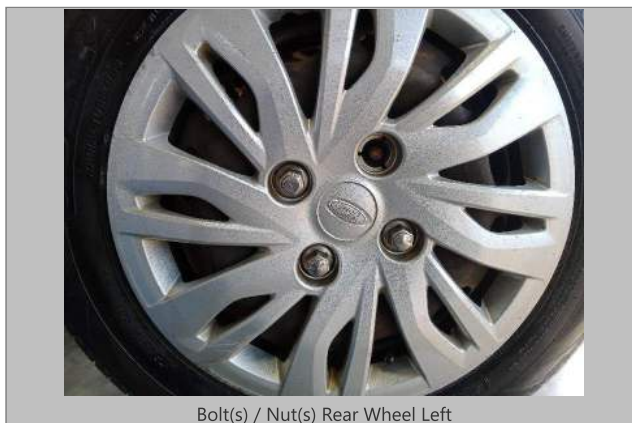

Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Gearbox



Gearbox



Gearbox Mountings



Steering Rack



Sub Frame



Sub Frame

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Chassis



Chassis



Chassis



Tie Rod End left



Engine Wiring



Belly plates

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737



## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Fuel Tank



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Shock Absorber Rear Right



Shock Absorber Rear Left



Rear Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737




## CONDITION REPORT



Report No:  
2017298325  
DATE  
14/09/2026



Caps

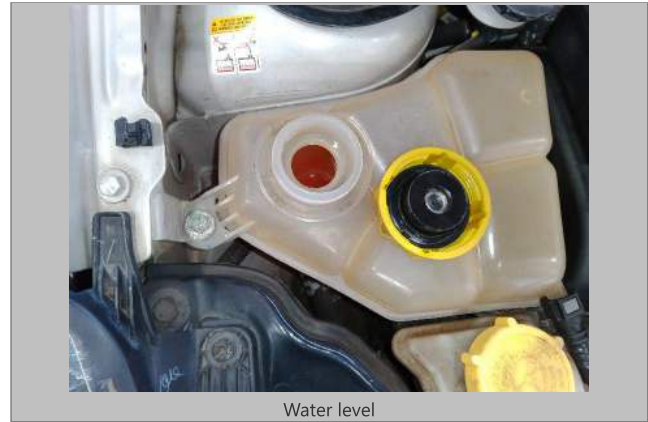

Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MAJ1XXMRJ1FE31737