



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/08/2026		M57 Pretoria Road - 1619
Inspection Date	20/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	CT97NCGP
Model	ECOSPORT 1.5 TDCI TREND DSL [2013-2014]	Register Number	
VIN	MAJAXXMRKADA32926	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	GREY	Power / Displacement	
Year Model	2013	Paint Finish	M - METALLIC
Km Reading	256,747 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Chipmarks	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Fuel Flap Poor Alignment	Repair
Gearbox Oil Leak	Repair
L/R tire deferred name brand	Repair
Engine light on	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	4.0	-	
Rear	1.9	2.4	-	
Emergency / Parking	1.4	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/60R16	92V	Apollo	Alnac	V	5020	3 mm
Front Right	205/60R16	92V	Apollo	Alnac	V	0521	2 mm
Rear Left	205/60R16	92H	Michelin	Energy	V	3713	3 mm
Rear Right	205/60R16	92V	Apollo	Alnac	V	1321	3 mm
Spare	205/60R16	92V	Apollo	Alnac	V	0521	3 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	B1D00:15-48	LEFT LOW BEAM	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Car				Car			
Model/Type	Ford EcoSport			Model/Type	Ford EcoSport		
Registration	MAJAXX			Registration	MAJAXX		
Test date	20/08/2026			Test date	20/08/2026		
Test time	10:22			Test time	10:22		
Test results				Test results			
Shock absorber test				Shock absorber test			
Shock absorber test	Pass			Shock absorber test	Pass		
Brake test				Brake test			
Brake test	Pass			Brake test	Pass		
Steering test				Steering test			
Steering test	Pass			Steering test	Pass		
Light test				Light test			
Light test	Pass			Light test	Pass		
Wash/wax test				Wash/wax test			
Wash/wax test	Pass			Wash/wax test	Pass		
Final inspection				Final inspection			
Final inspection	Pass			Final inspection	Pass		

Shock and brake report


Car		Car	
Model/Type	Ford EcoSport	Model/Type	Ford EcoSport
Registration	MAJAXX	Registration	MAJAXX
Test date	20/08/2026	Test date	20/08/2026
Test time	10:22	Test time	10:22
Test results		Test results	
Shock absorber test	Pass	Shock absorber test	Pass
Brake test	Pass	Brake test	Pass
Steering test	Pass	Steering test	Pass
Light test	Pass	Light test	Pass
Wash/wax test	Pass	Wash/wax test	Pass
Final inspection	Pass	Final inspection	Pass

Diagnostic report




Blank lined paper with a vertical margin line on the left and horizontal ruling lines. The paper is slightly aged and has some faint smudges. It is placed on a dark, textured surface.

Diagnostic report

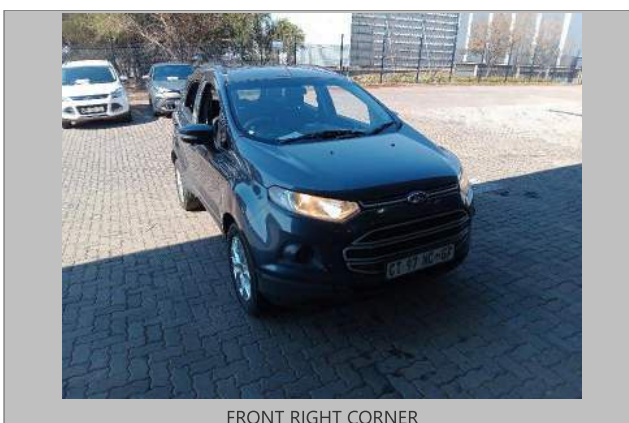

FRONT RIGHT CORNER

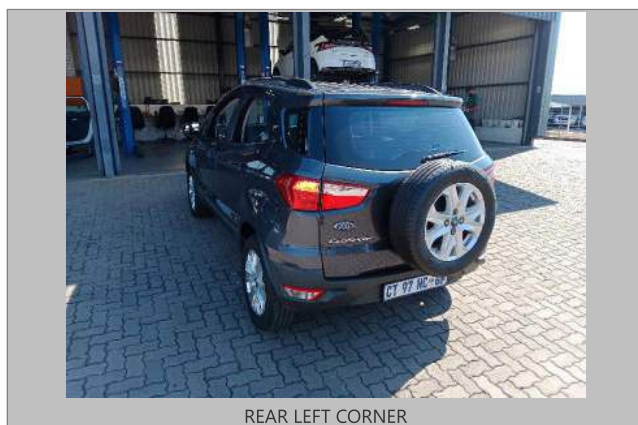

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick



Expection bottle



Water level



Bonnet



Fuel Flap



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Fender Left



Door Front Left



Side Mirror Left



Rear Fender Left



Door Rear Left



Rear bumper



Rear bumper



Gearbox