



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	JL97JSGP
Model	ATOS 1.1 50KW MOTION 5-DR [2019-2024]	Register Number	
VIN	MALAF51CLLM095617	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	316,660 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Defective	Replace
Radio/CD/USB Defective	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Damaged	Repair
Dash Padding Damaged	Repair
Boot Carpet Damaged	Repair
Clutch Pedal Rubber Missing	Replace
Brake Pedal Rubber Damaged	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Front Bumper Damaged	Replace
Grill Cracked	Replace
Bonnet Damaged	Repair
B • Pillar Right Damaged	Repair
C • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Rear Fender Right / Inner Tray Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Doorstopper Rear Left Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Boot Lid / Hatch Door Rubbers Damaged	Replace
Rear bumper Damaged	Replace
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Brake Piping Damaged	Replace
Parking Brake Performance Insufficient	Repair
Tie Rod End right Loose / Excessive Play	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace
Rim Front Left Dented	Repair
Rim Front Right Dented	Repair
Rim Rear Right Scratched	Repair
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Main Beam Left Damaged	Repair
Chassis Dented	Repair
Engine to silencer pipe Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:

2017297476

DATE

11/09/2026

Damage

Repair Way

Belly plates Damaged	Repair
Gearbox Oil Leak	Repair
Radiator Cradle Damaged	Replace
Steering Noisy	Repair
Brakes Insufficient	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Loose sound wiring inside boot of vehicle	Replace
Foreign substance on oil cap	Repair
Signs of vehicle overheating	Repair
Fan Cowley damaged	Replace
Engine oil sump dented	Repair
Clutch fork welded	Replace
Bottom flywheel dust plate missing	Replace
Front and rear tyre sizes different	Repair
Deceleration service brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.36	2.5	-	
Rear	0.19	0.82	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/65 R14	79S	Dunlop	Enasave	V	1621	2 mm
Front Right	175/65 R14	82H	Feiyue	Radial	V	2123	2 mm
Rear Left	175/65 R14	82T	Dunlop	Sp-Sport	V	1724	0 mm
Rear Right	175/70 R13	82T	Goodride	Radial	V	0120	0 mm
Spare	165/70 R14	81T	Goodyear	Assurance	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Non standard battery fitted to vehicle and strapped with a wire.

Electrical Components and Instruments: Radio not working. Non standard switch fitted on driver's side.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels. Signs of impact damage to front of vehicle.

Brakes: Rear left brake piping damaged.

Undercarriage: Some bolts missing on gearbox.

Road Test: Vehicle unsafe to drive.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE LEFT



90 DEGREE RIGHT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories



Front chassis



Rear chassis



Sound wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:

2017297476

DATE

11/09/2026



Oil cap and dipstick



Fan Cowley



Engine oil sump



Clutch fork



ENGINE 1



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:

2017297476

DATE _____

11/09/2026



LICENSE DISC



DIAGNOSTIC REPORT

[illegible]

SHOCK AND BRAKE REPORT



Clutch Pedal Rubber



Brake Pedal Rubber



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Hood Lining



Center Console / Cubbyhole + Lid



Radio/CD/USB



Dash Padding



Hood Lining



Dash Padding

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



B • Pillar Right



Seat Front Right



Seat Rear



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Front Fender Right



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Door Rear Left



Door Front Left



Front Fender Left



Seat Rear



C • Pillar Left



Doorstopper Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Seat Front Left



Headlight Left



Headlight Right



Bonnet



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Front Bumper



Windscreen



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Boot Carpet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Seat Rear



Boot Lid / Hatch Door Rubbers



Engine Wiring



Main Beam Left



Hoses



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Sill Panel Right



Rim Front Right



Control Arm Bush(es) Front Axle Right



Grill



Rim Front Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Sill Panel Left



Bolt(s) / Nut(s) Rear Wheel Left



Rim Rear Right



Rear Fender Right / Inner Tray



Tie Rod End right



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Belly plates



Gearbox



Engine



Stabilizer Mounting Front Right



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026



Tyre Rear Right



Tyre Rear Left



Brake Piping



Inner Boot Floor Pan and Spare Wheel Well



Engine to silencer pipe



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617



CONDITION REPORT



Report No:
2017297476
DATE
11/09/2026




Water level



Water level



Roof

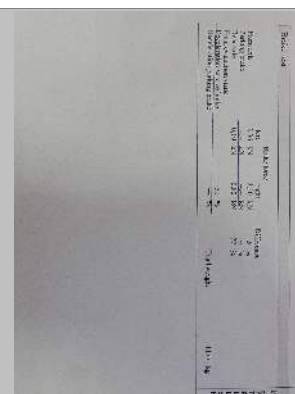

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAF51CLLM095617