



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/09/2026		M57 Pretoria Road - 1619
Inspection Date	15/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	LD48ZDGP
Model	GRAND I10 1.0 MOTION 5-DR [2020-2024]	Register Number	
VIN	MALB251ALPM397204	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	SILVER	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	34,130 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:

2017299103

DATE

15/09/2026

Damage

Repair Way

Front Bumper Dented	Repair
Bonnet Paintwork • Scratched	Repair
C • Pillar Left Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Damaged	Repair
Door Front Right Dented	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Silencer Defective	Repair
Gearbox Oil Sweat	Repair
Clutch Operation Insufficient	Repair
Rear left interior sill panel plastic trim damaged	Replace
Foreign substance on oil cap	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.24	2.66	-	
Rear	1.7	1.68	-	
Emergency / Parking	1.36	1.06	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81T	Goodyear	Assurance	V	4822	1 mm
Front Right	165/70 R14	81T	Goodyear	Assurance	V	5022	3 mm
Rear Left	165/70 R14	81T	Goodyear	Assurance	V	5022	3 mm
Rear Right	165/70 R14	81T	Goodyear	Assurance	V	5022	5 mm
Spare	165/70 R14	81T	Goodyear	Assurance	V	5022	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:

2017299103

DATE

15/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Road Test: Gear selection faulty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026

TEST RESULTS			
Test name	Limit	Result	
Brake test			
Front axle	1.200 s	1.200 s	OK
Rear axle	1.200 s	1.200 s	OK
Shock absorber test			
Front axle	0.000 s	0.000 s	OK
Rear axle	0.000 s	0.000 s	OK
Brake test			
Front axle	1.200 s	1.200 s	OK
Rear axle	1.200 s	1.200 s	OK
Shock absorber test			
Front axle	0.000 s	0.000 s	OK
Rear axle	0.000 s	0.000 s	OK

Brake and shock absorber report

VEHICLE DIAGNOSTIC REPORT			
Test name	Limit	Result	
Engine oil level	0.000 s	0.000 s	OK
Brake oil level	0.000 s	0.000 s	OK
Water level	0.000 s	0.000 s	OK
Engine oil pressure	0.000 s	0.000 s	OK
Brake oil pressure	0.000 s	0.000 s	OK
Water pressure	0.000 s	0.000 s	OK
Engine oil temperature	0.000 s	0.000 s	OK
Brake oil temperature	0.000 s	0.000 s	OK
Water temperature	0.000 s	0.000 s	OK
Engine oil level	0.000 s	0.000 s	OK
Brake oil level	0.000 s	0.000 s	OK
Water level	0.000 s	0.000 s	OK
Engine oil pressure	0.000 s	0.000 s	OK
Brake oil pressure	0.000 s	0.000 s	OK
Water pressure	0.000 s	0.000 s	OK
Engine oil temperature	0.000 s	0.000 s	OK
Brake oil temperature	0.000 s	0.000 s	OK
Water temperature	0.000 s	0.000 s	OK

Diagnostic report page 1

VEHICLE DIAGNOSTIC REPORT			
Test name	Limit	Result	
Engine oil level	0.000 s	0.000 s	OK
Brake oil level	0.000 s	0.000 s	OK
Water level	0.000 s	0.000 s	OK
Engine oil pressure	0.000 s	0.000 s	OK
Brake oil pressure	0.000 s	0.000 s	OK
Water pressure	0.000 s	0.000 s	OK
Engine oil temperature	0.000 s	0.000 s	OK
Brake oil temperature	0.000 s	0.000 s	OK
Water temperature	0.000 s	0.000 s	OK
Engine oil level	0.000 s	0.000 s	OK
Brake oil level	0.000 s	0.000 s	OK
Water level	0.000 s	0.000 s	OK
Engine oil pressure	0.000 s	0.000 s	OK
Brake oil pressure	0.000 s	0.000 s	OK
Water pressure	0.000 s	0.000 s	OK
Engine oil temperature	0.000 s	0.000 s	OK
Brake oil temperature	0.000 s	0.000 s	OK
Water temperature	0.000 s	0.000 s	OK

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT




Report No:
2017299103
DATE
15/09/2026



90 DEGREE LEFT



LF TYRE TREAD

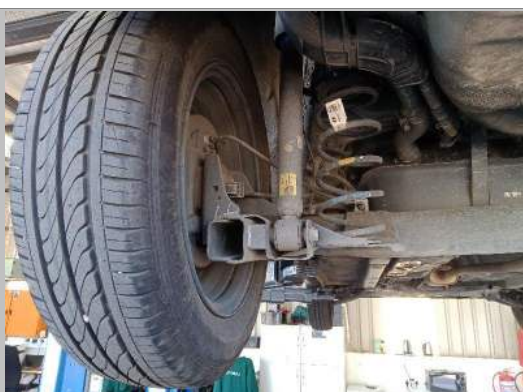

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:

2017299103

DATE

15/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026



Rear left interior sill panel



Rear Fender Right



Door Rear Right



Door Front Right



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026



Front Fender Left



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204



CONDITION REPORT



Report No:
2017299103
DATE
15/09/2026



Front Bumper



Front Bumper



Gearbox



Silencer



Water level



C • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALB251ALPM397204