



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/03/2024		M57 Pretoria Road - 1619
Inspection Date	13/03/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	KH57WLGP
Model	i20	Register Number	
VIN	MALBM51CLKM538344	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	83,010 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

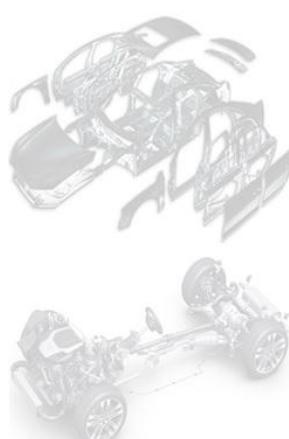

Damage	Repair Way
Battery box Damaged	Replace
Center Console / Cubbyhole + Lid Defective	Repair
Windscreen Wiper Damaged	Replace
Dim Light Left Damaged	Replace
Dim Light Right Damaged	Replace
Bright Light Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Boot Carpet Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Paintwork • Scratched	Repair
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Chassis Dented	Repair
Sub Frame Scratched	Replace
Belly plates Defective	Repair
Radiator Cradle Cracked	Repair
Interior	Vehicle interior dirty and some panels scratched

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MALBM51CLKM538344

1 / 13



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Damage	Repair Way
Engine	Engine bay dirty.
Engine	Signs of rodent in engine bay
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Undercarriage	Vehicle undercarriage dirty.

**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.71	2.71	-	
Rear	2.27	2.35	-	
Emergency / Parking	1.68	1.63	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55 R16	87V	Bridgestone	B250	V	1018	4 mm
Front Right	195/55 R16	87V	Hilo	Genesys	V	1521	4 mm
Rear Left	195/55 R16	87V	Hilo	Genesys	V	1421	4 mm
Rear Right	195/55 R16	87V	Hilo	Genesys	V	1521	4 mm
Spare	195/55 R16	87V	Hilo	Genesys	V	1421	5 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

**Inspection Conditions**

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT


VIN: V1VLMU1C1M1530384

Report No: 2016303384


2 / 13

DATE


13/03/2024

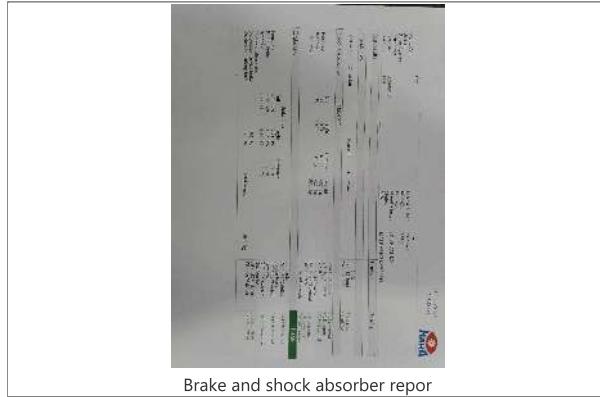

Brake and shock absorber report

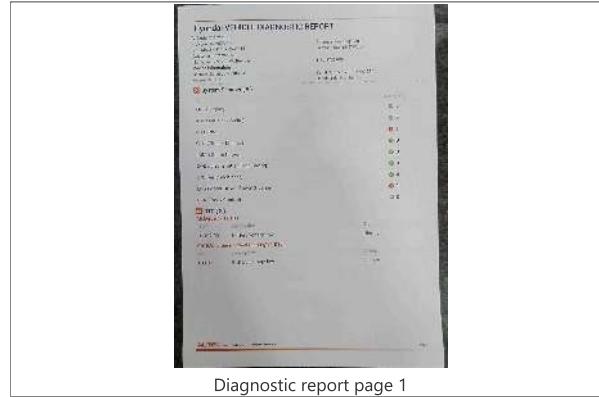


Diagnostic report page 1

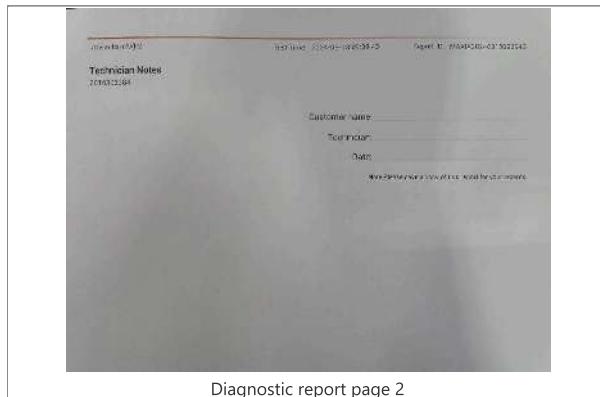

Diagnostic report page 2



FRONT RIGHT CORNER

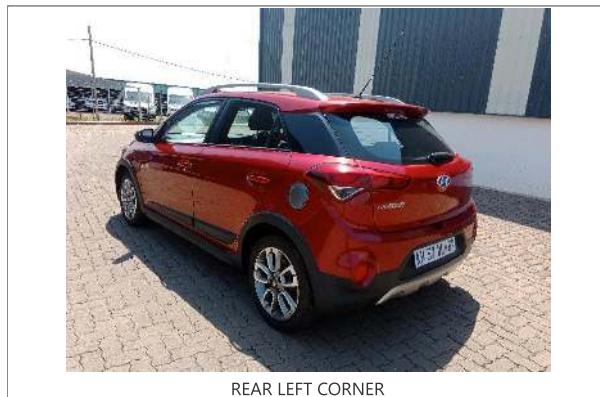

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016303384**

VIN: MALBM51CLKM538344

**DATE**

13/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE

VIN: MALBM51C151032024

15/03/2024

4 / 13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

5 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

6 / 13



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

7 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 201630334

DATE  
13/03/2024

LICENSE DISC



VIN: MALBM51CLKM538344

8 / 13



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

9 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Seat Front Right



Seat Rear



Sill Panel Right




Door Front Right



Door Rear Right



Front Fender Right

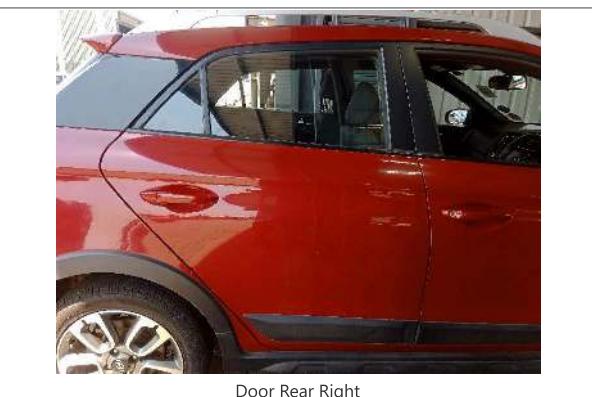



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

11 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Front Bumper



Front Bumper



Bonnet



Door Front Left



Windscreen Wiper



Seat Front Left





## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

VIN: MALBM51CLKM538344

13 / 13



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Seat Rear



Rear bumper



Rear bumper



Windscreen Wiper



Dim Light Right



Bright Light Right



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Dim Light Left



Boot Carpet



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Battery box



Water level



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

Rim Front Right



Rim Rear Left




Rim Front Left



Rocker Panel Left



Sub Frame

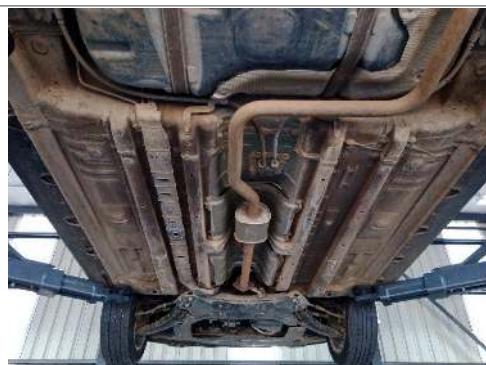

Chassis



## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT


Report No: 2016303384

DATE  
13/03/2024

Chassis



Radiator Cradle

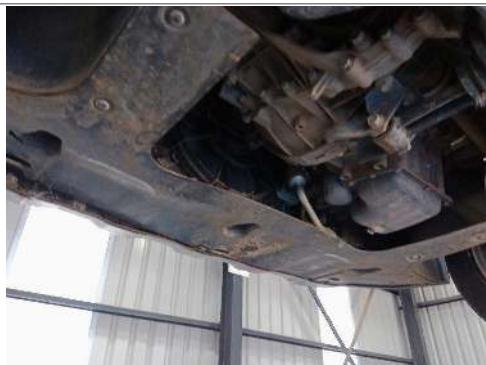

Belly plates



Center Console / Cubbyhole + Lid





## CONDITION REPORT

Report No: 2016303384

DATE  
13/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)