



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/02/2024		M57 Pretoria Road - 1619
Inspection Date	01/02/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	JF15GCGP
Model	KWID	Register Number	
VIN	MEEBBA00400660941	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	47,075 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

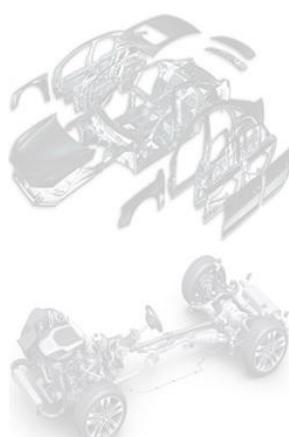

Damage	Repair Way
Engine Oil Leak	Repair
Headlight Left Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Lock Boot Lid Damaged	Replace
Parcel Tray Damaged	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Service Brake Performance Rear Axle Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Jack Missing	Replace
Wheel Spanner Missing	Replace

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MEEBBA00400660941

1 / 12



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Damage	Repair Way
Triangle Missing ABS warning light illuminated on dashboard.	Replace Repair

**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	1.66	1.99	-	
Rear	1.15	1.23	-	
Emergency / Parking	0.85	0.73	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80 R13	79T	Ceat	Milaze	V	1319	4 mm
Front Right	155/80 R13	79T	Ceat	Milaze	V	0619	4 mm
Rear Left	155/80 R13	79T	Ceat	Milaze	V	1319	7 mm
Rear Right	155/80 R13	79T	Ceat	Milaze	V	0819	6 mm
Spare	155/80 R13	79T	Ceat	Milaze	V	2019	5 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJECTION	DTC025A13	FUEL PUMP RELAY CONTROL CIRCUIT OPEN CIRCUIT	

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: VEHICLE LICENSE DISK INSIDE CUBBYHOLE.  
Interior: Vehicle interior dirty and some interior panels scratched.  
Body • Exterior: Dents and scratches on some body panels.Spray work on some body panels.Some body panels misaligned.Stone chips on some bo

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE  
ACCORDING TO THE AGE AND  
MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND  
MECHANICAL PARTS.

**Technician**

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT


VIN: MVEFDAD02000290636

Report No: 2000290636


2 / 12

DATE


01/02/2024

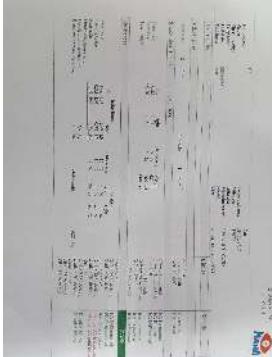

Brake and shock absorber report

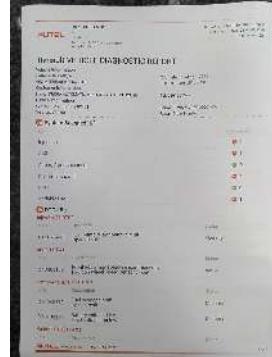

Diagnostic report page 1

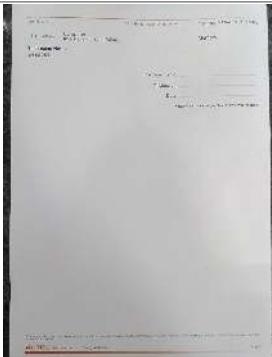

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016250636**

VIN: MEEBBA00400660941

**DATE**

01/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE

VIN: MEEBBA0100292024

01/02/2024

4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN: MEEBBA00400660941

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN: MEEBBA00400660941

6 / 12



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC





## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN: MEEBBA00400660941

7 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Manual Transmission



Oil cap and dipstick



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN: MEEBBA00400660941

9 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Hood Lining



Steering Wheel Trim



Seat Front Right



Door Sealing Rubber Front Right



Seat Front Left



Windscreen



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

VIN: MEEBBA00400660941

11 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Front Bumper



Front Bumper



Bonnet



Headlight Left



Service Brake Performance Rear Axle



Rear bumper



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Rear bumper



Parcel Tray



Door Lock Boot Lid



Boot Lid / Hatch door



Control Arm Bush(es) Front Axle Right



Door Front Right



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Door Rear Right



Rear Fender Right



Door Rear Left



Door Front Left



Front Fender Left



Control Arm Bush(es) Front Axle Left



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

Engine



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Water level



Front Fender Left / Inner Tray



## CONDITION REPORT

Report No: 2016250636

DATE  
01/02/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)