



CONDITION REPORT



Report No:

2017293640

DATE

03/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	03/09/2026		M57 Pretoria Road - 1619
Inspection Date	03/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	LG18WRGP
Model	TRIBES	Register Number	
VIN	MEERBC00200164157	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2026
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	171,975 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026

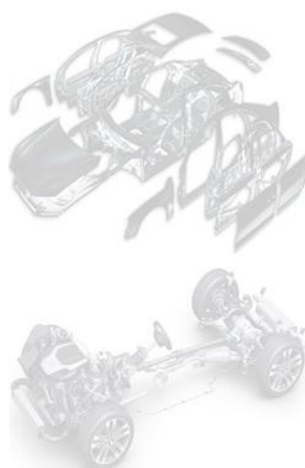

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Caps Damaged	Replace
Hoses Defective	Replace
Expansion Bottle Water Leak	Replace
Fan Belt Missing	Replace
Under bonnet insulation cover Damaged	Replace
Windscreen Washer Damaged	Repair
Air Conditioner Insufficient	Replace
Tail Light Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Seat Rear (2. Row) Dirty	Repair
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Carpet Rear Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Firewall Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Dented	Repair
Front Fender Right / Inner Tray Dented	Repair
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Dented	Repair
Door Rear Left Damaged	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Dented	Repair
Roof Damaged	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Sweat	Replace
Shock Absorber Front Right Sweat	Replace
Shock Absorber Rear Left Damaged	Replace
Shock Absorber Rear Right Sweat	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Main Beam Left Dented	Repair
Main Beam Right Damaged	Repair
Chassis Dented	Repair
Engine mountings Damaged	Replace
Gearbox Mountings Cracked	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Dented	Repair
Engine Smoke Excessive	Repair
Warning light illuminated on dashboard	Repair
Front right shock absorber weak	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026

Damage	Repair Way
Rear left and right shock absorbers weak	Replace
Foreign substance on oil cap	Repair.
Front bumper stiffener dented	Repair
Spare Wheel missing	Replace
Rear left and right tyre sizes different	Repair
Firewall insulation cover damaged	Replace

Brakes

Brake Test Results

	Left Braking Force [KN]	Right Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.02	2.03	-	
Rear	1.75	1.59	-	
Emergency / Parking	1.21	0.95	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/65 R14	75S	Goodyear	Efficient	V	3823	2 mm
Front Right	155/65 R14	75S	Goodyear	Efficient	V	3223	4 mm
Rear Left	165/60 R14	75H	Annaite	AN600	V	1924	1 mm
Rear Right	185/65 R14	86H	Sumitomo	HTR	V	2723	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC001313	EXHAUST CAMSHAFT SHIFTER OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Oil sweat on brake booster.Air-conditioning belt.Foreign substance inside expansion bottle.

Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Boot does not open.Signs of impact damage to front and rear of vehicle.Body panels misaligned.Dents and scratches on body panels

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:

2017293640

DATE

03/09/2026

Axle and Suspension: Front suspension faulty.

Undercarriage: Vehicle undercarriage dirty

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MEERBC00200164157




CONDITION REPORT




Report No:
2017293640
DATE
03/09/2026

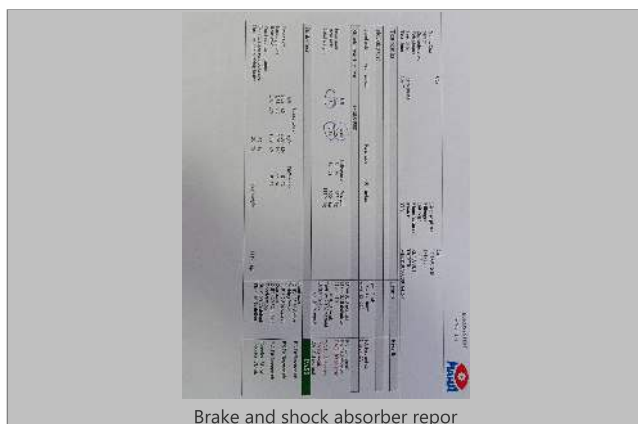


Brake and shock absorber report

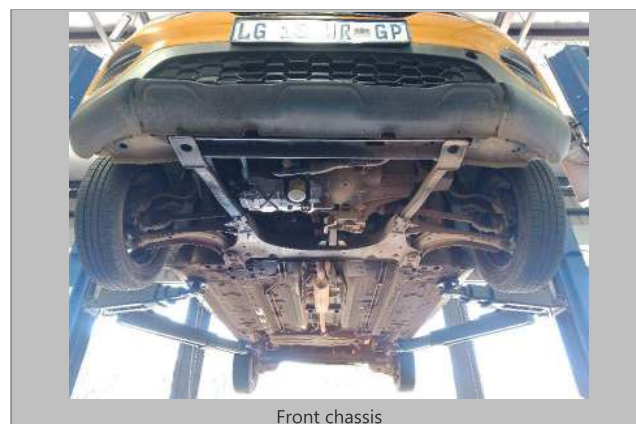


Front chassis

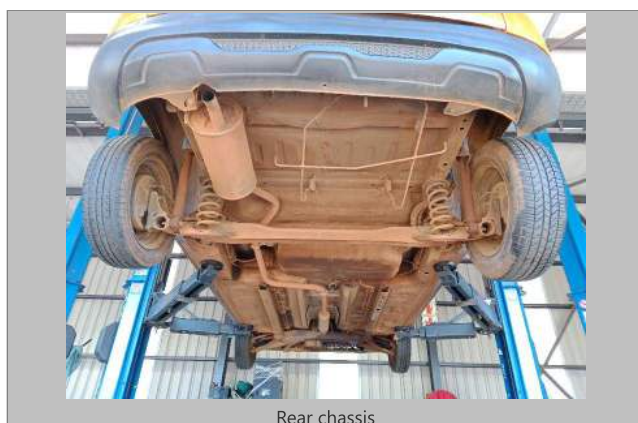


Rear chassis

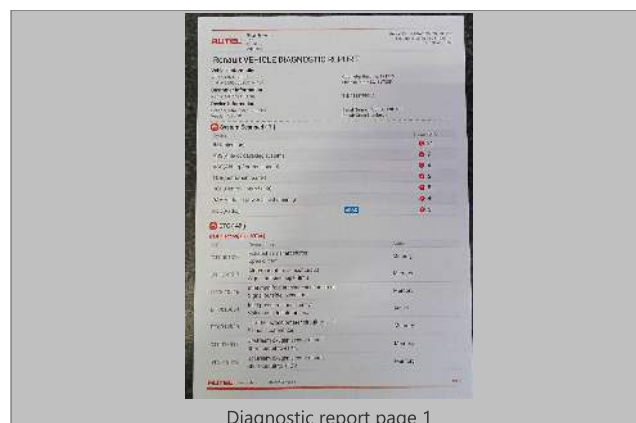

Diagnostic report page 1

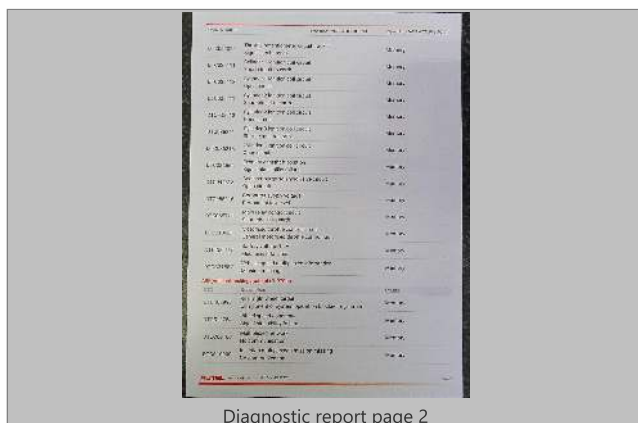

Diagnostic report page 2

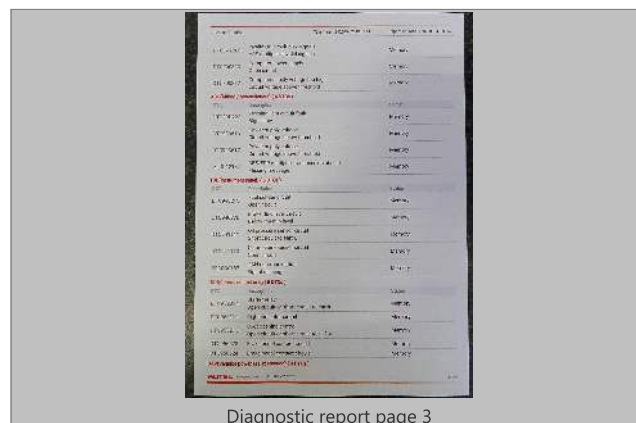

Diagnostic report page 3

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:

2017293640

DATE

03/09/2026



Diagnostic report page 4



Front bumper stiffener



Firewall insulation cover



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:

2017293640

DATE

03/09/2026




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

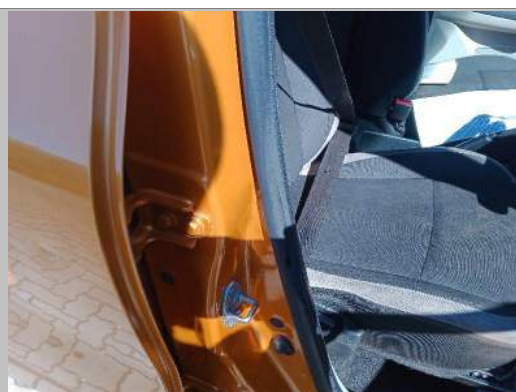

Door Sealing Rubber Front Right



Seat Front Right



Seat Rear (2. Row)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026




Seat Rear



Rear Fender Right



Door Rear Right

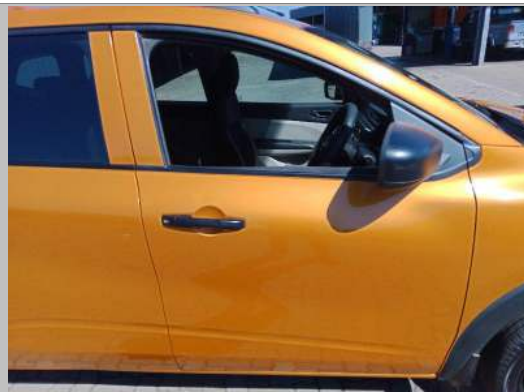

Door Front Right



Front Fender Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT




Report No:
2017293640
DATE
03/09/2026



Bonnet



Windscreen

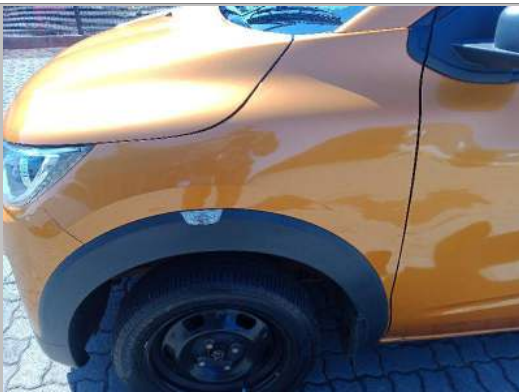

Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Seat Front Left



Seat Rear



Door Sealing Rubber Rear Left



Carpet Rear



Boot Lid / Hatch door



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Rear bumper



Rear bumper



Tail Light Right



Steering Wheel Trim



Hood Lining



Air Conditioner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Caps



Engine Wiring



Engine mountings



Engine Wiring



Front Fender Left / Inner Tray



Front Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Shock Absorber Front Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Sill Panel Right



Sill Panel Left



Shock Absorber Front Left



Shock Absorber Rear Left



Shock Absorber Rear Right



Rear Fender Right / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Main Beam Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Engine



Fan Belt



Gearbox Mountings



Gearbox Mountings

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Chassis



Chassis



Inner Boot Floor Pan and Spare Wheel Well



Main Beam Left



Radiator Cradle



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157



CONDITION REPORT



Report No:
2017293640
DATE
03/09/2026



Hoses



Firewall



Expansion Bottle



Under bonnet insulation cover



Windscreen Washer



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00200164157