



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/08/2026		M57 Pretoria Road - 1619
Inspection Date	27/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	MC90PDGP
Model	TRIBER	Register Number	
VIN	MEERBC00900218361	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	99,238 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:

2017290034

DATE

27/08/2026

Damage

Repair Way

Headlight Left Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Foreign substance on oil cap	Repair
L/F fender liner damage	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.5	-	
Rear	1.7	1.6	-	
Emergency / Parking	0.9	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	88T	Fronway	Eco green	V	1526	4 mm
Front Right	175/70R14	88T	Fronway	Eco green	V	1526	4 mm
Rear Left	175/70R14	88T	Fronway	Eco green	V	1526	4 mm
Rear Right	175/70R14	88T	Fronway	Eco green	V	1526	4 mm
Spare	185/65R14	86H	Hilo	Genesys xp1	V	////	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	MEMORY	DTC056016	COMPUTER SUPPLY VOLTAGE PERMANENT LOW LEVEL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026

Vehicle Information		Engine Information		Transmission Information	
Make/Model	DAEWOO TACUS	Engine No.	4G54	Transmission No.	4D50
Year	2004	Engine Type	Gasoline	Transmission Type	Manual
Color	White	Engine Capacity	1.8L	Transmission Capacity	5-Speed
Registration	1234567	Engine Power	100 kW	Transmission Power	100 kW
Inspection Date	2026-08-27	Inspection Location	DEKRA	Inspection Technician	John Doe

Shock and brake report

Vehicle Information		Engine Information		Transmission Information	
Make/Model	DAEWOO TACUS	Engine No.	4G54	Transmission No.	4D50
Year	2004	Engine Type	Gasoline	Transmission Type	Manual
Color	White	Engine Capacity	1.8L	Transmission Capacity	5-Speed
Registration	1234567	Engine Power	100 kW	Transmission Power	100 kW
Inspection Date	2026-08-27	Inspection Location	DEKRA	Inspection Technician	John Doe

Diagnostic report

Vehicle Information		Engine Information		Transmission Information	
Make/Model	DAEWOO TACUS	Engine No.	4G54	Transmission No.	4D50
Year	2004	Engine Type	Gasoline	Transmission Type	Manual
Color	White	Engine Capacity	1.8L	Transmission Capacity	5-Speed
Registration	1234567	Engine Power	100 kW	Transmission Power	100 kW
Inspection Date	2026-08-27	Inspection Location	DEKRA	Inspection Technician	John Doe

Diagnostic report

Vehicle Information		Engine Information		Transmission Information	
Make/Model	DAEWOO TACUS	Engine No.	4G54	Transmission No.	4D50
Year	2004	Engine Type	Gasoline	Transmission Type	Manual
Color	White	Engine Capacity	1.8L	Transmission Capacity	5-Speed
Registration	1234567	Engine Power	100 kW	Transmission Power	100 kW
Inspection Date	2026-08-27	Inspection Location	DEKRA	Inspection Technician	John Doe

Diagnostic report



Spare wheel



Expenditure bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026



Oil cap and dipstick



Manual



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026



ODOMETER



90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

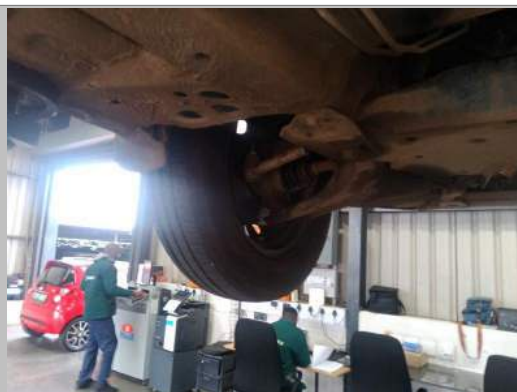

LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT




Report No:
2017290034
DATE
27/08/2026



LR TYRE TREAD



RR TYRE TREAD

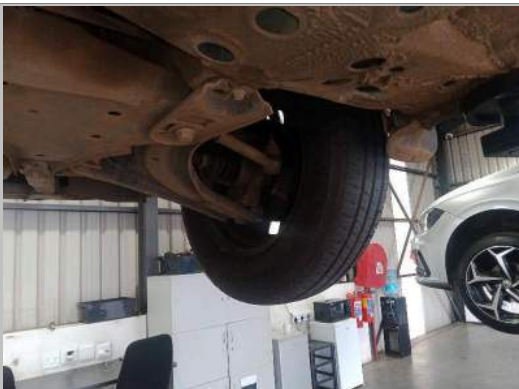

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026



ENGINE 2



CHASSIS



Water level



Headlight Left



Bonnet



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT




Report No:

2017290034

DATE

27/08/2026

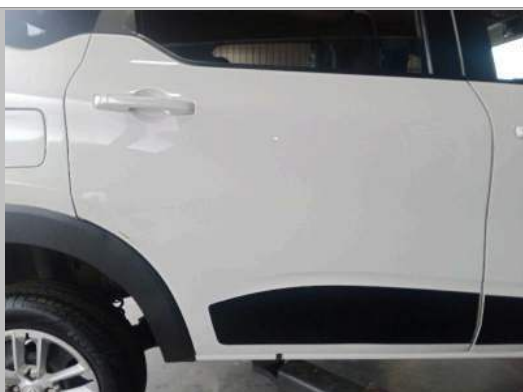

Door Rear Right



Door Front Right



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361



CONDITION REPORT



Report No:
2017290034
DATE
27/08/2026



Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEERBC00900218361