



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LW80HMGP
Model	AGYA 1.0 AUDIO 5-DR [2020-2023]	Register Number	
VIN	MHKA4DA5N0J005345	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2026
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	C - COMMON
Km Reading	175,413 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:

2017298532

DATE

14/09/2026

Damage

Repair Way



Engine Oil Leak	Repair
Battery box Corrosion	Repair
Tail Light Left Chipped	Replace
Tail Light Right Damaged	Replace
Seat Rear Torn / Cut	Repair
Carpet Rear Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Damaged	Repair
Front Fender Left / Inner Tray Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Replace
Brake disc 1. Axle right Excessive Wear & Tear	Replace
Tie Rod End left Damaged	Replace
Steering Rack Boot Left Torn / Cut	Replace
Wheel bearing Front Right Loose / Excessive Play	Replace
Tyre Rear Right Smooth	Replace
Rim Front Left Scratched	Repair
Rim Rear Left Damaged	Repair
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cradle Deformed	Repair
Warning lights illuminated	Repair
Front tyre size differs	Replace
Rear tyre size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	1.7	-	
Rear	1.0	0.8	-	
Emergency / Parking	0.7	0.5	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82T	Velocity	Reacta	V	2418	1 mm
Front Right	165/65R14	79H	Nexen	CP661	V	3319	3 mm
Rear Left	175/65R14	82T	Sumitomo	HTR	V	2524	5 mm
Rear Right	165/60R14	81S	Bridgestone	B250	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	EFI	P1604	ENGINE START ABNORMAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026

[illegible]

Shock and brake

The screenshot displays the AUTOSAR Diagnostic Event Manager (DEM) interface. At the top, the title bar indicates the application is 'RUTER' and the current session is 'My Demo -'. The main window is titled 'Towing VEHICLE DIAGNOSTIC REPORT'. Below the title, there is a 'VehicleStatus' section with a tree view of diagnostic events. The tree shows 'DTC' expanded, listing 'P001300' and 'P001301'. The 'P001300' event is selected, and its details are shown in the right pane. The details include 'DTC: P001300', 'Status: Confirmed', 'Severity: High', 'First Occurrence: 2023-01-10 10:00:00', 'Last Occurrence: 2023-01-10 10:00:00', and 'Occurrences: 1'. The bottom status bar shows 'AUTOSAR' and the time '10:00:00'.

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:

2017298532

DATE

14/09/2026



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MHKA4DA5N0J005345



CONDITION REPORT




Report No:
2017298532
DATE
14/09/2026

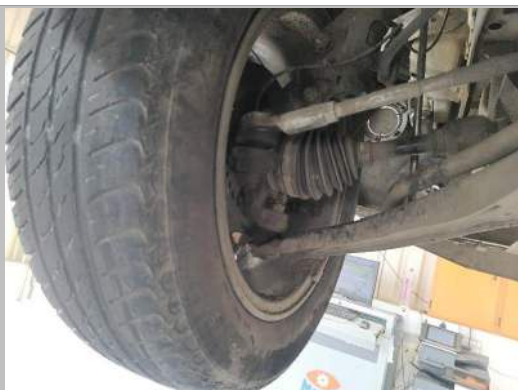

LF TYRE TREAD



LR TYRE TREAD

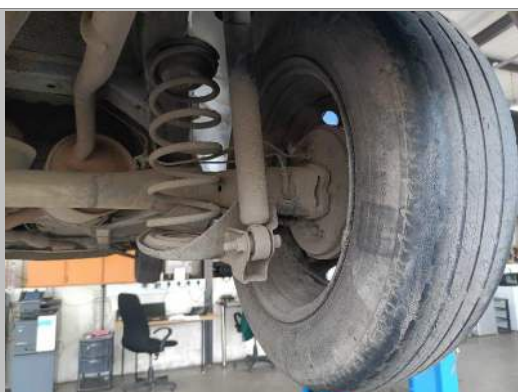

RR TYRE TREAD



RF TYRE TREAD



rim



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



ABS warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Warning lights illuminated



Oil cap and dipstick



Coolant reservoir



L/F fender liner missing



Front Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026




Door Front Right



Tail Light Right



Carpet Rear

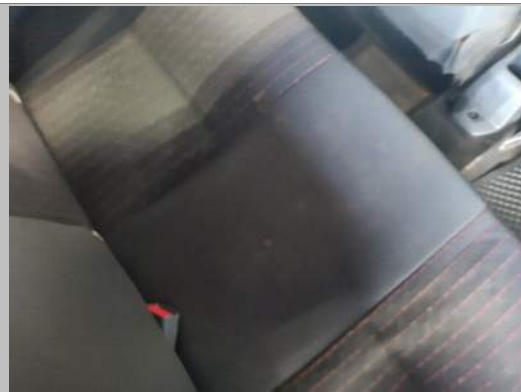

Seat Rear



Tail Light Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Rear Fender Left



Door Rear Left



Door Front Left



Carpet Rear



Front Fender Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Windscreen



Bonnet



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:

2017298532

DATE

14/09/2026



Grill



Rim Front Left



Rim Rear Left



Rear Fender Left / Inner Tray



Front Fender Left / Inner Tray



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Rear bumper



Rear bumper



Rear bumper



Tie Rod End left



Brake disc 1. Axle right



Brake disc 1. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Engine



Engine



Engine



Gearbox



Gearbox



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345



CONDITION REPORT



Report No:
2017298532
DATE
14/09/2026



Battery box



Radiator Cradle



CV Joint(s) Boot(s) Front Left (inner/outer)



Tyre Rear Right



Steering Rack Boot Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MHKA4DA5N0J005345