



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/09/2026		M57 Pretoria Road - 1619
Inspection Date	04/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD TRAILER	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	JZP592EC
Model	NAVARA 2.3 LE D-CAB DSL 4X4 PU [2017-2019]	Register Number	
VIN	MNTCB4D23Z0002158	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT UNI
Km Reading	298,032 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026

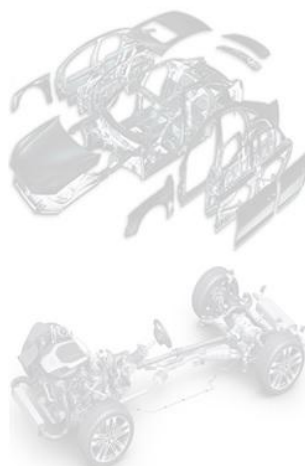

Damage	Repair Way
Engine Wiring Defective	Repair
Hoses Oil Leak	Replace
Air cleaner Damaged	Replace
Radio/CD/USB Damaged	Repair
Air Conditioner Insufficient	Replace
Tail Light Left Defective	Repair
Fog Light Front Left Damaged	Replace
Fog Light Front Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Seat Belt Rear Middle Missing	Replace
Hood Lining Dirty	Repair
Door Panel Front Right Damaged	Repair
Door Sealing Rubber Rear Left Defective	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Welded	Replace
C • Pillar Left Paintwork • Scratched	Repair
C • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Paintwork • Scratched	Smart Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Damaged	Repair
Fuel Flap Damaged	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Roof Dented	Repair
Load Body Damaged	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle left Damaged	Replace
Rim Front Right Scratched	Repair
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Belly plates Damaged	Repair
Gearbox Oil Sweat	Repair
Prop Shaft Defective	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Warning lights illuminated on dashboard	Repair
Front right shock absorber weak	Replace
Engine oil sump dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60 R18	114Q	Sailun	Terramax	V	3424	5 mm
Front Right	265/60 R18	114Q	Sailun	Terramax	V	3224	5 mm
Rear Left	265/60 R18	114Q	Sailun	Terramax	V	2625	8 mm
Rear Right	265/60 R18	114Q	Sailun	Terramax	V	2625	8 mm
Spare	255/60 R18	108H	Toyo	Country	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0530:16	REFRIGERANT TEMPERATURE PRESSURE SENSOR VOLTAGE---	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Engine bay dirty.Oil sweat on brake booster.Oil leak on turbo
Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Dents and scratches on body panelsBody panels misaligned.
Axle and Suspension: Aftermarket lift kit fitted to front suspension.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



90 DEGREE REAR



90 DEGREE RIGHT



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158




CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026




Front chassis

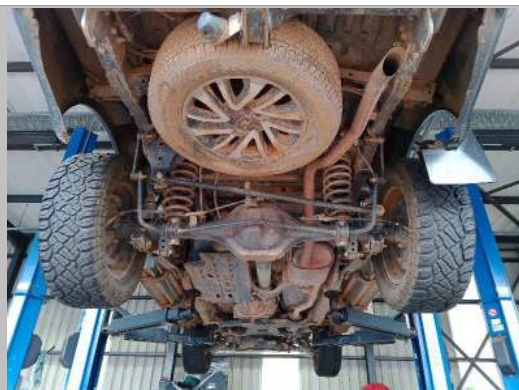

Rear chassis



LF TYRE TREAD

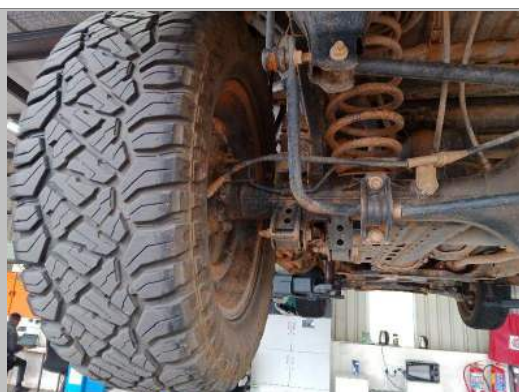

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026




Spare Wheel



ENGINE 1



Oil cap and dipstick

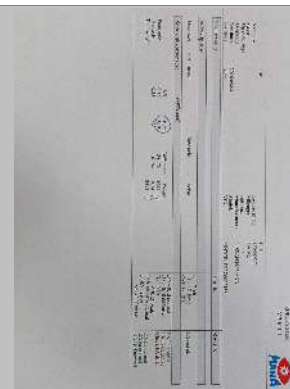

Shock absorber report



Diagnostic report page 1



Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026

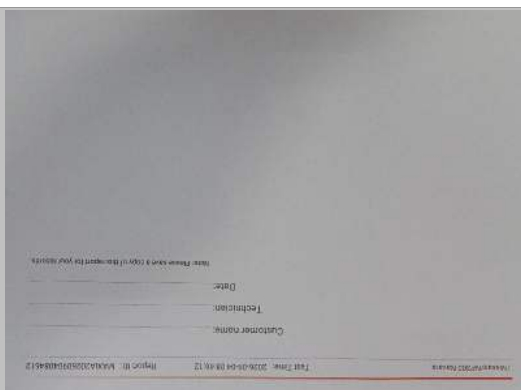

Diagnostic report page 3



Turbo leak



Engine oil sump



Hood Lining



Steering Wheel Trim



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Seat Front Right



Seat Belt Rear Middle



Seat Rear



C • Pillar Right



Sill Panel Right



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Front Fender Right



Door Front Right



Door Front Right



Door Rear Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:

2017294297

DATE

04/09/2026



Rear Fender Right



Tailgate



Tailgate



Load Body



Tail Light Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026




Door Rear Left



Door Front Left



Front Fender Left

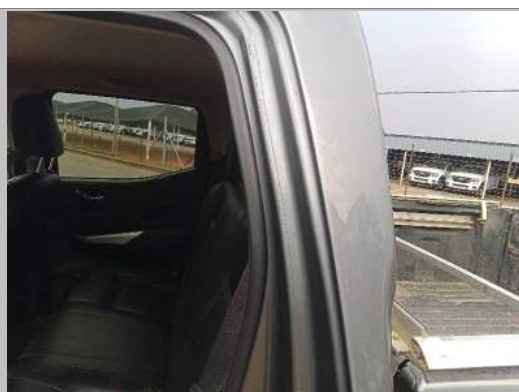

C • Pillar Left



Door Sealing Rubber Rear Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Sill Panel Left



Bonnet



Fog Light Front Left



Fog Light Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Roof



Air Conditioner



Windscreen



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Engine Wiring



Hoses



Hoses



Front Fender Right / Inner Tray



Rim Front Right



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Bolt(s) / Nut(s) Front Wheel Right



Front Fender Left / Inner Tray



Rocker Panel Left



Belly plates



CV Joint(s) Boot(s) Front Right (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Prop Shaft



Gearbox



Gearbox



Hoses



Brake disc 1. Axle left



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158



CONDITION REPORT



Report No:
2017294297
DATE
04/09/2026



Water level



Radio/CD/USB



Rear Fender Left



Fuel Flap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTCB4D23Z0002158