



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	FK52HCGP
Model	JUKE 1.6DIG-T TEKNA 5-DR [2016-2019]	Register Number	
VIN	SJNFAAF15Z7196108	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2025
Color	SILVER	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT METALLIC
Km Reading	139,231 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026

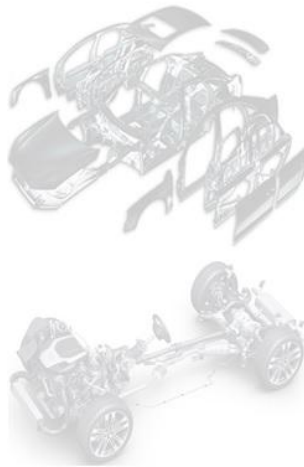

Damage	Repair Way
Windscreen Wiper Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Door Handle Front Right Damaged	Replace
Front Bumper Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Worn	Replace
Control Arm Bush(es) Front Axle Right Worn	Replace
Control Arm Bush(es) Rear Axle Left Cracked	Replace
Control Arm Bush(es) Rear Axle Right Cracked	Replace
Spare Tyre Worn	Replace
Rear tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.98	3.94	-	
Rear	2.28	2.42	-	
Emergency / Parking	0.14	1.91	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R18	95Y	Tracmax	Radial	V	4825	3 mm
Front Right	225/45R18	95Y	Tracmax	Radial	V	4825	3 mm
Rear Left	T135/90R16	102M	Continental	Temporary	V	4015	2 mm
Rear Right	225/45R18	95W	Sailun	Radial	V	0121	2 mm
Spare	225/45R18	95W	Toledo	Radial	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P1550	BAT CURRENT SENSOR	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. VEHICLE ELECTRONICS MALFUNCTIONING. 9 DTC'S AT TIME OF TESTING SEE DTC REPORT. Interior: driver side door does not open from outside.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SJNFAAF15Z7196108




CONDITION REPORT




Report No:
2017296500
DATE
09/09/2026

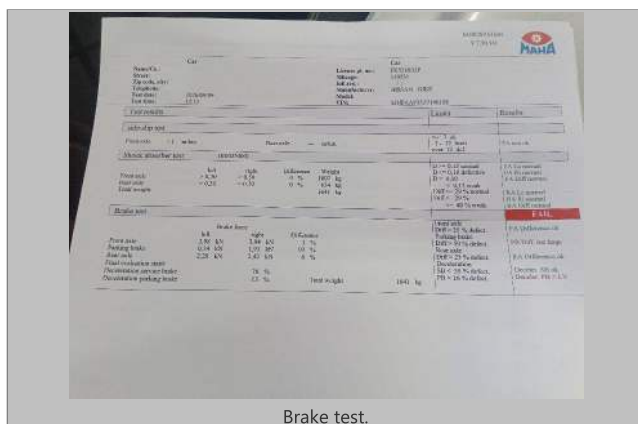

Brake test.

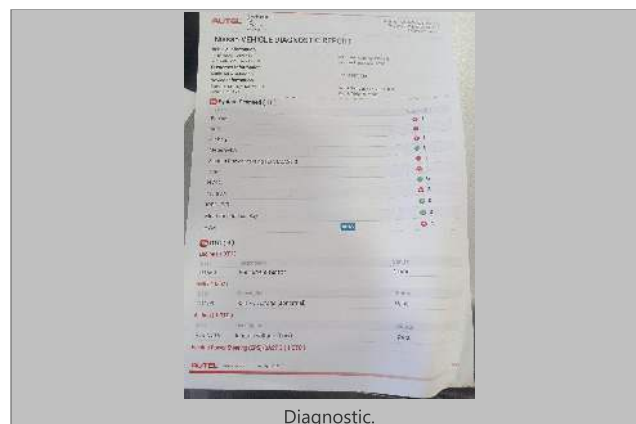

Diagnostic.

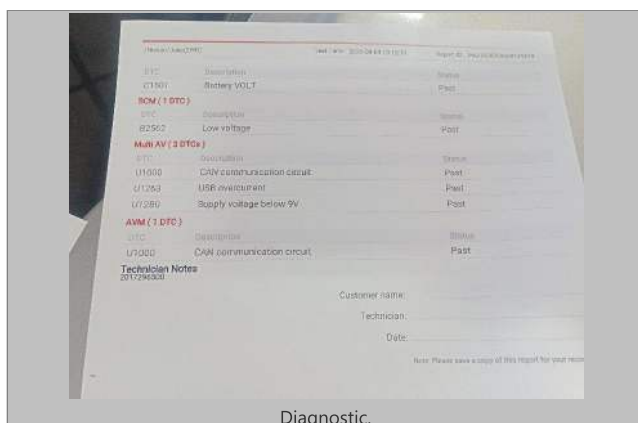

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108




CONDITION REPORT




Report No:
2017296500
DATE
09/09/2026




90 DEGREE LEFT

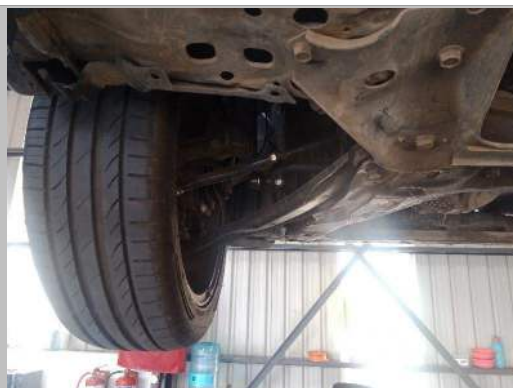

LF TYRE TREAD

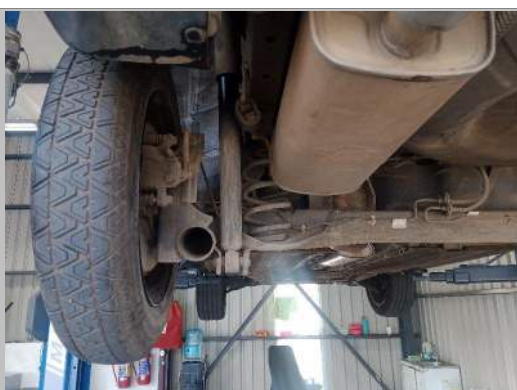

LR TYRE TREAD

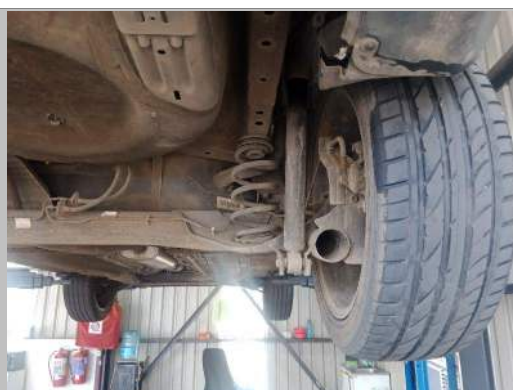

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026




VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.

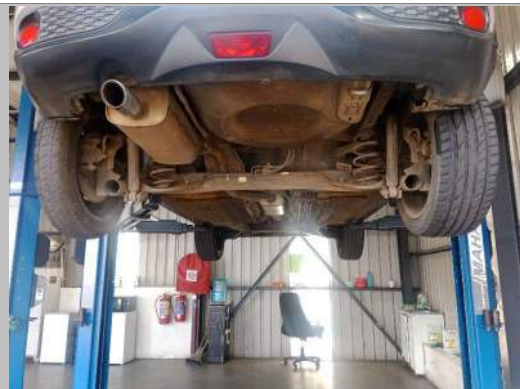

Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026




Front Bumper



Front Bumper



Front Fender Left

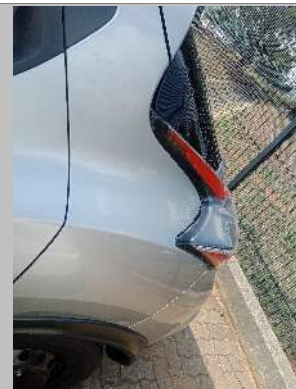

Rear Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026

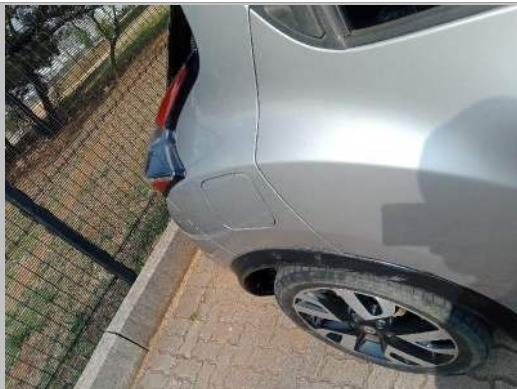

Rear Fender Right



Windscreen




Door Handle Front Right



Seat Front Right



Headlight Right

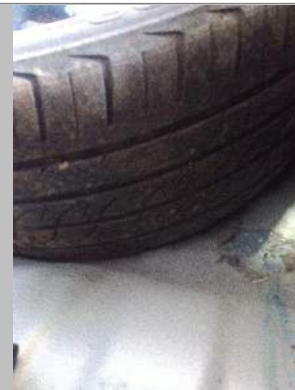

Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108



CONDITION REPORT



Report No:
2017296500
DATE
09/09/2026



Windscreen Wiper



Control Arm Bush(es) Rear Axle Left



Control Arm Bush(es) Rear Axle Right



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAF15Z7196108