



CONDITION REPORT



Report No:

2017300372

DATE

17/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	
Requested Date	17/09/2026		
Inspection Date	17/09/2026		M57 Pretoria Road - 1619 Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KMV291NW
Model	QASHQAI 1.5 DCI ACENTA DSL 5-DR [2018-2020]	Register Number	
		Date Of First Licensing	
VIN	SJNFAAJ11Z2306720	Last COR	
Engine Number		License Expiry Date	30/06/2026
Doors	5	Power / Displacement	
Color	RED	Paint Finish	M - METALLIC
Year Model	2019	Fuel	DIESEL
Km Reading	154,074 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:

2017300372

DATE

17/09/2026

Damage

Repair Way

Engine Wiring Defective	Repair
Wiring connections Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Gear Lever Dust Boot Torn / Cut	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Front suspension noisy	Replace
Gearbox mounting damaged.	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	4.4	-	
Rear	2.8	3.0	-	
Emergency / Parking	2.2	2.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Dunlop	Sport	V	1628	5 mm
Front Right	215/60R17	96H	Dunlop	Sport	V	1625	3 mm
Rear Left	215/60R17	96H	Dunlop	Sport	V	3923	1 mm
Rear Right	215/60R17	96H	Bridgestone	Alenza	V	3521	2 mm
Spare	215/65R16	98H	Bridgestone	Dueler	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:

2017300372

DATE

17/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0100:16	AIR FLOW SENSOR CIRCUIT 1 DEF	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostics report

[illegible]

Diagnostics report

[illegible]

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:

2017300372

DATE

17/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

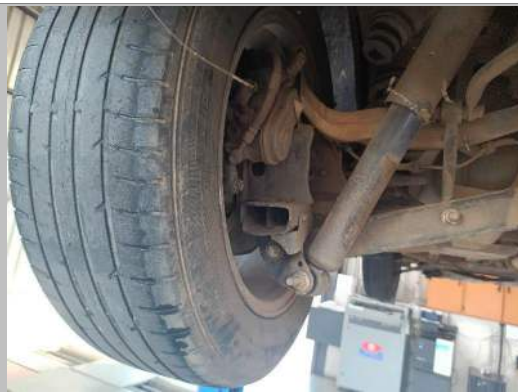

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:

2017300372

DATE

17/09/2026



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720




CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026



REAR

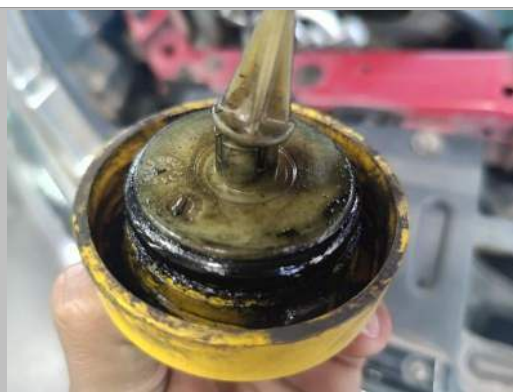

Oil cap



Dipstick



Warning lights illuminated



Coolant reservoir



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026



Seat Front Left



Seat Front Right



Gear Lever Dust Boot



Windscreen



Windscreen



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026




Side Mirror Right



Door Rear Right



Rear Fender Left

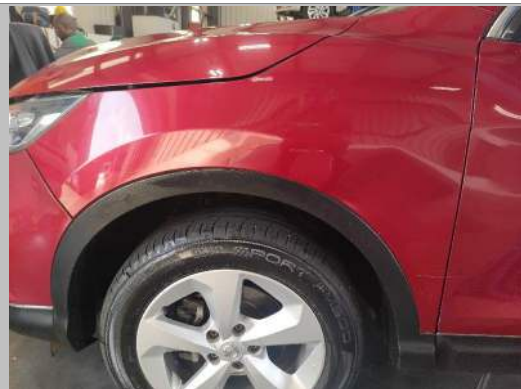

Front Fender Left



Wiring connections



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720



CONDITION REPORT



Report No:
2017300372
DATE
17/09/2026



Engine Wiring




Engine Wiring



Front Bumper



Front Bumper

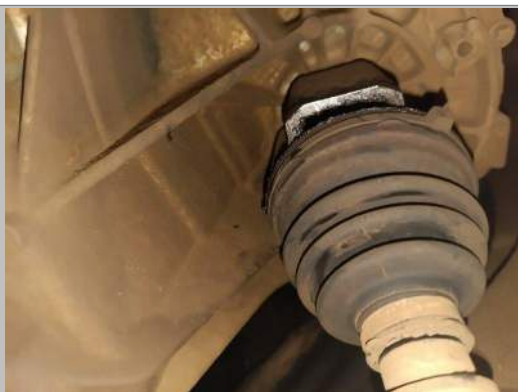

CV Joint(s) Boot(s) Front Left (inner/outer)



Ball Joint(s) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFAAJ11Z2306720