



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	HG40PVGP
Model	KADJAR	Register Number	
VIN	VF1RFE00755716146	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GOLDEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	141,592 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:

2017296582

DATE

09/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Door Sealing Rubber Front Right Torn / Cut	Replace
Steering Wheel Trim Excessive Wear & Tear	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Dented	Repair
B • Pillar Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Windscreen Chipped	Repair
Tie Rod End left Cracked	Replace
Tie Rod End right Cracked	Replace
Shock Absorber Rear Left Leak	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Cracked	Replace
Tyre Rear Right Damaged	Replace
Main Beam Left Damaged	Repair
Chassis Damaged	Repair
Gearbox Mountings Cracked	Replace
Gearbox Oil Leak	Repair
Engine Performance Idling / Hunting	Repair
Jack Missing	Replace
Warning light illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.61	3.81	-	
Rear	2.36	2.31	-	
Emergency / Parking	1.93	2.06	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:

2017296582

DATE

09/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	98H	Durun	K313	V	0221	2 mm
Front Right	215/65R16	98H	Goodyear	Eagle	V	0809	5 mm
Rear Left	215/65 R16	98H	Dunlop	Sp-Sport	V	3121	1 mm
Rear Right	215/65R16	98H	Landsail	LS388	V	4017	0 mm
Spare	215/65 R16	98H	Continental	ContiEco	V	4415	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC020112	CYLINDER 1 INJECTOR CONTROL CIRCUIT SHORT-CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Electrical Components and Instruments: Vehicle electronics malfunction.

Interior: Vehicle interior is dirty and panels are scratched.

Body • Exterior: Dents and scratches on body panels

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026

Car				Car			
Name/Car				License (pl. no.)	1304PVPUP		
Brand				Registration	14192		
Registration				Manufacturer	RENAULT KADAR		
Year				Model	V1419277716146		
Test date	14/05			VIN	V1419277716146		
Test results				Remarks			
Undercarriage				OK			
Front axle - 6 rollers				OK			
Rear axle - 6 rollers				OK			
Shock absorber test (BONDAGE)				OK			
Brake test				PASS			

Brake and shock absorber report



Front chassis



Rear chassis

Vehicle Diagnostic Report	
Vehicle	Chevrolet Kadar
Engine	1.8L
Transmission	5-Speed Manual
Drive Type	Front Wheel Drive
Year	2014
VIN	V1419277716146
Test Date	14/05/2026
Test Location	DEKRA
Test Results	OK

Diagnostic report page 1

Vehicle Diagnostic Report	
Vehicle	Chevrolet Kadar
Engine	1.8L
Transmission	5-Speed Manual
Drive Type	Front Wheel Drive
Year	2014
VIN	V1419277716146
Test Date	14/05/2026
Test Location	DEKRA
Test Results	OK

Diagnostic report page 2

Vehicle Diagnostic Report	
Vehicle	Chevrolet Kadar
Engine	1.8L
Transmission	5-Speed Manual
Drive Type	Front Wheel Drive
Year	2014
VIN	V1419277716146
Test Date	14/05/2026
Test Location	DEKRA
Test Results	OK

Diagnostic report page 3

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026

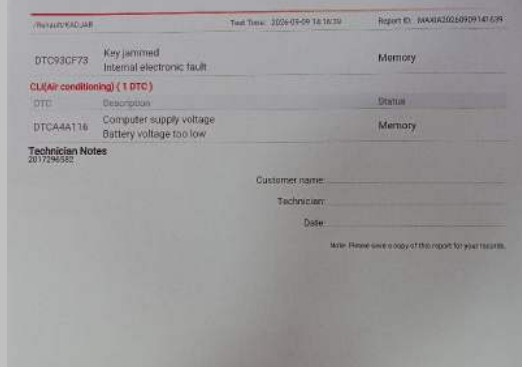

Diagnostic report page 4



Spare Wheel and Accessories



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026




90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD

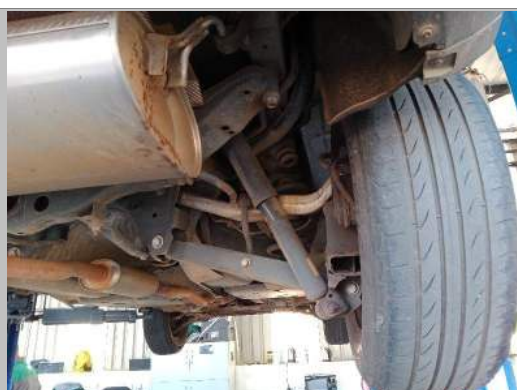

RR TYRE TREAD

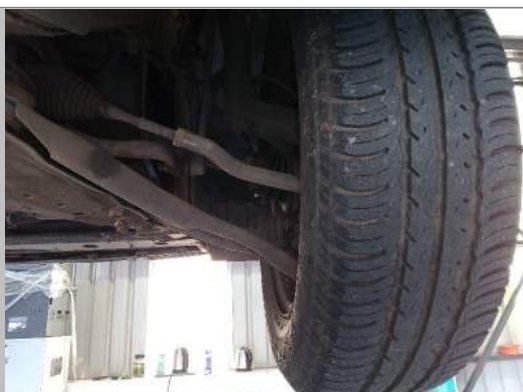

RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



VIN PLATE OR STICKER




ENGINE 1



Windscreen



Grill

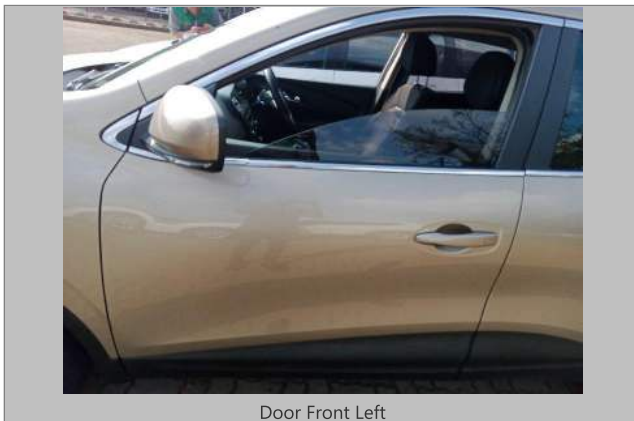

Door Front Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Seat Rear



Door Rear Left



Door Rear Left



Rear Fender Left



Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Seat Rear



Door Rear Right



Door Rear Right



Seat Front Right



Door Sealing Rubber Front Right



B • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Grill



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Engine



Gearbox



Chassis



Chassis



Tie Rod End left



Tie Rod End right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Ball Joint(s) Front Axle Left



Main Beam Left



Shock Absorber Rear Left



Tyre Rear Right



Tyre Rear Right



Gearbox Mountings

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146



CONDITION REPORT



Report No:
2017296582
DATE
09/09/2026



Water level



Steering Wheel Trim



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF1RFE00755716146