



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	03/09/2026		M57 Pretoria Road - 1619
Inspection Date	03/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	OPEL	Registration Number	LBR738NW
Model	CORSA 1.2 EDITION 5-DR [2021-2022]	Register Number	
VIN	VXKUPHMGBN4239550	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2027
Color	SILVER	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT METALLIC
Km Reading	75,232 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VXKUPHMGBN4239550



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026

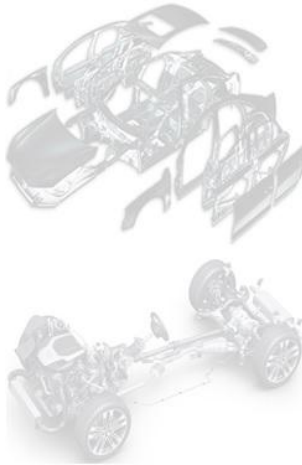

Damage	Repair Way
Engine Management Lights Set	Repair
Tail Light Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.85	3.46	-	
Rear	1.92	1.86	-	
Emergency / Parking	1.92	1.73	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Continental	Eco	V	1622	2 mm
Front Right	185/65R15	88H	Rovelo	Radial	V	2225	2 mm
Rear Left	185/65R15	88H	Continental	Eco	V	1622	0 mm
Rear Right	185/65R15	88H	Continental	Eco	V	1222	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BUILT-IN SYSTEMS LNTERFACE	U1F3B:87	NO COMMUNICATION WITH MULTIFUNCTIONING CONTROL UNI	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR AND INTERIOR ELECTRICAL AND MECHANICAL PARTS.34 DTC'S AT THE TIME OF TESTING; SEE DTC REPORT.Engine Compartment: micro cracks visible in timing belt, timing belt needs to be replaced.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Vehicle body in poor condition. Signs of hail damage to some body panels.

Tyres and Rims: spare wheel missing.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026



LICENSE DISC



VIN PLATE OR STICKER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXKUPHMGBN4239550



CONDITION REPORT




Report No:
2017293979
DATE
03/09/2026



90 DEGREE REAR



90 DEGREE RIGHT

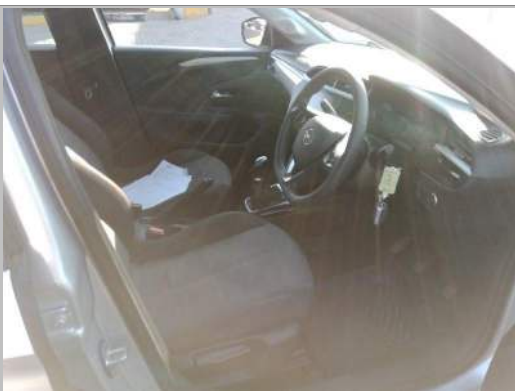

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026



Undercarriage front.



Undercarriage rear.



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:

2017293979

DATE

03/09/2026




ENGINE 1




Oil cap and dipstick.



micro cracks in timing belt.

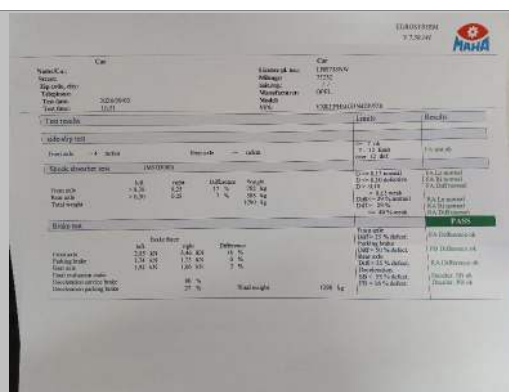

Brake test.

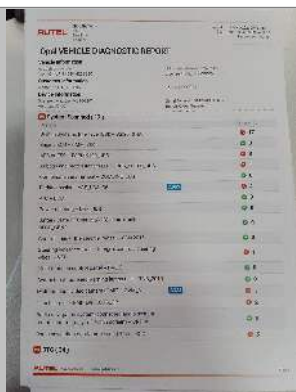

Diagnostic.



Diagnostic.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: VXXUPHMGBN4239550




CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026

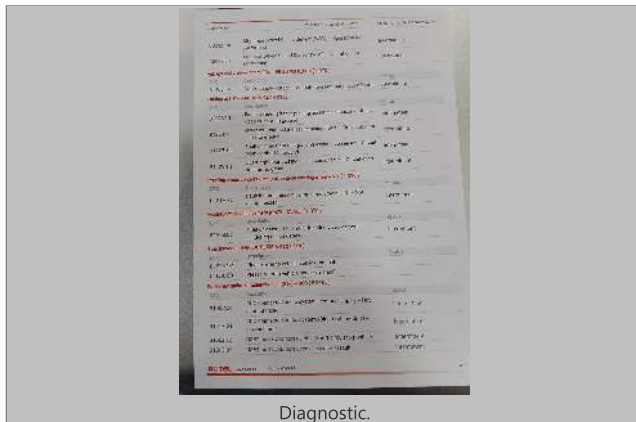


Diagnostic.

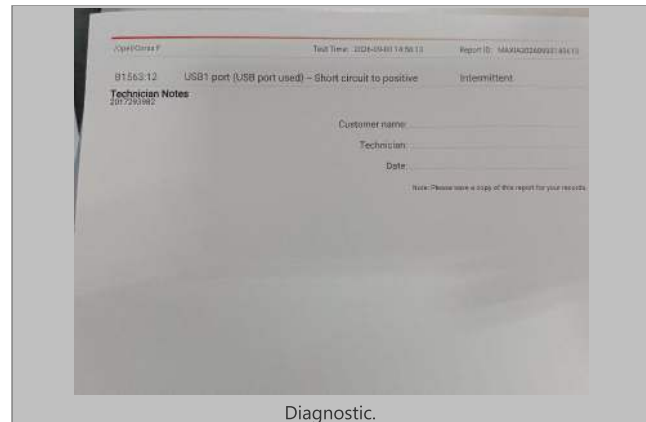


Diagnostic.




Front Bumper

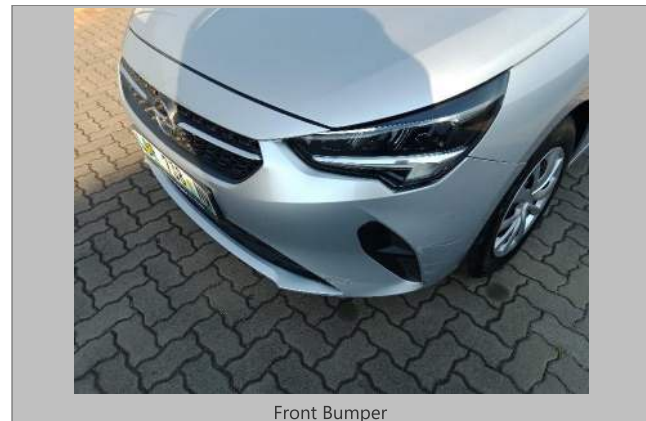

Front Bumper

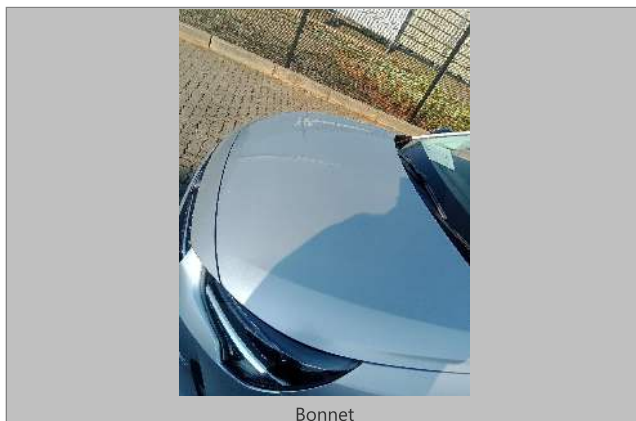

Bonnet

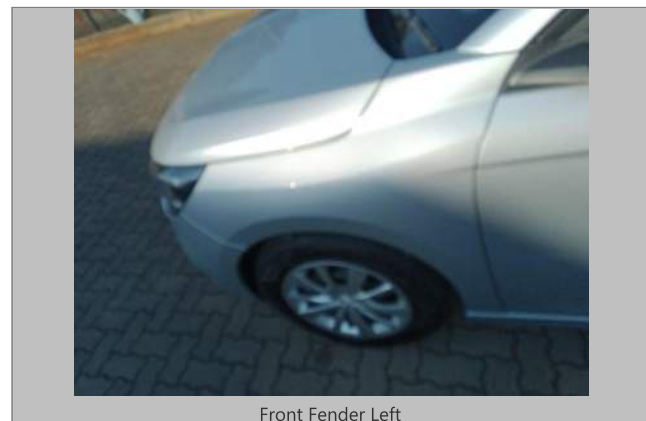

Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550




CONDITION REPORT




Report No:
2017293979
DATE
03/09/2026



Door Front Left

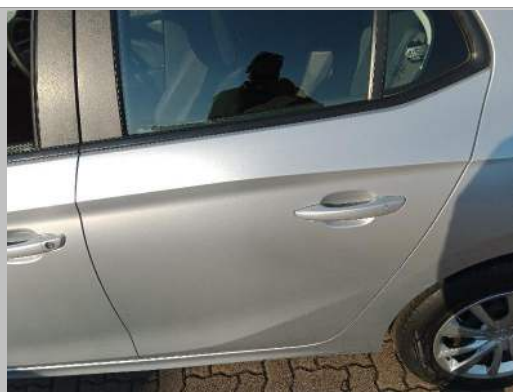

Door Rear Left

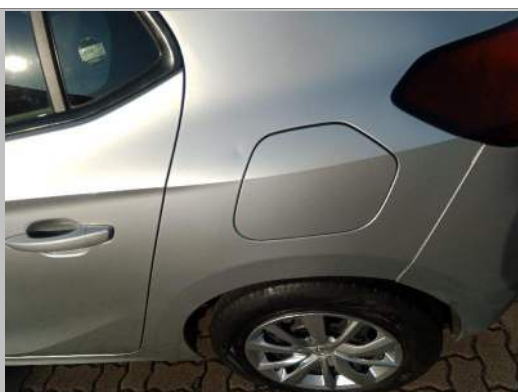

Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:

2017293979

DATE


03/09/2026



Door Rear Right



Door Front Right

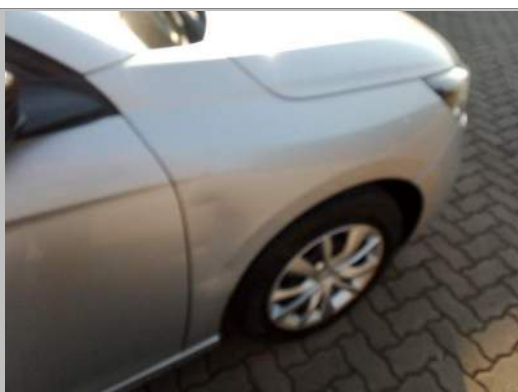

Front Fender Right



Rear Fender Right



Tail Light Left



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550



CONDITION REPORT



Report No:
2017293979
DATE
03/09/2026



Roof



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VXXUPHMGBN4239550