



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/08/2025		M57 Pretoria Road - 1619
Inspection Date	07/08/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	AUDI	Registration Number	DV49SHGP
Model	A6 2.0T FSI MULTITRONIC [2014-2015]	Register Number	
VIN	WAUZZZ4G4EN203974	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2022
Color	GREY	Power / Displacement	
Year Model	2015	Paint Finish	TWO COAT METALLIC
Km Reading	217,680 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025

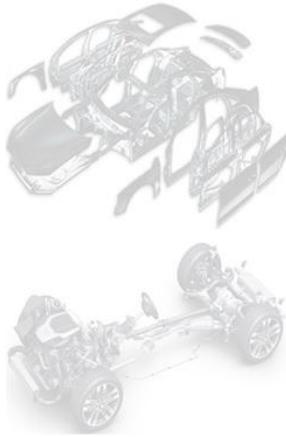

Damage	Repair Way
Water level Insufficient	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Headlight Left Cracked	Replace
Seat Belt Rear Middle Defective	Replace
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Fuel Flap Damaged	Repair
Sill Panel Left Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Parking Brake Performance Insufficient	Repair
Shock Absorber Front Left Leak	Replace
Shock Absorber Rear Left Leak	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
Engine Performance Idling / Hunting	Repair
Gear Selections Slippy Hesitation	Repair
Warning lights illuminated on dashboard	Repair
Foreign substance on oil cap	Repair
Aircon condenser dented	Repair
Front left and right tyre sizes different	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.25	4.38	-	
Rear	2.59	2.01	-	
Emergency / Parking	1.35	1.05	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/35Z R19	96Y	Michelin	Pilot Sport	V	1619	0 mm
Front Right	255/40Z R19	100Y	Hankook	Ventus	V	4618	1 mm
Rear Left	255/40Z R19	96W	Pirelli	Pzero	V	4914	0 mm
Rear Right	255/40Z R19	100Y	Kumho	Ecsta	V	5217	0 mm
Spare	T145/60 R20	105M	Hankook	Temporary	V	2914	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P035400	IGNITION COIL D PRIMARY/SECONDARY A CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: OIL LEVEL COULD NOT BE CHECKED. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



LF TYRE TREAD



Front Chassis



RF TYRE TREAD



LR TYRE TREAD



Rear chassis



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



ENGINE 1




Oil cap



Spare wheel and Accessories



Wheel spanner and Tow eye

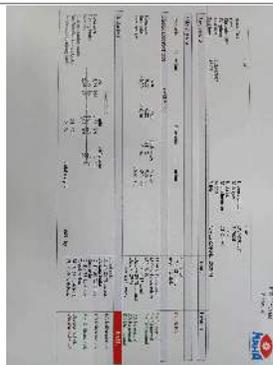

Brake and shock absorber repor



Diagnostic report page 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WAUZZZ4G4EN203974




CONDITION REPORT




Report No:
2016972411
DATE
07/08/2025

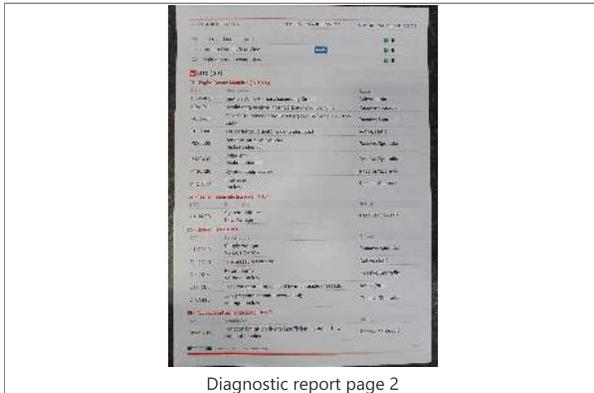

Diagnostic report page 2

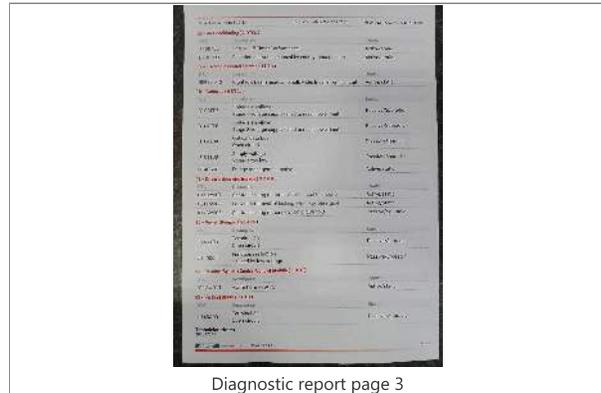

Diagnostic report page 3

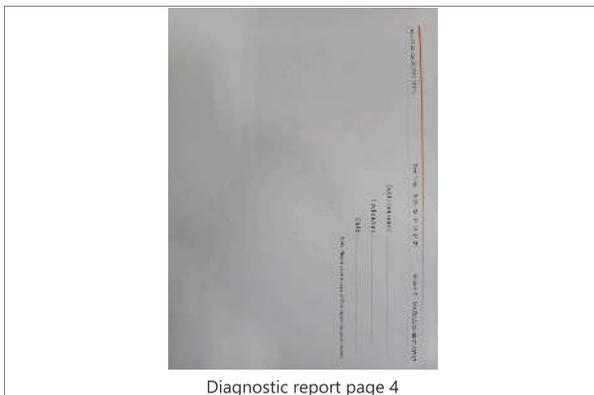

Diagnostic report page 4



Aircon condenser



Center Console / Cubbyhole + Lid



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Bonnet



Windscreen



Front Bumper



Front Bumper



Headlight Left



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Side Mirror Right



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Door Rear Left



Rear Fender Left



Seat Belt Rear Middle



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Fuel Flap



Spare Tyre



Front Fender Right / Inner Tray



Control Arm Bush(es) Front Axle Right



Rim Front Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Shock Absorber Front Left



Rim Rear Left



Sill Panel Left



Rim Rear Right



Tyre Rear Right



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Belly plates



Belly plates



Tyre Front Right



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974



CONDITION REPORT



Report No:
2016972411
DATE
07/08/2025



Sub Frame



Gearbox



Tyre Rear Right



Tyre Rear Left



Shock Absorber Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G4EN203974