

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



### Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/04/2024		M57 Pretoria Road - 1619
Inspection Date	10/04/2024		Kempton Park - GT

### Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	AUDI	Registration Number	CD57MPGP
Model	A4	Register Number	
VIN	WAUZZZ8K8DA111853	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	217,350 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

### Vehicle Options & Accessories

#### Items

### VEHICLE INSPECTION



Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
A • Pillar Right Paintwork • Scratched	Repair
Front Fender Left Paintwork • Pitmarks	Repair
Front Fender Right Paintwork • Pitmarks	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Engine to silencer pipe Welded	Repair
Gearbox Oil Leak	Repair
Engine Performance Idling / Hunting	Repair
Gear Selections Insufficient	Repair
None standard exhaust fitted	Repair
Engine management lights illuminated	Repair

**Brakes****Brake Test Results**

	Left	Right	Axe Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	3.8	4.2	-	
Rear	2.6	2.3	-	
Emergency / Parking	2	1.9	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R16	95W	Michelin	Primacy	V	4820	3 mm
Front Right	225/55R16	95W	Michelin	Primacy	V	4820	3 mm
Rear Left	225/55R16	95W	Michelin	Primacy	V	2320	2 mm
Rear Right	225/55R16	95W	Michelin	Primacy	V	2320	2 mm
Spare	T125/70R19	100M	Hankook	S300	V	1512	4 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

**Inspection Conditions**

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: SIGNS OF SPRAY WORK ON VARIOUS BODY PANELS. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

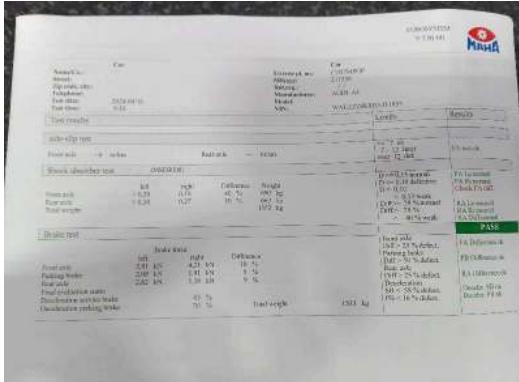

Vehicle details:

- Model: CAR
- Chassis no.: 2016335030
- Registration no.: F018440
- Test date: 2024-04-10
- Test time: 09:14
- Test location: DEKRA AUTOMOTIVE (PTY) LTD.
- Test results: 100%


Shock absorber test (OVERVIEW)

Front axle	Left	Right	Front axle	Left	Right
Front axle	0.13	0.14	Front axle	0.13	0.14
Front wheel	0.13	0.17	Front wheel	0.13	0.17
Total weight			Total weight		

Brake test (OVERVIEW)

Front axle	Left	Right	Front axle	Left	Right
Front axle	0.13	0.14	Front axle	0.13	0.14
Pulling back	0.09	0.11	Pulling back	0.09	0.11
Front axle	0.09	0.11	Front axle	0.09	0.11
Total weight			Total weight		
Brake distance (meters)	4.0	3.9	Brake distance (meters)	4.0	3.9
Brake distance (feet)	13.1	12.8	Brake distance (feet)	13.1	12.8

Shock and brake report

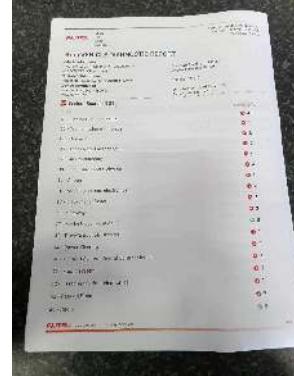

Diagnostic report



Diagnostic report



Diagnostic report



Diagnostic report




Diagnostic report



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024

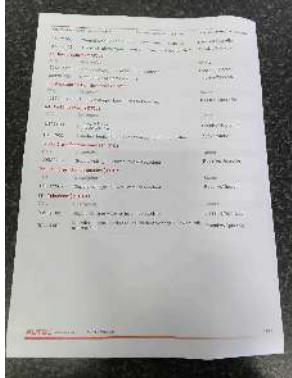

Diagnostic report



Diagnostic report



Automatic



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024



Expedition bottle



Spare wheel




Oil cap



LF TYRE TREAD



LR TYRE TREAD

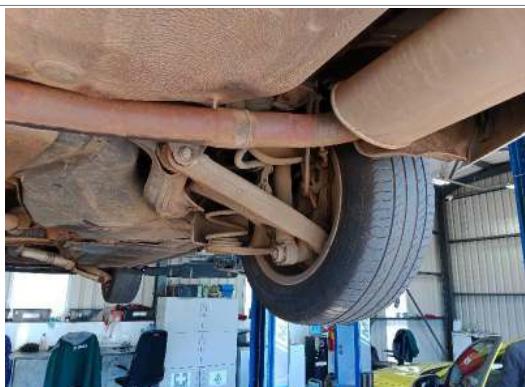

RR TYRE TREAD



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024



RF TYRE TREAD



ENGINE 1



CHASSIS



ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC



## CONDITION REPORT

Report No: 2016335030


DATE  
10/04/2024



Water level



Seat Front Right

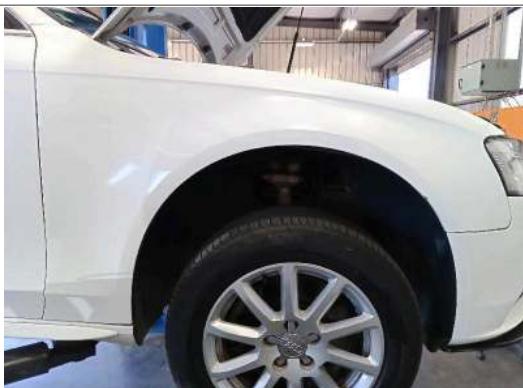

Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024



Rear bumper



Rear bumper



Rear Fender Right



Door Rear Right



Door Front Right



Engine to silencer pipe



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024



Engine to silencer pipe



Engine to silencer pipe



Gearbox



Gearbox



A • Pillar Right



Gear Selections



## CONDITION REPORT

Report No: 2016335030

DATE  
10/04/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)