



CONDITION REPORT



Report No:
2017286376
DATE
20/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/08/2026		M57 Pretoria Road - 1619
Inspection Date	20/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	FT37DDGP
Model	FOCUS 2.0 ECOBOOST ST3 5-DR [2015-2019]	Register Number	
VIN	WF05XXGCC5GT71158	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2026
Color	WHITE	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT UNI
Km Reading	207,355 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL


Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF05XXGCC5GT71158

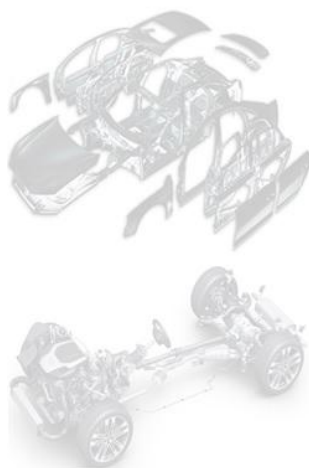

Damage	Repair Way
Engine Oil Leak	Repair
Air cleaner Defective	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Damaged	Repair
Rear bumper Residual Traces of Repair	Repair
Windscreen Damaged	Repair
Engine to silencer pipe Welded	Replace
Catalytic converter Missing	Replace
Gearbox Oil Sweat	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.05	4.42	-	
Rear	2.7	2.79	-	
Emergency / Parking	2.3	2.38	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91W	King	Radial	V	0225	3 mm
Front Right	235/35R19	91W	King	Radial	V	0325	3 mm
Rear Left	235/35R19	91W	Royal black	Radial	V	1623	3 mm
Rear Right	T125/90R16	98M	Hankook	Temporary	V	2716	1 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: signs of aftermarket performance done to vehicle.
Electrical Components and Instruments: Vehicle struggles to start.
Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Repair work done to vehicle below standard.
Poor alignment to somebody panels.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Werner Laubscher

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

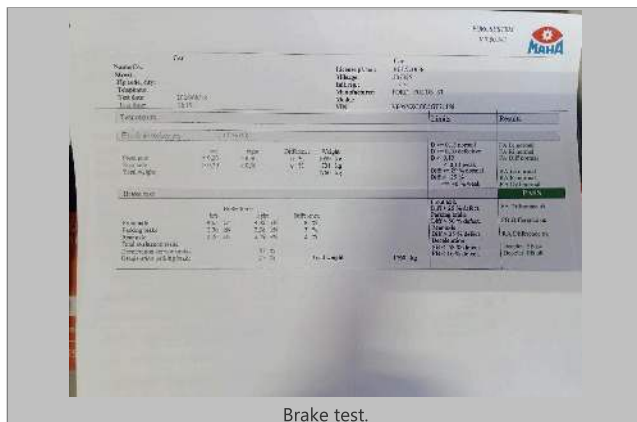


Brake test.

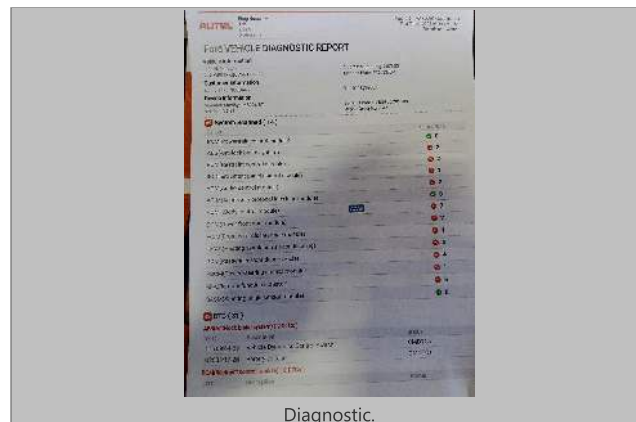

Diagnostic.

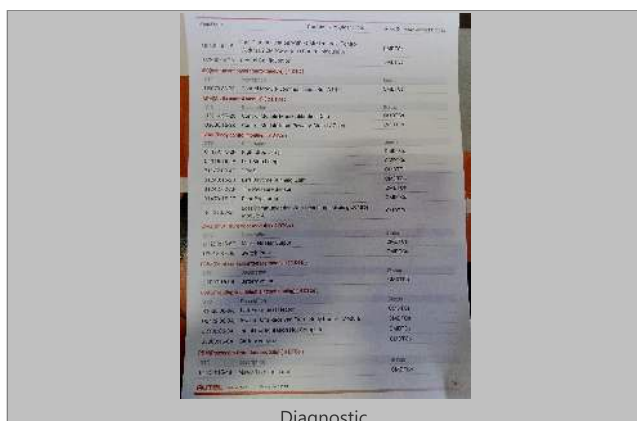

Diagnostic.

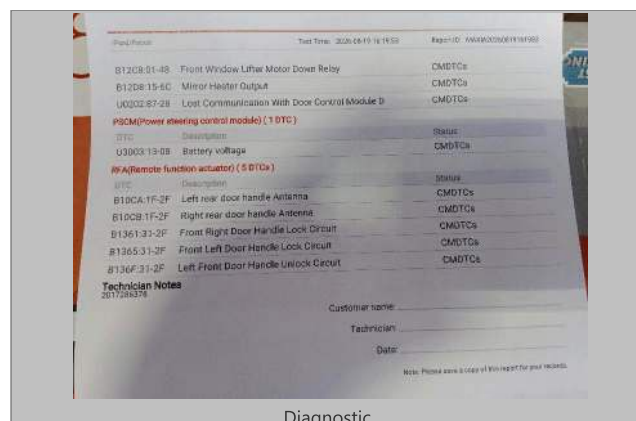

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage rear.



Undercarriage front.



Oil cap and dipstick.



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Door Front Right



Door Rear Right



Rear Fender Right



Front Fender Right



Windscreen



Engine to silencer pipe



Catalytic converter



Engine



Gearbox



Air cleaner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF05XXGCC5GT71158