

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/04/2024		M57 Pretoria Road - 1619
Inspection Date	19/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	JJ89YMGP
Model	FOCUS	Register Number	
VIN	WF05XXGCC5GT80383	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2022
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	131,162 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Switch Electrical Window Winder front left Defective	Repair
Indicator Light Front Left Damaged	Replace
Park Light Front Left Defective	Repair
Park Light Front Right Defective	Replace
Door Handle Front Left Damaged	Replace
Door Sealing Rubber Rear Left Torn / Cut	Replace
Door Lock Boot Lid Defective	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
A • Pillar Left Residual Traces of Repair	Repair
B • Pillar Left Dented	Repair
C • Pillar Left Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Residual Traces of Repair	Repair
Sill Panel Left Residual Traces of Repair	Repair
Brake disc 2. Axle left Corrosion	Replace
Brake disc 2. Axle right Corrosion	Replace
Steering Rack Damaged	Repair
Wheel bearing Front Left Loose / Excessive Play	Replace
Wheel bearing Front Right Loose / Excessive Play	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Front Right (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Warning lights illuminated.	Repair.

Damage

Repair Way

Excessive noise front suspension
Central locking system malfunction

Repair
Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.9	3.1	-	
Rear	2.3	2.3	-	
Emergency / Parking	1.7	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91W	Atlas	Sport	V	1622	5 mm
Front Right	205/55R16	91W	Atlas	Sport	V	1622	5 mm
Rear Left	205/60R16	96H	Michelin	Primacy	V	3618	2 mm
Rear Right	205/60R16	96H	Michelin	Primacy	V	3618	3 mm
Spare	T125/90R19	98M	Hankook	Temporary	V	//////77	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: RESIDUAL TRACES OF POOR REPAIR WORK DONE ON MOST BODY PANELS. RESPRAY WORK DONE ON MOST BODY PANELS. NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016347139

VIN: WF05XXGCC5GT80383

DATE

19/04/2024



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



Warning lights illuminated



Sparewheel



Expansion bottle



Oil cap and dipstick



Rear end



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

VIN: WF05XXGCC5GT80383


7 / 15



RF TYRE TREAD



ENGINE 1

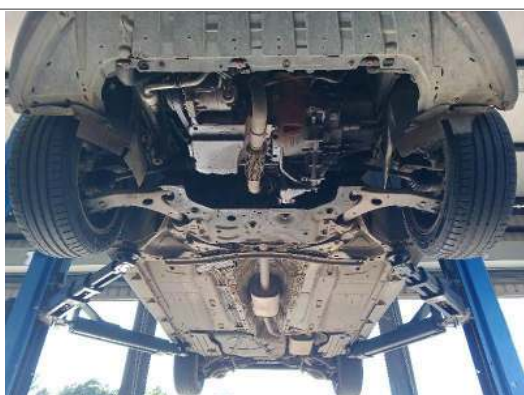

CHASSIS



ENGINE 2




VIN PLATE OR STICKER




LICENSE DISC

VIN: WF05XXGCC5GT80383


9 / 15

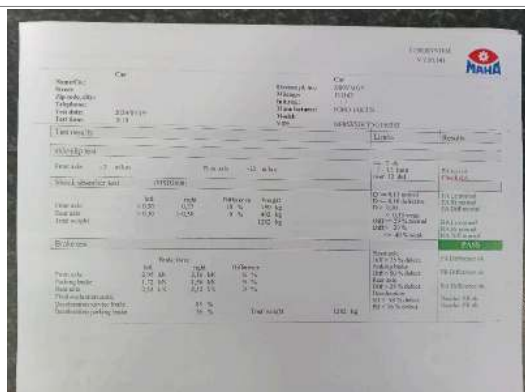

Shock and brake report

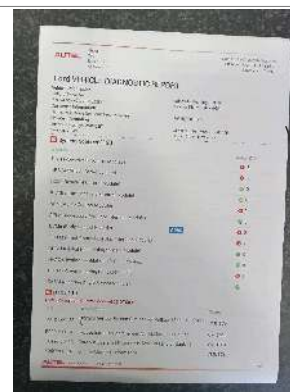

Diagnostic test

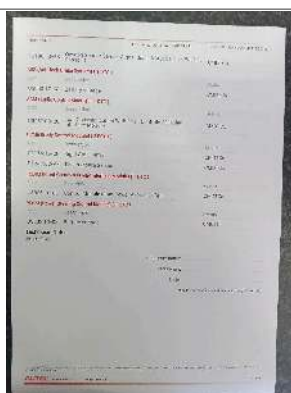

Diagnostic test



Switch Electrical Window Winder front left



Door Lock Boot Lid



Rear Fender Left

N: WF05XXGCC5GT80383

10 / 15

VIN: WF05XXGCC5GT80383

11 / 15



Door Rear Left



C • Pillar Left

VIN: WF05XXGCC5GT80383
12 / 15

Sill Panel Left



Sill Panel Left



B • Pillar Left



Door Sealing Rubber Rear Left

VIN: WF05XXGCC5GT80383

13 / 15



Door Sealing Rubber Rear Left



Door Sealing Rubber Rear Left

14 / 15



Door Front Left



Door Front Left



Door Front Left



Door Front Left

VIN: WF05XXGCC5GT80383

15 / 15



B • Pillar Left




Door Handle Front Left



A • Pillar Left



A • Pillar Left

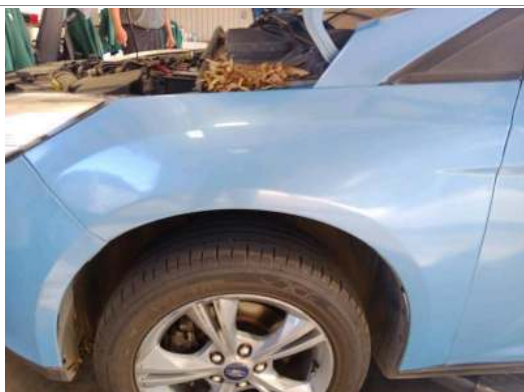

Front Fender Left



Water level



CV Joint(s) Front Right (inner/outer)




CV Joint(s) Boot(s) Front Right (inner/outer)



Indicator Light Front Left



CV Joint(s) Boot(s) Front Right (inner/outer)

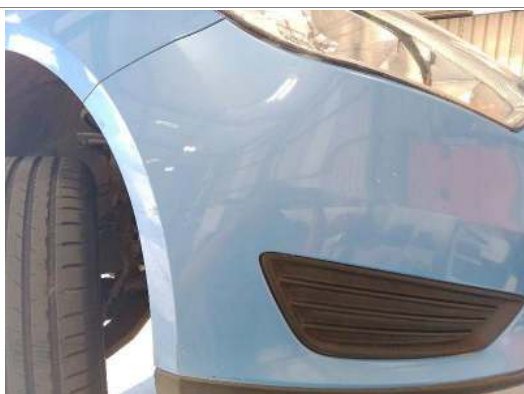

Front Bumper



Front Bumper



Brake disc 2. Axle right



Brake disc 2. Axle left



CV Joint(s) Boot(s) Front Left (inner/outer)



Gearbox



Gearbox



Engine



Engine



Engine



Steering Rack



Door Front Right



Park Light Front Left



Park Light Front Right



Bonnet



CONDITION REPORT

Report No: 2016347139

DATE
19/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za