

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC M57 Pretoria Road - 1619 Kempton Park - GT
Requested Date	26/01/2024		
Inspection Date	26/01/2024		

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	MINI	Registration Number	HZ62SVP
Model	JOHN COOPER WALKS	Register Number	
VIN	WMWXM920902F19959	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	31/08/2024
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	236,883 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Sweat	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Seat Front Right Worn	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair

Brakes

Brake Test Results

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.53	3.75	-	
Rear	1.62	1.77	-	
Emergency / Parking	1.36	2.16	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40R18	86W	Pirelli	Radial	V	1623	4 mm
Front Right	205/40R18	86W	Pirelli	Radial	V	0923	4 mm
Rear Left	205/40R18	86W	Pirelli	Radial	V	0522	4 mm
Rear Right	205/40R18	86W	Pirelli	Radial	V	3719	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor al

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



CONDITION REPORT

Report No: 2016244402

VIN: WMWXM920902F19959

DATE

26/01/2024



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024

VIN: WMWXM920902F19959

5 / 9

VIN: WMWXM920902F19959

6 / 9




RF TYRE TREAD



LICENSE DISC




VIN PLATE OR STICKER

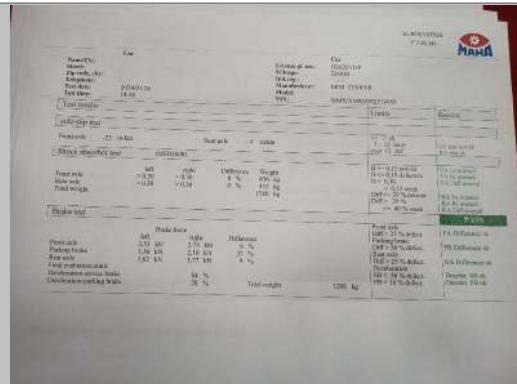

ADDITIONAL 1



ADDITIONAL 2

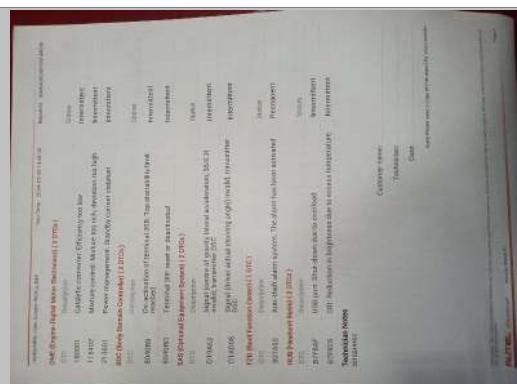

ADDITIONAL 3



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024

VIN: WMWXM920902F19959

7 / 9



ADDITIONAL 4



ADDITIONAL 5



ENGINE 1



ADDITIONAL 10



ADDITIONAL 11



Water level



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024

VIN: WMWXM920902F19959

9 / 9




Front Bumper



Front Bumper



Bonnet

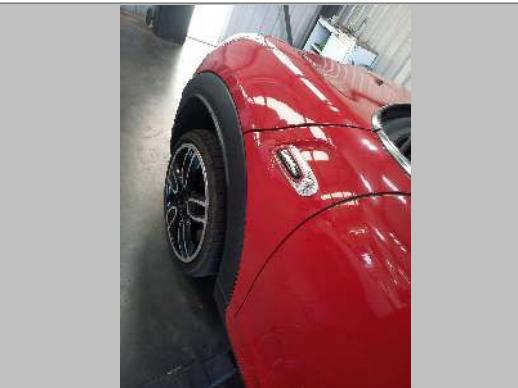

Front Fender Left



Boot Lid / Hatch door



Rear bumper



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024



Rear bumper



Front Fender Right



Rear Fender Right



Door Front Right



Door Front Left



Windscreen



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024



Windscreen Wiper



Engine



Center Console / Cubbyhole + Lid



Seat Front Right



CONDITION REPORT

Report No: 2016244402

DATE
26/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za