



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LX15HYGP
Model	KOMBI T6 SWB 2.0 TDI TRENDLINE MPV DSL 103KW DSG [2017-2020]	Register Number	
		Date Of First Licensing	
VIN	WV2ZZZ7HZJH132637	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2018	Fuel	DIESEL
Km Reading	281,183 KM	Transmission	AUTOMATIC
Cab / Body Type	OTHERS		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:

2017297776

DATE

11/09/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Switch Electrical Window Winder front left Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Replace
Seat Rear Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Repair
Grill Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Residual Traces of Repair	Replace
Sliding Door Residual Traces of Repair	Repair
Roof Paintwork • Scratched	Repair
Brake Piping Torn / Cut	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Ball Joint(s) Front Axle Left Damaged	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Spare Tyre Smooth	Replace
Gearbox Oil Sweat	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Warning lights illuminated	Repair
Body exterior	Residual traces of poor repair on body panels
Body exterior	Minor dents scratches stone chips on body panels
Left sliding door struggling to open.	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.3	4.9	-	
Rear	2.9	2.7	-	
Emergency / Parking	1.7	0.9	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/65R16	95H	Royal black	Mile	V	4923	1 mm
Front Right	205/65R16	95H	Royal black	Mile	V	4923	3 mm
Rear Left	205/65R16	95H	Royal black	Mile	V	4923	0 mm
Rear Right	205/65R16	95H	Royal black	Mile	V	4923	0 mm
Spare	205/60R16	92H	Landsail	LS	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P066E00	CYLINDER 3 GLOW PLUG CONTROL CIRCUIT LOW	
2	AIRBAG	B13BCF2	MULTIPLE COLLISION BRAKE NO FUNCTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026

Car				Car			
Make/Model	Car	Engine pl. no.	Car	Make/Model	Car	Engine pl. no.	Car
Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811
Year	2011	Year	2011	Year	2011	Year	2011
Shock and brake test				Shock and brake test			
Front axle	Left	Right	Result	Front axle	Left	Right	Result
Shock absorber test	Pass	Pass	Pass	Shock absorber test	Pass	Pass	Pass
Brake test	Pass	Pass	Pass	Brake test	Pass	Pass	Pass
Brake force	Left	Right	Result	Brake force	Left	Right	Result
Brake force	8.21 kN	8.21 kN	8.21 kN	Brake force	8.21 kN	8.21 kN	8.21 kN
Brake force	8.21 kN	8.21 kN	8.21 kN	Brake force	8.21 kN	8.21 kN	8.21 kN
Brake force	8.21 kN	8.21 kN	8.21 kN	Brake force	8.21 kN	8.21 kN	8.21 kN

Shock and brake report

Car				Car			
Make/Model	Car	Engine pl. no.	Car	Make/Model	Car	Engine pl. no.	Car
Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811
Year	2011	Year	2011	Year	2011	Year	2011
Diagnostics report				Diagnostics report			
Engine	Pass	Pass	Pass	Engine	Pass	Pass	Pass
Transmission	Pass	Pass	Pass	Transmission	Pass	Pass	Pass
Brake	Pass	Pass	Pass	Brake	Pass	Pass	Pass
Steering	Pass	Pass	Pass	Steering	Pass	Pass	Pass
Wheels	Pass	Pass	Pass	Wheels	Pass	Pass	Pass

Diagnostics report

Car				Car			
Make/Model	Car	Engine pl. no.	Car	Make/Model	Car	Engine pl. no.	Car
Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811
Year	2011	Year	2011	Year	2011	Year	2011
Diagnostics report				Diagnostics report			
Engine	Pass	Pass	Pass	Engine	Pass	Pass	Pass
Transmission	Pass	Pass	Pass	Transmission	Pass	Pass	Pass
Brake	Pass	Pass	Pass	Brake	Pass	Pass	Pass
Steering	Pass	Pass	Pass	Steering	Pass	Pass	Pass
Wheels	Pass	Pass	Pass	Wheels	Pass	Pass	Pass

Diagnostics report

Car				Car			
Make/Model	Car	Engine pl. no.	Car	Make/Model	Car	Engine pl. no.	Car
Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811	Reg. no.	32488811
Year	2011	Year	2011	Year	2011	Year	2011
Diagnostics report				Diagnostics report			
Engine	Pass	Pass	Pass	Engine	Pass	Pass	Pass
Transmission	Pass	Pass	Pass	Transmission	Pass	Pass	Pass
Brake	Pass	Pass	Pass	Brake	Pass	Pass	Pass
Steering	Pass	Pass	Pass	Steering	Pass	Pass	Pass
Wheels	Pass	Pass	Pass	Wheels	Pass	Pass	Pass

Diagnostics report



Sparewheel



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:

2017297776

DATE

11/09/2026



Dipstick location




Automatic transmission



Warning lights illuminated



L/R interior panel loose

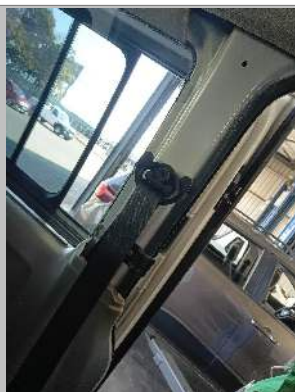

R/R interior panel loose



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:

2017297776

DATE

11/09/2026




REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

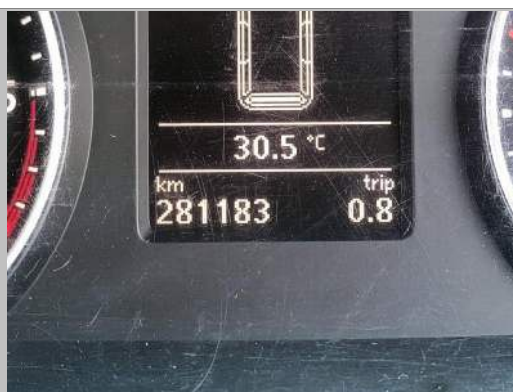

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:

2017297776

DATE

11/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:

2017297776

DATE

11/09/2026



LICENSE DISC



VIN PLATE OR STICKER



REAR



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Seat Front Left



Seat Front Right

Shock absorber test. (MSD33000)				
	left	right	Difference	Weight
Front axle	0,21	0,16	24 %	1359 kg
Rear axle	0,13	0,15	13 %	1021 kg
Total weight				2380 kg

Brake test				
	left	right	Difference	
Front axle	4,35 kN	4,90 kN	11 %	
Parking brake	1,73 kN	0,97 kN	44,5%	
Rear axle	2,95 kN	2,76 kN	6 %	
Final evaluation static				
Deceleration service brake		64 %		Total weight
Deceleration parking brake		12 %		

Parking Brake Performance



Side Mirror Right



Door Front Right



Sliding Door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Rear Fender Right



Boot Lid / Hatch door



Spare Tyre



Roof



Sliding Door



Sliding Door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Seat Rear



Side Mirror Left



Bonnet



Water level



Grill



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Bonnet



Rear bumper




Rear bumper



Rear bumper



Rear bumper

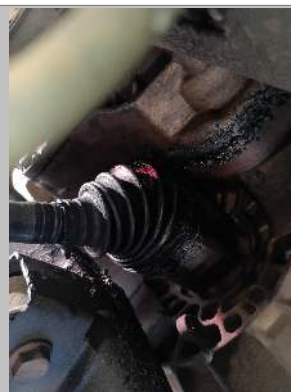

CV Joint(s) Boot(s) Front Left (inner/outer)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Ball Joint(s) Front Axle Left



Gearbox



Gearbox



Engine



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637



CONDITION REPORT



Report No:
2017297776
DATE
11/09/2026



Brake Piping



Brake Piping



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WV2ZZZ7HZJH132637