



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/09/2026		M57 Pretoria Road - 1619
Inspection Date	08/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	MN06MNGP
Model	GOLF 7 2.0 TSI GTI 5-DR DSG [2013-2016]	Register Number	
VIN	WVWZZZAUZFW119882	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2026
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	TWO COAT UNI
Km Reading	140,017 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZFW119882



CONDITION REPORT



Report No:

2017295899

DATE

08/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Defective	Repair
Bonnet stay and shocks Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Windscreen Wiper Damaged	Replace
Headlight Left Defective	Replace
Headlight Right Defective	Replace
Boot Carpet Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Sill Panel Left Residual Traces of Repair	Repair
Roof Residual Traces of Repair	Repair
Windscreen Chipped	Repair
Rim Front Left Scratched	Repair
Engine to silencer pipe Defective	Replace
Silencer Missing	Replace
Catalytic converter Missing	Replace
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
Engine Noise Excessive	Repair
Loose sound wiring inside boot of vehicle	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.79	3.76	-	
Rear	2.39	2.76	-	
Emergency / Parking	1.49	1.69	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZFW119882



CONDITION REPORT



Report No:

2017295899

DATE

08/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/35Z R19	88Y	Royalblack	Explorer	V	0226	2 mm
Front Right	225/35Z R19	88Y	Royalblack	Explorer	V	0226	2 mm
Rear Left	225/35Z R19	88W	Hilo	Vantage	V	0125	4 mm
Rear Right	225/35Z R19	88W	Hilo	Vantage	V	0125	5 mm
Spare	T125/70 R18	99M	Continental	Temporary	V	3514	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P201400	INTAKE MANIFOLD RUNNER POSITION SENSOR/SWITCH CIRCUIT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Signs of Aftermarket performance parts fitted to vehicle.

Electrical Components and Instruments: Signs of front left and right headlight washers leaking.

Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Undercarriage: Non standard exhaust fitted to vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026

Car				Car			
Make/Model				Make/Model			
Year				Year			
Engine				Engine			
Transmission				Transmission			
VIN				VIN			
Test results				Test results			
Brake and shock absorber				Brake and shock absorber			
Pass				Pass			

Brake and shock absorber report

Car				Car			
Make/Model				Make/Model			
Year				Year			
Engine				Engine			
Transmission				Transmission			
VIN				VIN			
Test results				Test results			
Pass				Pass			

Diagnostic report page 1

Car				Car			
Make/Model				Make/Model			
Year				Year			
Engine				Engine			
Transmission				Transmission			
VIN				VIN			
Test results				Test results			
Pass				Pass			

Diagnostic report page 2

Car				Car			
Make/Model				Make/Model			
Year				Year			
Engine				Engine			
Transmission				Transmission			
VIN				VIN			
Test results				Test results			
Pass				Pass			

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

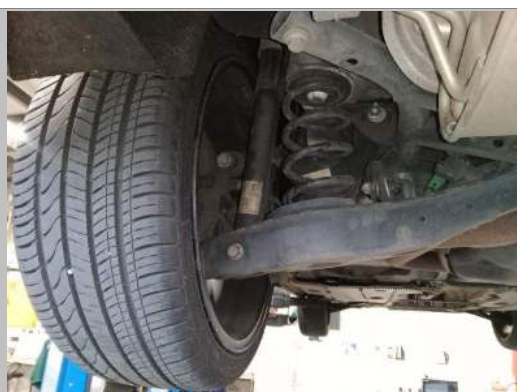

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZFW119882



CONDITION REPORT



Report No:

2017295899

DATE

08/09/2026



Spare Wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Loose sound wiring



Oil cap and dipstick



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Windscreen Wiper




Roof



Boot Carpet



Boot Lid / Hatch door

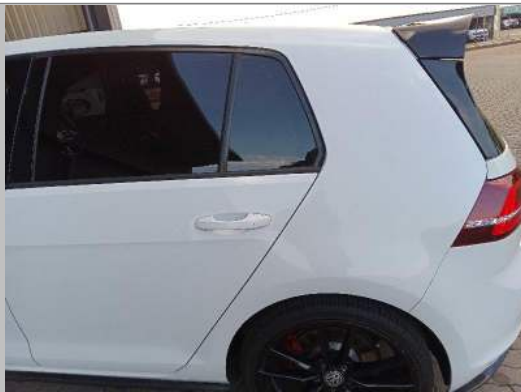

Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Door Front Left



Front Fender Left



Side Mirror Left



Bonnet



Center Console / Cubbyhole + Lid



Bonnet stay and shocks

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Engine Wiring



Hoses



Water level



Engine



Front Fender Right / Inner Tray



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Front Bumper



Headlight Right



Headlight Left



Sill Panel Left



Rim Front Left



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Belly plates



Belly plates



Engine to silencer pipe



Engine to silencer pipe



Silencer



Catalytic converter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZAUZFW119882



CONDITION REPORT



Report No:
2017295899
DATE
08/09/2026



Engine



Engine to silencer pipe



Water level



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZFW119882