



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/12/2025		M57 Pretoria Road - 1619
Inspection Date	09/12/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LM52CWGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
VIN	AHTSS22P407154486	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2025
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	158,467 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025

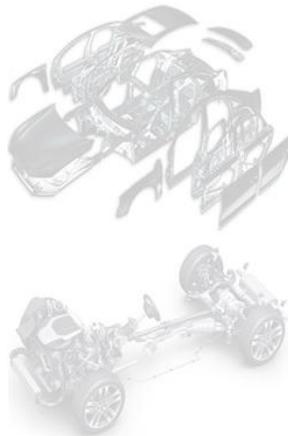

Damage	Repair Way
Engine Oil Leak	Replace
Expansion Bottle Damaged	Replace
Central Air Vent Damaged	Replace
Radio/CD/USB Missing	Replace
Engine Management Lights Set	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Replace
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Windscreen Damaged	Replace
Wheel Cylinder / Caliper 2. Axle left Missing	Replace
Wheel Cylinder / Caliper 2. Axle right Missing	Replace
Brake Pad/Shoe 2. Axle left Damaged	Replace
Brake Pad/Shoe 2. Axle right Damaged	Replace
Brake Drum 2. Axle left Damaged	Replace
Brake Drum 2. Axle right Damaged	Replace
Brake Piping Damaged	Replace
Shock Absorber Rear Left Missing	Replace
Shock Absorber Rear Right Worn	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Gearbox Oil Leak	Replace
Brakes Insufficient	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.63	2.71	-	
Rear	0.0	0.0	-	
Emergency / Parking	0.99	1.08	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15LT	104R	Double King	Radial	V	0824	0 mm
Front Right	195R15LT	104R	Double King	Radial	V	0824	0 mm
Rear Left	195R15C	104S	Toyo	Radial	V	1222	0 mm
Rear Right	195R15C	104R	Firemax	Radial	V	0424	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.
Diagnostic could not be performed due to no data available and or OBD interface malfunction.

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Repair work done to vehicle below standard.
Road Test: vehicle has no handbrake. vehicle has no rear brakes.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025

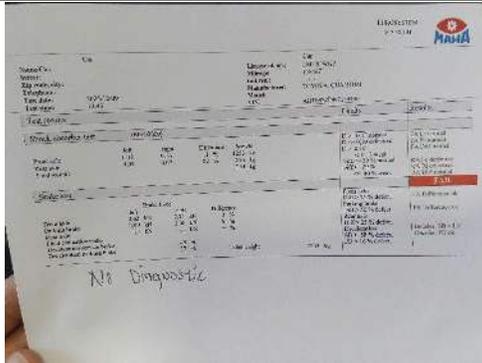

Brake test.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No: 2017096177
DATE 09/12/2025




LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

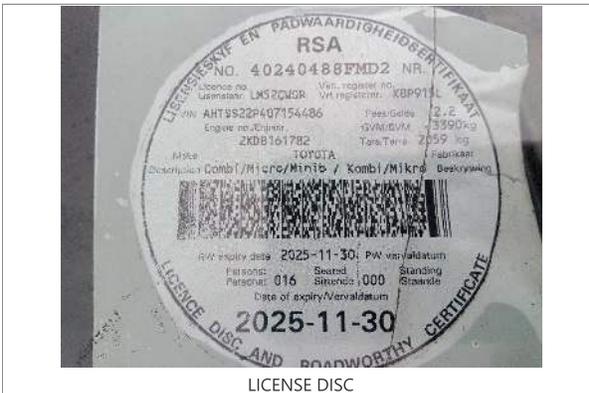

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Expansion Bottle



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Seat Front Right



Seat Rear



Seat Rear (2. Row)



Seat Rear (2. Row)



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Rear Fender Right



Door Front Right



Windscreen



Side Mirror Right



Engine Management Lights



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025




Tail Light Right



Headlight Right



Headlight Left

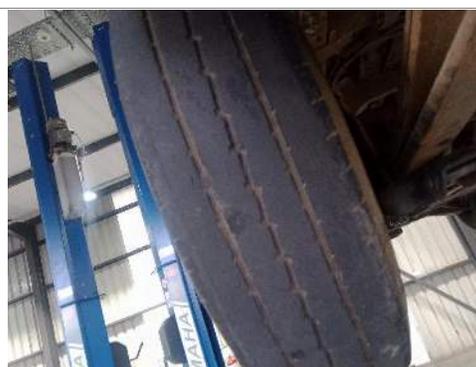

Tyre Rear Left



Tyre Rear Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Tyre Front Right



Engine



Gearbox



Brakes



Brakes



Wheel Cylinder / Caliper 2. Axle left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Wheel Cylinder / Caliper 2. Axle right



Brake Pad/Shoe 2. Axle left



Brake Pad/Shoe 2. Axle right



Brake Drum 2. Axle right



Brake Drum 2. Axle left



Brake Piping

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486



CONDITION REPORT



Report No:
2017096177
DATE
09/12/2025



Shock Absorber Rear Right



Shock Absorber Rear Left



Central Air Vent



Radio/CD/USB

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407154486