

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/02/2024		M57 Pretoria Road - 1619
Inspection Date	23/02/2024		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	BMW	Registration Number	JN48FSGP
Model	328I	Register Number	
VIN	WBA3A56000NR04154	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	136,407 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Shock Absorber Front Left Leak	Replace
Shock Absorber Front Right Leak	Replace
Tyre Rear Left Smooth	Replace
Windscreen washers not working	Repair
Park brake warning light stays illuminated	Repair

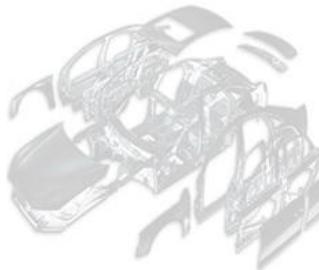

Brakes**Brake Test Results**

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.8	2.9	-	
Rear	2.6	2.7	-	
Emergency / Parking	2.6	3	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R19	89Y	Bridgestone	Potenza	V	2819	1 mm
Front Right	225/40R19	89Y	Bridgestone	Potenza	V	1322	4 mm
Rear Left	255/35R19	92Y	Goodyear	Eagle	V	2019	0 mm
Rear Right	255/35R19	92Y	Bridgestone	Potenza	V	1720	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: MINOR DENTS, SCRATCHES & STONE CHIPS ON VARIOUS BODY PANELS. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

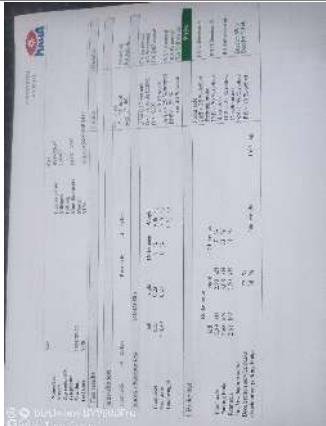

Shock and brake report



Diagnostic report



Diagnostic report



Diagnostic report



Expection bottle



Oil cap



Automatic



No spare wheel



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

VIN: WBA3A56000NR04154

6 / 8



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: WBA3A56000NR04154

7 / 8



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD




LICENSE DISC



VIN PLATE OR STICKER



CHASSIS

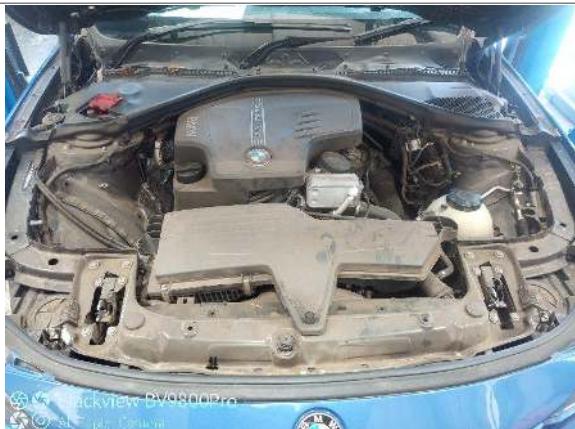

ENGINE 1



ENGINE 2



Water level



Windscreen



Rear Fender Right



Front Bumper



Blackview BV9800Pro
AI Triple Camera

Rear bumper



Blackview BV9800Pro
AI Triple Camera

Tyre Rear Left



Blackview BV9800Pro
AI Triple Camera

Shock Absorber Front Left



Blackview BV9800Pro
AI Triple Camera

Shock Absorber Front Right



CONDITION REPORT

Report No: 2016278566

DATE
23/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za