



CONDITION REPORT



Report No:

2017297678

DATE

11/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	11/09/2026		M57 Pretoria Road - 1619
Inspection Date	11/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	DODGE	Registration Number	DV62LWGP
Model	JOURNEY 3.6 RT AT [2012-2017]	Register Number	
VIN	3C4PDCKG0FT580988	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2027
Color	SILVER	Power / Displacement	
Year Model	2015	Paint Finish	TWO COAT METALLIC
Km Reading	122,140 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:

2017297678

DATE

11/09/2026

Damage

Repair Way

Engine Oil Leak
Under bonnet insulation cover Damaged
Radio/CD/USB Defective
Headlight Right Damaged
Seat Front Right Damaged
Front Bumper Damaged
Bonnet Damaged
Front Fender Left Damaged
Front Fender Right Damaged
Rear Fender Left Damaged
Rear Fender Right Damaged
Door Front Left Damaged
Door Front Right Damaged
Door Rear Left Damaged
Door Rear Right Damaged
Rear bumper Damaged
Roof Damaged
Shock Absorber Front Right Damaged
Stabilizer Mounting Front Right Damaged
Control Arm(s) Front Rear Left Worn
Control Arm(s) Front Rear Right Worn
Control Arm Bush(es) Front Axle Left Worn
Control Arm Bush(es) Front Axle Right Worn
Tyre Front Left Worn
Tyre Front Right Worn
Gearbox Oil Leak

Repair
Replace
Repair
Replace
Replace
Repair
Repair
Repair
Repair
Repair
Repair
Repair
Repair
Repair
Replace
Replace
Replace
Replace
Replace
Replace
Replace
Replace
Replace
Replace
Replace
Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.16	4.27	-	
Rear	3.46	3.44	-	
Emergency / Parking	2.69	2.39	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R19	105W	Landsail	Radial	V	0116	0 mm
Front Right	235/55R19	105V	Hifly	Radial	V	0121	0 mm
Rear Left	235/55R19	105V	Hifly	Radial	V	2321	2 mm
Rear Right	235/55R19	101Y	Goodyear	Eagle	V	3718	2 mm
Spare	T145/70R17	106M	Maxxis	Temporary	V	2914	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C212A-16	SYSTEM CIRCUIT VOLTAGE BELOW THRESHOLD	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 23 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: 3C4PDCKG0FT580988




CONDITION REPORT




Report No:
2017297678
DATE
11/09/2026

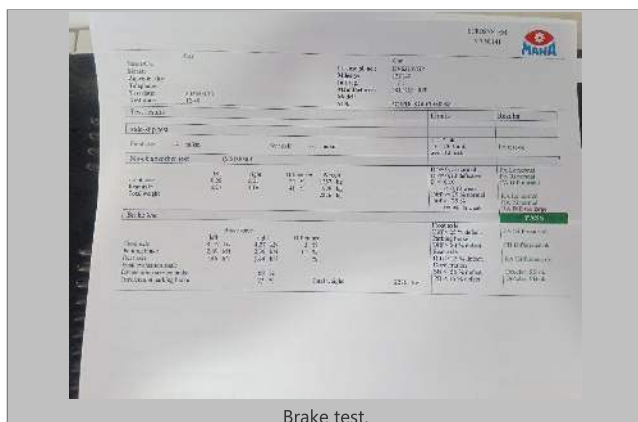

Brake test.

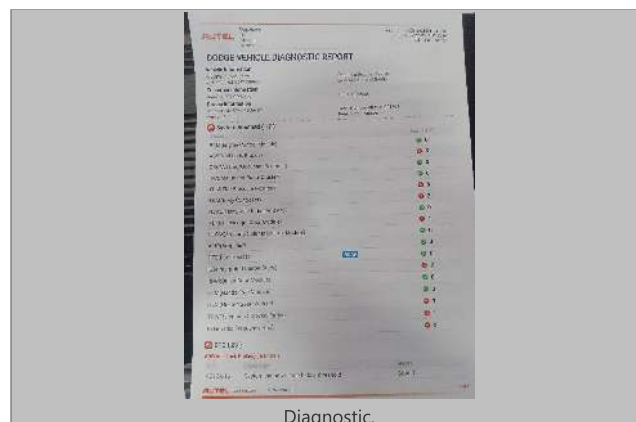

Diagnostic.

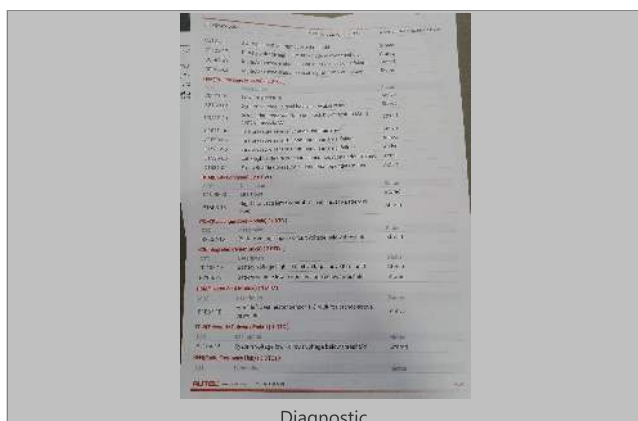


Diagnostic.



Diagnostic.



FRONT RIGHT CORNER

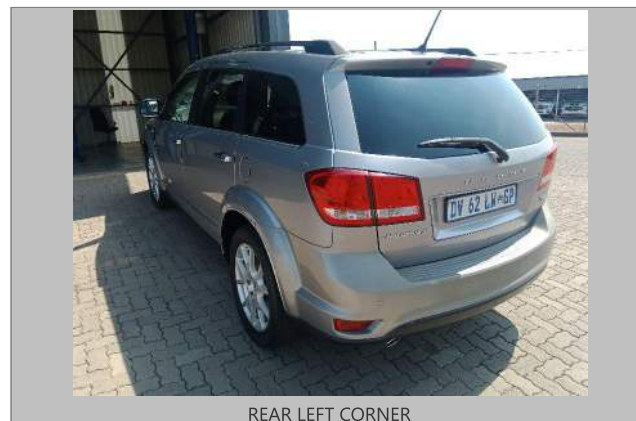

REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



Water level



Under bonnet insulation cover



Headlight Right



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026




Front Fender Left



Door Front Left



Door Rear Left

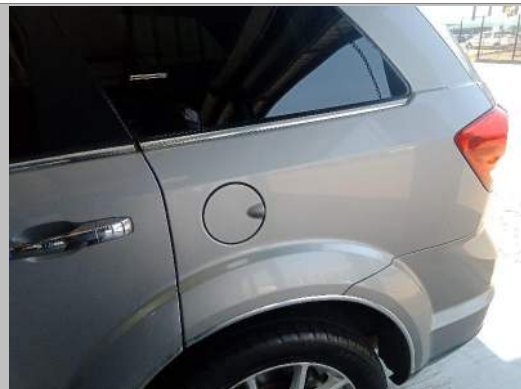

Rear Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026




Door Rear Right



Door Front Right



Front Fender Right

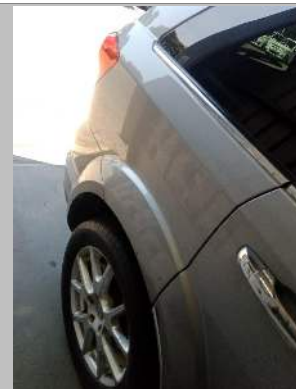

Rear Fender Right



Roof



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988




CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



Gearbox

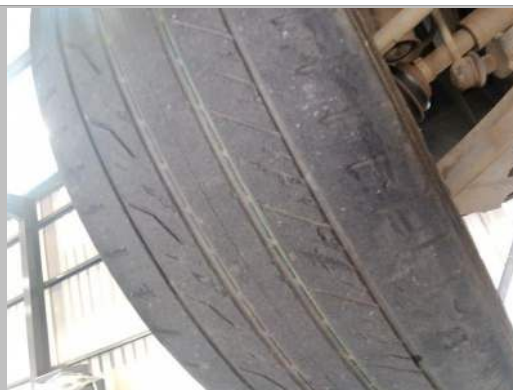

Tyre Front Left



Tyre Front Right



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



Control Arm Bush(es) Front Axle Right



Control Arm(s) Front Rear Left



Control Arm(s) Front Rear Right



Control Arm(s) Front Rear Right



Control Arm(s) Front Rear Left



Shock Absorber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988



CONDITION REPORT



Report No:
2017297678
DATE
11/09/2026



Stabilizer Mounting Front Right



Radio/CD/USB



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: 3C4PDCKG0FT580988