



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KRD404NW
Model	POLO GP 1.2 TSI TRENDLINE 66KW 5-DR [2014-2016]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZFU065054	Last COR	
Engine Number		License Expiry Date	31/01/2023
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2015	Fuel	PETROL
Km Reading	153,842 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026

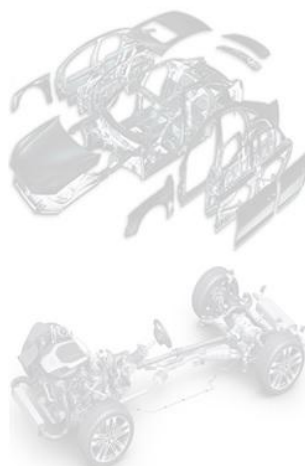

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Air cleaner Damaged	Replace
Air Conditioner Insufficient	Replace
Fog Light Front Left Damaged	Replace
Fog Light Front Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Damaged	Repair
Door Panel Front Left Damaged	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Gear Lever Dust Boot Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Number Plate Front Missing	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Replace
Bonnet Paintwork • Runners / Teardrops	Repair
A • Pillar Right Damaged	Repair
Front Fender Left Dented	Replace
Front Fender Right Damaged	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Chipmarks	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Brake disc 1. Axle left Excessive Wear & Tear	Replace
Spring Front Left Defective	Replace
Spring Front Right Defective	Replace
Spring Rear Left Defective	Replace
Spring Rear Right Defective	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Rim Front Left Dented	Repair
Rim Front Right Dented	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Chassis Dented	Repair
Sub Frame Scratched	Repair
Belly plates Damaged	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:

2017299373

DATE

16/09/2026

Damage

Repair Way

Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair
Gear Selections Malfunction	Repair
Jack Missing	Replace
Warning lights illuminated on dashboard	Repair
Spare Wheel missing	Replace
Firewall insulation cover damaged	Replace
Rear left tyre regrooved	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.67	2.7	-	
Rear	1.74	1.92	-	
Emergency / Parking	1.34	1.69	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40Z R17	84W	Wanli	Sport macro	V	4420	0 mm
Front Right	205/40Z R17	84W	Wanli	Sport macro	V	0521	0 mm
Rear Left	205/40 R17	84W	Dunlop	Sp-Sport	V	2922	0 mm
Rear Right	205/40Z R17	84W	Sunwide	RS-ONE	V	2025	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P261C00	COOLANT PUMP 2 SHORT CIRCUIT TO GROUND	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and panels scratched. Front left seat adjuster handle missing.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:

2017299373

DATE

16/09/2026

Body • Exterior: Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026

SAFARI 4x4			
Model	SAFARI 4x4	Year	2017
Engine	2.0 TDI	Power	150 kW
Transmission	6-Speed	Drive	4x4
Registration	12345678	Color	White
Owner	John Doe	Address	123 Main St, Pretoria
SAFARI 4x4			
Front axle	1. 1.1.1.1	Front axle	1. 1.1.1.1
Shock absorber	1. 1.1.1.1	Shock absorber	1. 1.1.1.1
Brake	1. 1.1.1.1	Brake	1. 1.1.1.1
Steering	1. 1.1.1.1	Steering	1. 1.1.1.1
Engine	1. 1.1.1.1	Engine	1. 1.1.1.1
Transmission	1. 1.1.1.1	Transmission	1. 1.1.1.1
Drive	1. 1.1.1.1	Drive	1. 1.1.1.1
Registration	1. 1.1.1.1	Registration	1. 1.1.1.1
Color	1. 1.1.1.1	Color	1. 1.1.1.1
Owner	1. 1.1.1.1	Owner	1. 1.1.1.1
Address	1. 1.1.1.1	Address	1. 1.1.1.1
12345678	1. 1.1.1.1	12345678	1. 1.1.1.1

Brake and shock absorber report

SAFARI 4x4			
Model	SAFARI 4x4	Year	2017
Engine	2.0 TDI	Power	150 kW
Transmission	6-Speed	Drive	4x4
Registration	12345678	Color	White
Owner	John Doe	Address	123 Main St, Pretoria
SAFARI 4x4			
Front axle	1. 1.1.1.1	Front axle	1. 1.1.1.1
Shock absorber	1. 1.1.1.1	Shock absorber	1. 1.1.1.1
Brake	1. 1.1.1.1	Brake	1. 1.1.1.1
Steering	1. 1.1.1.1	Steering	1. 1.1.1.1
Engine	1. 1.1.1.1	Engine	1. 1.1.1.1
Transmission	1. 1.1.1.1	Transmission	1. 1.1.1.1
Drive	1. 1.1.1.1	Drive	1. 1.1.1.1
Registration	1. 1.1.1.1	Registration	1. 1.1.1.1
Color	1. 1.1.1.1	Color	1. 1.1.1.1
Owner	1. 1.1.1.1	Owner	1. 1.1.1.1
Address	1. 1.1.1.1	Address	1. 1.1.1.1
12345678	1. 1.1.1.1	12345678	1. 1.1.1.1

Diagnostic report page 1

SAFARI 4x4			
Model	SAFARI 4x4	Year	2017
Engine	2.0 TDI	Power	150 kW
Transmission	6-Speed	Drive	4x4
Registration	12345678	Color	White
Owner	John Doe	Address	123 Main St, Pretoria
SAFARI 4x4			
Front axle	1. 1.1.1.1	Front axle	1. 1.1.1.1
Shock absorber	1. 1.1.1.1	Shock absorber	1. 1.1.1.1
Brake	1. 1.1.1.1	Brake	1. 1.1.1.1
Steering	1. 1.1.1.1	Steering	1. 1.1.1.1
Engine	1. 1.1.1.1	Engine	1. 1.1.1.1
Transmission	1. 1.1.1.1	Transmission	1. 1.1.1.1
Drive	1. 1.1.1.1	Drive	1. 1.1.1.1
Registration	1. 1.1.1.1	Registration	1. 1.1.1.1
Color	1. 1.1.1.1	Color	1. 1.1.1.1
Owner	1. 1.1.1.1	Owner	1. 1.1.1.1
Address	1. 1.1.1.1	Address	1. 1.1.1.1
12345678	1. 1.1.1.1	12345678	1. 1.1.1.1

Diagnostic report page 2

SAFARI 4x4			
Model	SAFARI 4x4	Year	2017
Engine	2.0 TDI	Power	150 kW
Transmission	6-Speed	Drive	4x4
Registration	12345678	Color	White
Owner	John Doe	Address	123 Main St, Pretoria
SAFARI 4x4			
Front axle	1. 1.1.1.1	Front axle	1. 1.1.1.1
Shock absorber	1. 1.1.1.1	Shock absorber	1. 1.1.1.1
Brake	1. 1.1.1.1	Brake	1. 1.1.1.1
Steering	1. 1.1.1.1	Steering	1. 1.1.1.1
Engine	1. 1.1.1.1	Engine	1. 1.1.1.1
Transmission	1. 1.1.1.1	Transmission	1. 1.1.1.1
Drive	1. 1.1.1.1	Drive	1. 1.1.1.1
Registration	1. 1.1.1.1	Registration	1. 1.1.1.1
Color	1. 1.1.1.1	Color	1. 1.1.1.1
Owner	1. 1.1.1.1	Owner	1. 1.1.1.1
Address	1. 1.1.1.1	Address	1. 1.1.1.1
12345678	1. 1.1.1.1	12345678	1. 1.1.1.1

Diagnostic report page 3

SAFARI 4x4			
Model	SAFARI 4x4	Year	2017
Engine	2.0 TDI	Power	150 kW
Transmission	6-Speed	Drive	4x4
Registration	12345678	Color	White
Owner	John Doe	Address	123 Main St, Pretoria
SAFARI 4x4			
Front axle	1. 1.1.1.1	Front axle	1. 1.1.1.1
Shock absorber	1. 1.1.1.1	Shock absorber	1. 1.1.1.1
Brake	1. 1.1.1.1	Brake	1. 1.1.1.1
Steering	1. 1.1.1.1	Steering	1. 1.1.1.1
Engine	1. 1.1.1.1	Engine	1. 1.1.1.1
Transmission	1. 1.1.1.1	Transmission	1. 1.1.1.1
Drive	1. 1.1.1.1	Drive	1. 1.1.1.1
Registration	1. 1.1.1.1	Registration	1. 1.1.1.1
Color	1. 1.1.1.1	Color	1. 1.1.1.1
Owner	1. 1.1.1.1	Owner	1. 1.1.1.1
Address	1. 1.1.1.1	Address	1. 1.1.1.1
12345678	1. 1.1.1.1	12345678	1. 1.1.1.1

Diagnostic report page 4



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:

2017299373

DATE

16/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:

2017299373

DATE

16/09/2026




RF TYRE TREAD



Spare Wheel Accessories



LICENSE DISC

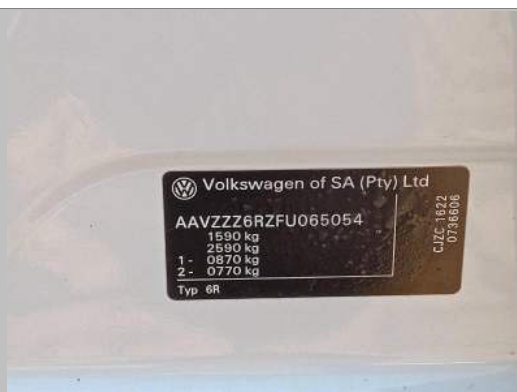

VIN PLATE OR STICKER



ENGINE 1



Front chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Rear chassis



Oil cap and dipstick



Firewall insulation cover



Side Mirror Left



Side Mirror Right



Hood Lining

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026

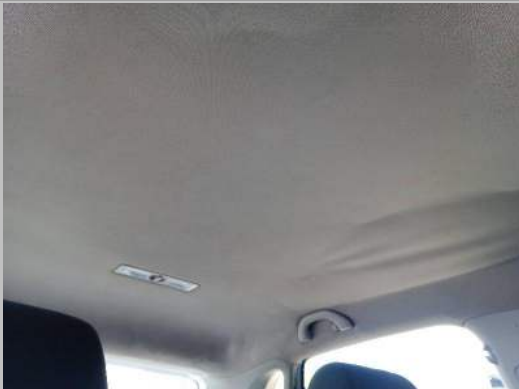

Hood Lining



Steering Wheel Trim



Seat Front Right



Door Sealing Rubber Front Right



Seat Rear



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Seat Front Left



Seat Front Left



Door Sealing Rubber Front Left



Door Panel Front Left



Sill Panel Left



Air Conditioner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Rear Fender Right



Door Rear Right



Door Rear Right



Door Front Right



Side Mirror Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



A • Pillar Right



Windscreen



Rear bumper



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Boot Lid / Hatch door



Boot Lid / Hatch door



Roof



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Door Front Left



Door Front Left



Side Mirror Left



Front Fender Left



Bonnet



Number Plate Front

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Water level



Air cleaner



Spring Front Right



Rim Front Right



Control Arm Bush(es) Front Axle Right



Fog Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Fog Light Front Left



Front Bumper



Front Bumper



Front Bumper



Rim Front Left



Spring Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Control Arm Bush(es) Front Axle Left



Brake disc 1. Axle left




Sill Panel Left



Rim Rear Left



Spring Rear Left

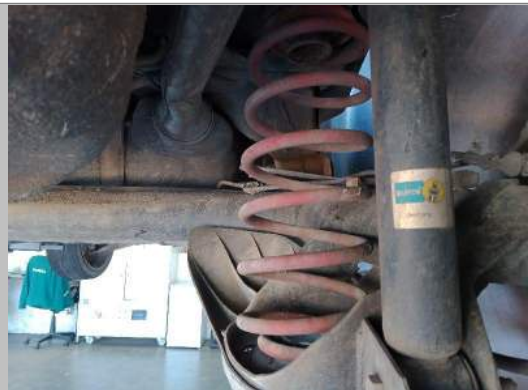

Spring Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Rim Rear Right



Sill Panel Right



Engine



Gearbox



Sub Frame



Sub Frame

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)



Belly plates



Belly plates



Chassis



Chassis



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Tyre Front Left



Engine Wiring




Engine Wiring



Radiator Cradle



Stabilizer Mounting Front Right

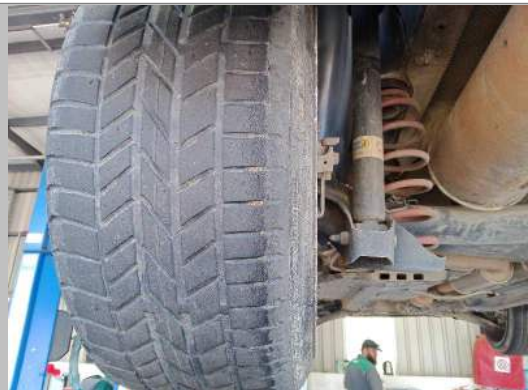

Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZFU065054



CONDITION REPORT



Report No:
2017299373
DATE
16/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Water level



Gear Lever Dust Boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZFU065054