



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/08/2026		M57 Pretoria Road - 1619
Inspection Date	21/08/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JP56RBGP
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2020-2022]	Register Number	
VIN	AAVZZZ6RZLU019081	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2026
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	159,267 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

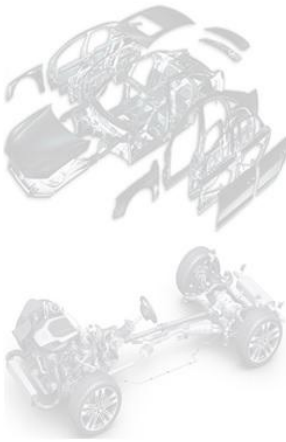

Damage	Repair Way
Engine Oil Leak	Repair
Head Light Switch Defective	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Dirty	Repair
Door Handle Front Left Damaged	Repair
Door Handle Front Right Damaged	Repair
Door Sealing Rubber Front Right Damaged	Replace
Parcel Tray Missing	Replace
Boot Carpet Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Discoloured	Repair
Grill Damaged	Repair
Bonnet Damaged	Repair
A • Pillar Left Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Replace
Front Fender Right / Inner Tray Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Rear Fender Right / Inner Tray Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Damaged	Replace
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle right Excessive Wear & Tear	Replace
Stabilizer Mounting Front Left Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Torn / Cut	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Chassis Damaged	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Damaged	Repair
Radiator Cradle Damaged	Replace
Loose sound wiring inside of vehicle	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

Damage	Repair Way
Front right shock absorber weak	Replace
Front bumper stiffener damaged	Replace
Rear bumper stiffener damaged	Replace
Front and rear tyre sizes different	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.53	2.76	-	
Rear	1.85	1.81	-	
Emergency / Parking	1.2	1.31	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88T	Hankook	Kinergy	V	1723	3 mm
Front Right	175/60 R15	81H	Yokohama	Bluearth	V	2123	2 mm
Rear Left	185/65 R15	88H	Tracmax	X-privilo	V	1723	3 mm
Rear Right	195/60 R15	88H	Sumitomo	HTR 900	V	2320	4 mm
Spare	185/60 R14	82H	Goodyear	Efficient	V	0720	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	09-ENGINE CENTRAL ELECTRIC	03429:011	ACTIVATION OF RIGHT CORNERING LIGHT-OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Signs of rodent in engine bay.Engine bay dirty.
Electrical Components and Instruments: Bright light not working.
Interior: Vehicle interior dirty and panels scratched.
Body • Exterior: Signs of impact damage to front and rear of vehicle.Poor residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081

**CONDITION REPORT**

Report No:
2017287706
DATE
21/08/2026

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

[illegible]

Brake and shock absorber repor

Diagnostic report page 1

Welcome to the... Path: View 2018 >		Test Time: 2020-09-21 09:40:59	Report ID: MA68A202040823084089
56 - Radio (3 DTCs)			
DTC	Description	Status	
00870:01	Left front bass speaker - Open circuit	Active/static	
00871:01	Right front bass speaker - Open circuit	Active/static	
01044:00	Control module incorrectly coded	Passive/Sporadic	

Technician Notes
2017287506

Customer name: _____

Technician: _____

Date: _____

Note: Please keep a copy of this report for your records.

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Loose sound wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Oil cap and dipstick



Front bumper stiffener



Rear bumper stiffener



Steering Wheel Trim



Hood Lining



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Seat Front Right



Seat Rear



Rear Fender Right



Door Rear Right



Door Sealing Rubber Front Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Front Fender Right



Side Mirror Right



Windscreen



Roof



Roof



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Rim Rear Right



Boot Lid / Hatch door



Rear bumper



Rear bumper



Rear bumper



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Door Rear Left



Door Front Left



Front Fender Left



Side Mirror Left



Sill Panel Left



Door Handle Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Seat Front Left



A • Pillar Left



Bonnet



Side Mirror Right



Door Handle Front Right



Head Light Switch

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Parcel Tray



Boot Carpet



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Headlight Right



Water level



Engine



Tyre Front Right



Brake disc 1. Axle right



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

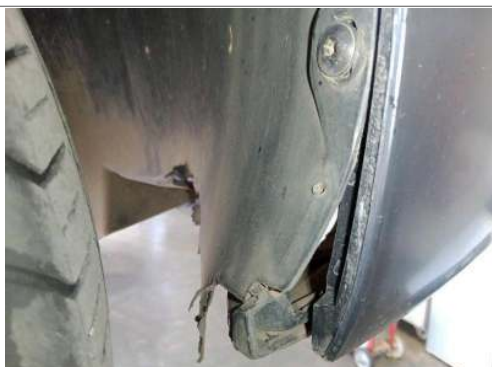

Front Fender Right / Inner Tray



Grill



Grill



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Rim Front Left



Front Fender Left / Inner Tray



Control Arm Bush(es) Front Axle Left



Rim Rear Left



Tyre Rear Left



Bolt(s) / Nut(s) Rear Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026

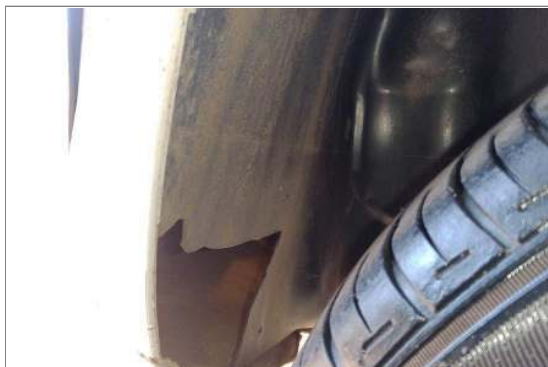

Rear Fender Right / Inner Tray



Sill Panel Right




Engine to silencer pipe



Radiator Cradle



Radiator Cradle

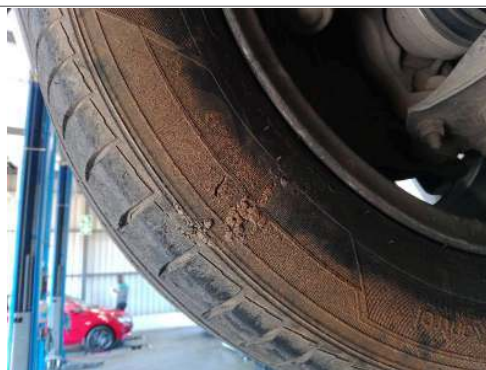

Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Stabilizer Mounting Front Left



Sub Frame



Sub Frame



Chassis



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081



CONDITION REPORT



Report No:
2017287706
DATE
21/08/2026



Tyre Rear Right



Rear Fender Left / Inner Tray



Inner Boot Floor Pan and Spare Wheel Well



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU019081