



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LF92DMGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2022-2024]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZPU014425	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2023	Fuel	PETROL
Km Reading	112,938 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:

2017296938

DATE

10/09/2026

Damage

Repair Way

Radiator Damaged	Repair
Battery clamps Damaged	Repair
Air conditioner pipes Damaged	Repair
Indicator Light Front Left Damaged	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
C • Pillar Right Damaged	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Paintwork • Scratched	Repair
Tyre Front Left Excessive Wear & Tear	Replace
Rim Front Left Deformed	Repair
Rim Front Right Deformed	Repair
Rim Rear Left Deformed	Repair
Radiator Cross Member Damaged	Replace
Body exterior	Residual traces of repair work on body panels
Body exterior	Minor dents scratches stone chips on body panels
Body exterior	Signs of spray work done on body panels
Rear tyre size differs	Replace
Front suspension excessive knocking noise	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.9	-	
Rear	0.8	1.7	-	
Emergency / Parking	0.3	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R14	82H	Annaite	AN600	V	2424	0 mm
Front Right	185/60R14	82H	Goodyear	Efficient	V	1523	2 mm
Rear Left	185/70R14	88T	Jk tyre	Vectra	V	3580	2 mm
Rear Right	185/60R14	82H	Goodyear	Efficient	V	1523	3 mm
Spare	175/70R14	84T	Continental	Contact	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AAVZZ6RZPU014425



CONDITION REPORT



Report No:

2017296938

DATE

10/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	U112100	DATA BUS MESSAGE MISSING	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZPU014425



CONDITION REPORT




Report No:
2017296938
DATE
10/09/2026

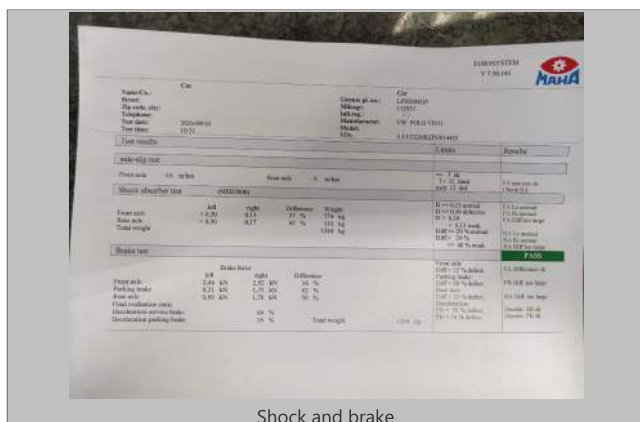

Shock and brake



Diagnostics

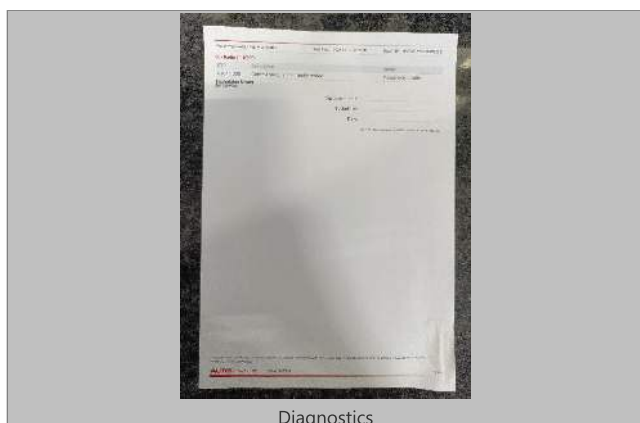


Diagnostics



Sparewheel



Expansion bottle

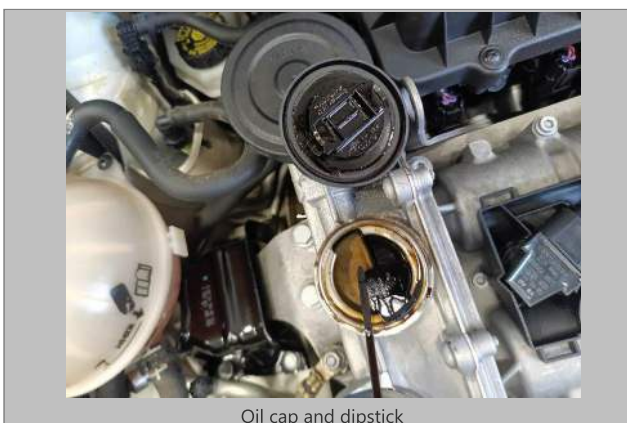

Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026

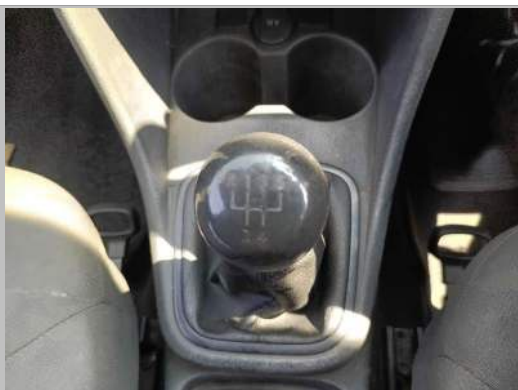

Manual transmission



L/F fender liner missing



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014425



CONDITION REPORT



Report No:


2017296938

DATE

10/09/2026



ODOMETER

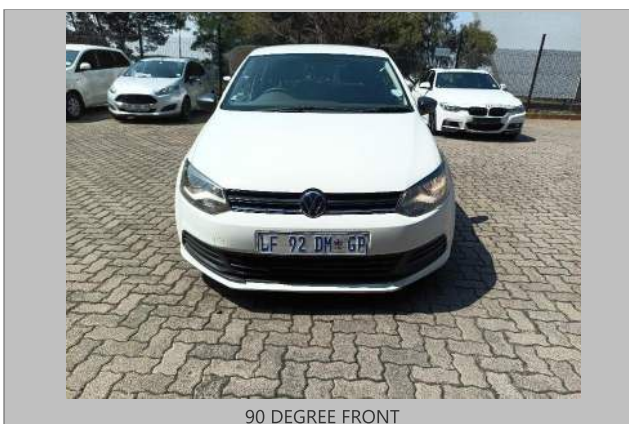

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:


2017296938

DATE

10/09/2026



LR TYRE TREAD

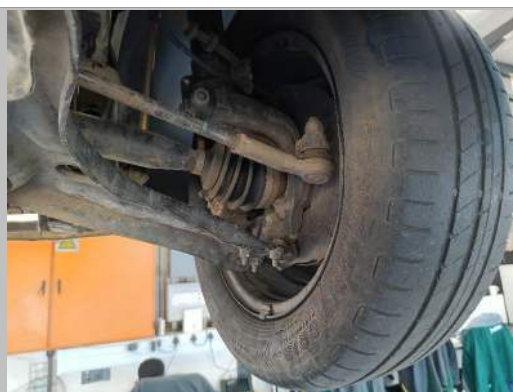

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014425



CONDITION REPORT




Report No:
2017296938
DATE
10/09/2026



ENGINE 1



ENGINE 2

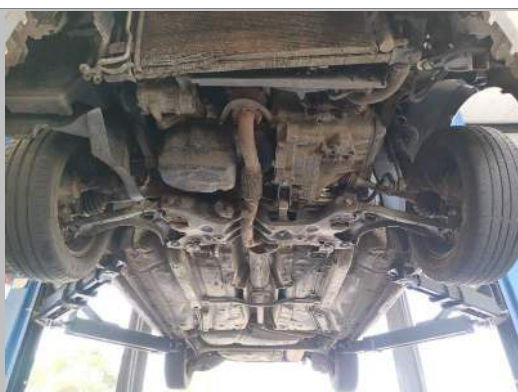

CHASSIS



Front Fender Right



Seat Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026



C • Pillar Right



Door Rear Left



Door Front Left



Front Fender Left



Battery clamps



Battery clamps

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026



Water level



Sill Panel Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026



Grill



Grill



Rim Front Left



Tyre Front Left



Rim Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026



Rear bumper



Rear bumper



Radiator



Radiator



Air conditioner pipes



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425



CONDITION REPORT



Report No:
2017296938
DATE
10/09/2026



Radiator Cross Member



Sill Panel Left



Rim Front Right



Indicator Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014425