



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LK46KMGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2023-2024]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZPU022469	Last COR	
Engine Number		License Expiry Date	31/03/2026
Doors	5	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2023	Fuel	PETROL
Km Reading	254,631 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:

2017299375

DATE

16/09/2026

Damage

Repair Way

Tail Light Left Damaged	Replace
Number Plate Light Right Missing	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Rear Dirty	Repair
Seat Belt Front Right Excessive Wear & Tear	Repair
Parcel Tray Missing	Replace
Rear Upper Valance Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Damaged	Replace
Bonnet Dented	Replace
Front Fender Right Dented	Repair
Rear Fender Left / Inner Tray Deformed	Repair
Door Front Right Dented	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Rim Front Left Deformed	Repair
Rim Front Right Deformed	Repair
Radiator Cross Member Deformed	Repair
Warning lights illuminated	Repair
Rear impact damage	Repair
radiator is loose	Repair
Rear tyre size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	3.1	-	
Rear	1.6	1.8	-	
Emergency / Parking	0.7	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R14	82H	Anchee	AC808	V	3025	0 mm
Front Right	185/60R14	82H	Anchee	AC808	V	3025	0 mm
Rear Left	165/80R14	85T	Ovation	Ecovision	V	4624	3 mm
Rear Right	185/60R14	82H	Anchee	AC808	V	0928	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AAVZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B10061B	DRIVER SEAT BELT TENSIONER IGNITER RESISTANCE TOO	
2	ENGINE CONTROL MODULE	P1609:00/05641:000	CRASH SHUT- OFF WAS TRIGGERED	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:

2017299375

DATE _____

16/09/2026



Shock and brake report



Diagnostics report




Diagnostics report



Diagnostics report



FRONT RIGHT CORNER

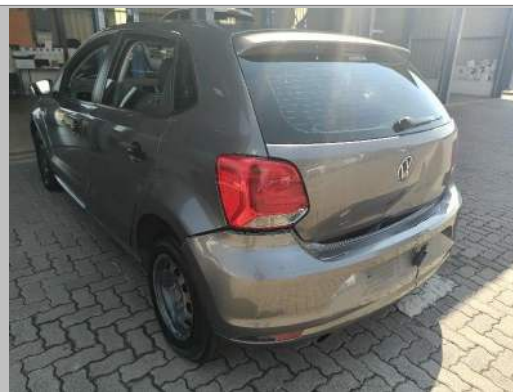

REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:

2017299375

DATE

16/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

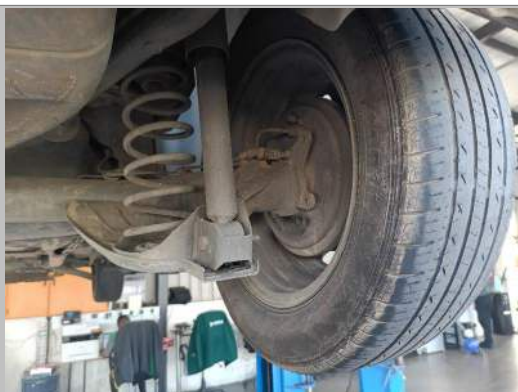

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



No sparewheel




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

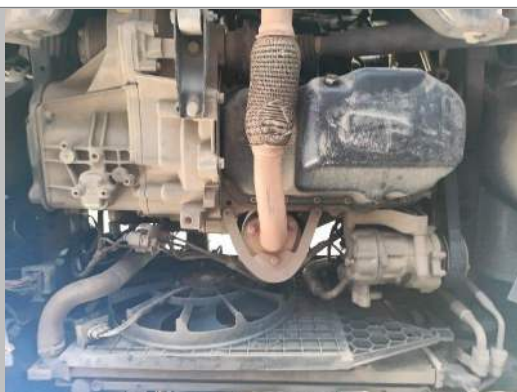

ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026




REAR



Sparewheel well dent



Interior sill cover missing

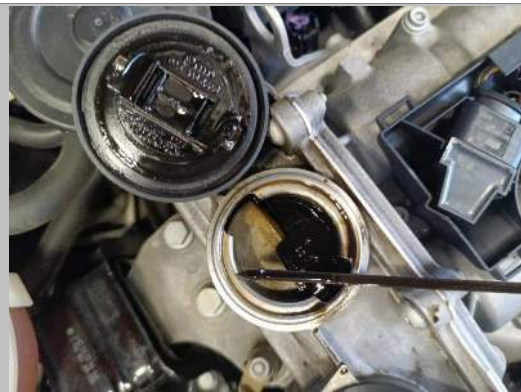

Oil cap and dipstick



Expansion bottle



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Sparewheel well damaged



left rear reflector crack



Front Fender Right



Door Front Right



Windscreen



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Rear Upper Valance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Rear Upper Valance



Rear Upper Valance



Windscreen



Bonnet



Grill



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Headlight Left



Headlight Left



Headlight Right



Rim Front Right



Rim Front Right



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Control Arm Bush(es) Front Axle Right



Tyre Front Right



Front Bumper



Front Bumper



Grill



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Tyre Front Left



Rim Front Left



Number Plate Light Right



Rear bumper



Rim Front Right



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469



CONDITION REPORT



Report No:
2017299375
DATE
16/09/2026



Rear Fender Left / Inner Tray



Seat Belt Front Right



Seat Rear



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU022469