



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/12/2025		M57 Pretoria Road - 1619
Inspection Date	08/12/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KYR291MP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2023-2024]	Register Number	
VIN	AAVZZZ6RZPU024783	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2026
Color	SILVER	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	45,473 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: AAVZZZ6RZPU024783



## CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025

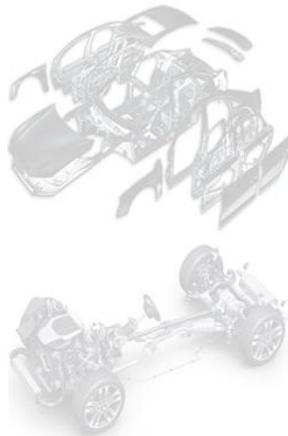

Damage	Repair Way
Engine Oil Sweat	Repair
Tail Light Left Damaged	Replace
Hood Lining Damaged	Repair
Parcel Tray Damaged	Repair
Steering Wheel Trim Excessive Wear & Tear	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Damaged	Repair
Tyre Rear Left Damaged	Replace
Belly plates Damaged	Replace
CV Joint(s) Front Right (inner/outer) Defective	Repair
Radiator Cradle Damaged	Repair

## Brakes

### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.95	2.53	-	
Rear	1.26	1.34	-	
Emergency / Parking	0.99	0.93	-	

## Tyres and Rims

### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	84H	Continental	Contipremuim	V	3524	4 mm
Front Right	185/60 R15	84H	Continental	Contipremuim	V	3023	2 mm
Rear Left	185/60 R15	84H	Continental	Contipremuim	V	2123	4 mm
Rear Right	185/60 R15	84H	Continental	Contipremuim	V	0325	6 mm
Spare	185/60 R14	82H	Goodyear	Efficient	V	2623	5 mm

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



## CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	09-ELECTRONIC CENTRAL ELECTRIC	00532:002	SUPPLY VOLTAGE-LOWER LIMIT NOT REACHED	

### Inspection Conditions

No Test Drive  
Rain at time of inspection  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and some panels scratched  
Body • Exterior: Dents and scratches on some body panels  
Undercarriage: Oil sweat on front right inner CV joint. Vehicle undercarriage dirty

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783





CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No: 2017095089  
DATE 08/12/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



Hood Lining



Steering Wheel Trim



Rear Fender Right



Rear Fender Right



Door Rear Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



Front Fender Right



Side Mirror Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



Rear Fender Left



Rear Fender Left



Door Rear Left



Door Rear Left



Parcel Tray



Tail Light Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



Tail Light Left



Engine



Water level



Front Bumper



Tyre Rear Left



Sill Panel Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783



CONDITION REPORT



Report No:  
2017095089  
DATE  
08/12/2025



Sill Panel Right



CV Joint(s) Front Right (inner/outer)



Belly plates



Radiator Cradle



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZPU024783