



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/12/2023		M57 Pretoria Road - 1619
Inspection Date	20/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	HMW867FS
Model	POLO TSI	Register Number	
VIN	AAVZZZAWZKU044630	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	164,724 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Tie Rod End right Damaged	Replace
Rim Front Right Dented	Repair
Tyre pressure warning light illuminated.	Report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU044630

1 / 9



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.7	-	
Rear	1.0	2.5	-	
Emergency / Parking	0.1	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88H	Royal Black	Royal mile	V	0123	3 mm
Front Right	185/70R14	88H	Royal black	Royal mile	V	0123	4 mm
Rear Left	185/70R14	88H	Royal Black	Royal mile	V	0123	4 mm
Rear Right	185/70R14	88H	Royal Back	Royal mile	V	0123	5 mm
Spare	185/65R14	86H	Diamond	Dem1	V	//////	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Minor dents scratches and

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No. 2016207160

2 / 9

DATE


20/12/2023



Shock and brake report



Diagnostic test

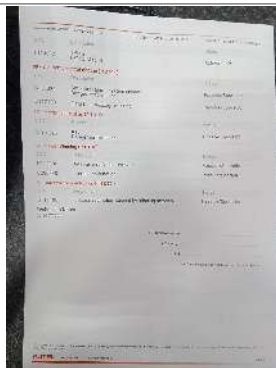

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160
VIN: AAVZZZAWZKU044630
DATE
3/6
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
VIN: AAVZZZAW76102023


4/9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

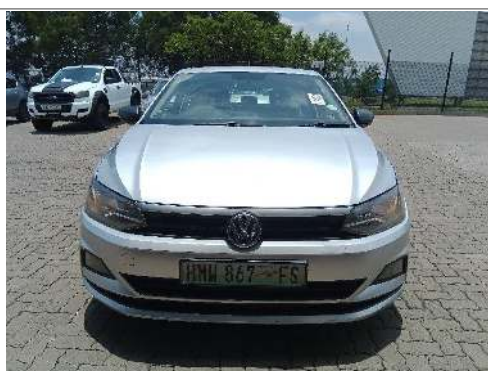

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016207160****DATE**
20/12/2023

VIN: AAVZZZAWZKU044630

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

VIN: AAVZZZAWZKU044630

6 / 9



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

VIN: AAVZZZAWZKU044630

7 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

VIN PLATE OR STICKER



ENGINE 1

VIN: AAVZZZAWZKU044630

8 / 9



ENGINE 2



CHASSIS



Rear end



Oil cap and dipstick



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

VIN: AAVZZZAWZKU044630
9 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

Tyre pressure warning light



Manual



Expansion bottle



Windscreen



Front Fender Left



Water level



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

Front Bumper



Front Bumper



Rear bumper



Door Rear Right



Tie Rod End right



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207160

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016207160

DATE
20/12/2023

Seat Front Right



Seat Front Left

**CONDITION REPORT****Report No: 2016207160****DATE**
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za