



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/11/2025		M57 Pretoria Road - 1619
Inspection Date	10/11/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KTL916MP
Model	POLO 1.0 TSI 70KW 5-DR [2022-2024]	Register Number	
VIN	AAVZZZAWZPU038403	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2026
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT UNI
Km Reading	73,036 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025

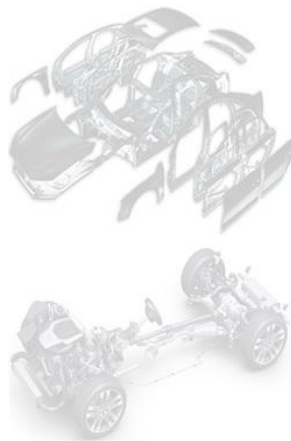

Damage

Repair Way

Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Window Rear Door Right Damaged	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Left Worn	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.33	2.98	-	
Rear	1.66	1.09	-	
Emergency / Parking	0.1	1.12	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Xcent	Radial	V	3824	2 mm
Front Right	185/65R15	88H	Xcent	Radial	V	3824	2 mm
Rear Left	185/65R15	88H	Goodyear	Efficient	V	4122	0 mm
Rear Right	185/65R15	88H	Goodyear	Efficient	V	4122	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AGENT CONTROL MODULE 1	P06EF00	ENGINE RESTART PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 11 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: bonnet slam plate plastic cover damaged. Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025

VEHICLE INFORMATION			
Make/Model	Volvo	Year	2017
Engine	1.6	Power	115 kW
Transmission	Manual	Drive	Front
Registration	AAVZZZ	Color	White
Inspection	10/11/2025	Inspector	DEKRA
BRAKE TEST RESULTS			
Wheel	Speed (km/h)	Brake Pressure (bar)	Brake Force (kN)
Front Left	100	1.2	15.5
Front Right	100	1.1	14.8
Rear Left	100	0.8	10.2
Rear Right	100	0.7	9.5
STEERING & SUSPENSION			
Steering	Alignment	Wear	Condition
Front	0.1°	Low	Good
Rear	0.2°	Low	Good
Suspension	Shock Absorbers	Coil Springs	Stabilizer
Front	Good	Good	Good
Rear	Good	Good	Good

Brake test.

VEHICLE INSPECTION REPORT	
Vehicle Make/Model	Volvo V40
Year	2017
Engine	1.6
Transmission	Manual
Drive	Front
Registration	AAVZZZ
Color	White
Inspection Date	10/11/2025
Inspector	DEKRA
INSPECTION RESULTS	
Exterior	Good
Interior	Good
Engine	Good
Transmission	Good
Drive	Good
Brakes	Good
Steering	Good
Suspension	Good
Wheels/Tyres	Good
Lighting	Good
Sound	Good
Overall	Good

Diagnostic.

VEHICLE INSPECTION REPORT	
Vehicle Make/Model	Volvo V40
Year	2017
Engine	1.6
Transmission	Manual
Drive	Front
Registration	AAVZZZ
Color	White
Inspection Date	10/11/2025
Inspector	DEKRA
INSPECTION RESULTS	
Exterior	Good
Interior	Good
Engine	Good
Transmission	Good
Drive	Good
Brakes	Good
Steering	Good
Suspension	Good
Wheels/Tyres	Good
Lighting	Good
Sound	Good
Overall	Good

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



Rear Fender Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403



CONDITION REPORT



Report No:
2017067165
DATE
10/11/2025



Front Fender Right



Rear Fender Right



Window Rear Door Right



Tyre Rear Left



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU038403