



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/09/2026		M57 Pretoria Road - 1619
Inspection Date	04/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	KPF527MP
Model	D-MAX 3.0 DDI HR LSE D-CAB DSL PU AT [2022-2023]	Register Number	
		Date Of First Licensing	
VIN	ACVTFR40JMD092268	Last COR	
Engine Number		License Expiry Date	30/06/2027
Doors	4	Power / Displacement	
Color	BLACK	Paint Finish	TWO COAT METALLIC
Year Model	2022	Fuel	DIESEL
Km Reading	98,915 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026

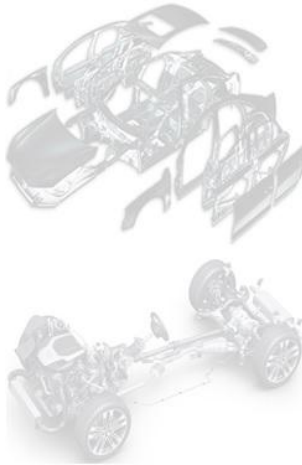

Damage	Repair Way
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.14	5.16	-	
Rear	3.23	3.7	-	
Emergency / Parking	3	4.29	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110H	General	Radial	V	0722	2 mm
Front Right	265/60R18	110H	General	Radial	V	0722	2 mm
Rear Left	265/60R18	110H	General	Radial	V	3023	3 mm
Rear Right	265/60R18	110H	General	Radial	V	0722	2 mm
Spare	265/60R18	110T	Continental	Crosscontact	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	U0136_87	LOSS COMMUNICATION WITH DLC	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Undercarriage: bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVTFR40JMD092268




CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026

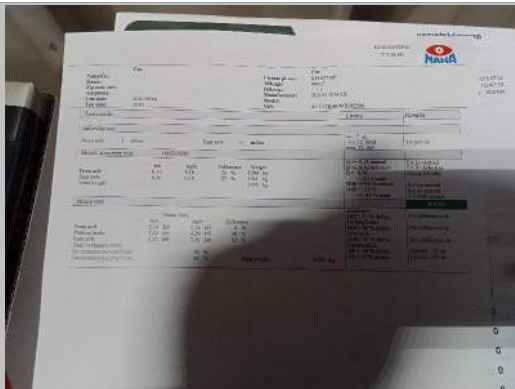

Brake test.

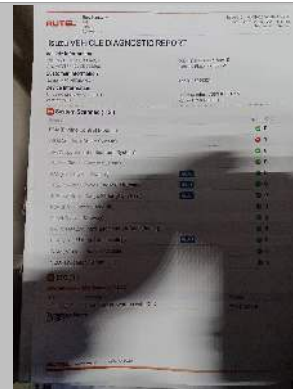

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026



LF TYRE TREAD



RR TYRE TREAD



LR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:
2017294644
DATE
04/09/2026



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268



CONDITION REPORT



Report No:

2017294644

DATE

04/09/2026



Rear bumper



Rear bumper



Tailgate



Rear Fender Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFR40JMD092268